

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22002383/KNY3M4**Date:** 10/08/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSNW00014152207

Claimant Vehicle No : SMF134L **Insured Vehicle No :** SGV68G

Date of Loss: 11/03/2022 Nature of Claim: TP Claim No: SNM22D201729/C02/LEEPG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMF134L**

Make & Model: HONDA VEZEL, 1.5 X CVT ABS D/AIRBAG 2WD 5DR (A) Engine No: L15B5552997

Reg. Date: 25/10/2018 (Man. Year: 2018) Chassis No: RU11302990

Colour: Metallic Black Odometer: 72385 km

Engine Capacity: 1496 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/60 R16 Rear Tyre Size: 215/60 R16

Front Left Side: Fireza 8 mm Rear Left Side: Dunlop 5 mm

Front Right Side: Fireza 8 mm Rear Right Side: Dunlop 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	12,564.00	10,932.96	1,631.04	12.98
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,700.00	2,930.00	2,770.00	48.60
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	18,264.00	13,862.96	4,401.04	24.10
+ GST 7.00/7.00% (S\$)	1,278.48	970.41	308.07	24.10
Nett Amount (S\$)	19,542.48	14,833.37	4,709.11	24.10

INSPECTION

Date of Assignment: 15/03/2022

Date Inspected: 15/03/2022 Inspected At: Cartimes Autolution Pte Ltd
160 Sin Ming Drive #02-04 Autocity,
Singapore 575722

Estimated Period of Repair: 12.0 days

Adjuster: KENNETH KONG**Manager:** HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Different 1 cent -Finalise confirm amount: \$13,862.95

REPAIR DETAILS**Reference****Part Source:** MRM-SG Version: 1.0 (Last Synchronised: 10 Aug 2022)**Parts:** 144 HONDA VEZEL 1.5 X CVT ABS D/AIRBAG 2WD 5DR (A) (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** (Unsubmitted, no print-code for SMF134L)**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Recommended Parts**

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Bent	810.00 FL	*762.30 FL
2	1		*FRONT BUMPER RETAINER LHS	Distorted	30.00 FL	*30.00 FL
3	1		*FRONT BUMPER RETAINER RHS	Distorted	30.00 FL	*30.00 FL
4	1		*FRONT BUMPER GRILLE	Cracked	200.00 FL	*200.00 FL
5	1		*FRONT BUMPER GRILLE OUTER GARNISH	Cracked	230.00 FL	*230.00 FL
6	1		*FRONT BUMPER LOWER SPOILER	Distorted	360.00 FL	*360.00 FL
7	1		*FRONT HONDA EMBLEM	Missing	30.00 FL	*30.00 FL
8	1		*FOG LAMP COVER LHS	Dented	60.00 FL	*60.00 FL
9	1		*FOG LAMP COVER RHS	Serviceable	60.00 FL	*- FL
10	1		*FOG LAMP LHS	Serviceable	270.00 FL	*- FL
11	1		*FOG LAMP RHS	Serviceable	270.00 FL	*- FL
12	1		*HEADLAMP LHS	Mtg Broken	1,930.00 FL	*1,859.10 FL
13	1		*HEADLAMP RHS	Mtg Broken	1,930.00 FL	*1,859.10 FL
14	1		*HEADLAMP BRACKET LHS	Cracked	50.00 FL	*50.00 FL
15	1		*HEADLAMP BRACKET RHS	Repair	50.00 FL	*- FL
16	1		*FRONT BUMPER REINFORCEMENT	Bent	290.00 FL	*290.00 FL
17	1		*SUPPORT PANEL	Bent	440.00 FL	*440.00 FL
18	1		*BONNET	Bent	800.00 FL	*800.00 FL
19	1		*BONNET RUBBER TRIM	Cut	220.00 FL	*120.00 FL
20	1		*BONNET INSULATION	Cracked	160.00 FL	*160.00 FL
21	1		*BONNET LOCK ASSY	Bent	150.00 FL	*150.00 FL
22	1		*BONNET HINGE LHS	Distorted	70.00 FL	*70.00 FL
23	1		*BONNET HINGE RHS	Distorted	70.00 FL	*70.00 FL
24	1		*FRONT WHEEL ARCH MOULDING LHS	Buckled	180.00 FL	*180.00 FL
25	1		*BONNET CENTRE BRACKET	Bent	80.00 FL	*80.00 FL
26	1		*CONDENSOR	Bent	620.00 FL	*620.00 FL
27	1		*RADIATOR	Bent / Punctured	1,400.00 FL	*1,250.70 FL
28	1		*RADIATOR CROWNING	Cracked	160.00 FL	*160.00 FL
29	1		*WIPER RESERVOIR	Dented	120.00 FL	*120.00 FL
30	1		*RESONATOR	Cracked	180.00 FL	*180.00 FL
31	1		*WIPER COWL	Cracked	260.00 FL	*260.00 FL
32	1		*FRONT BUMPER LOWER GRILLE	Distorted	180.00 FL	*180.00 FL
33	1		*FRONT BUMPER CENTRE BRACKET TOP	Bent	160.00 FL	*160.00 FL
34	1		*REINFORCEMENT TOP RUBBER GARNISH	Cracked	80.00 FL	*80.00 FL
35	1		*SUPPORT PANEL BUSHING (LOWER)	Missing	60.00 FL	*60.00 FL
36	1		*RADAR	Dented	2,550.00 FL	*1,850.00 FL
37	1		*BATTERY HOLDER (LOWER)	Cracked	50.00 FL	*50.00 FL
38	1		*SUPPORT PANEL TOP BRACKET LHS	Bent	50.00 FL	*50.00 FL
39	1		*SUPPORT PANEL TOP BRACKET RHS	Bent	50.00 FL	*50.00 FL
40	1		*FRONT AIR GUIDE	Cracked	160.00 FL	*160.00 FL
41	1		*OIL COOLER	Bent	300.00 FL	*300.00 FL
42	1		*AMBIENT SENSOR	Cracked	180.00 FL	*180.00 FL
43	1		*FRONT SENSORS	No such part	200.00 FS	*- FS
44	1		*CARPLATE W/HOLDER	Missing	40.00 FS	*40.00 FS
45	1		*SET BUMPER CLIPS	Necessary	60.00 FS	*60.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; REPLACE DAMAGED PARTS AND COMPONENTS	New	2,500.00	1,200.00
2	TO SUPPLY PAINT MATERIALS, EXPANDABLE ITEMS & PUTTY, RESPRAY PAINT ON PARTS REPLACED & REPAIRED	New	2,500.00	1,300.00
3	TO REMOVE AND RE-FIX WIRING AND CHECK ALL ELECTRICAL COMPONENTS AT DAMAGED AREAS FOR PROPER FUNCTIONS	New	100.00	20.00
4	TO PROVIDE ANTI-RUST TREATMENT ON AFFECTED AREAS	New	100.00	60.00
5	REMOVE & REFIT ENGINE	New	400.00	250.00
6	TOP UP AIRCON GAS	New	100.00	100.00
Gross Labour Cost (\$\$)			5,700.00	2,930.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >