

Vehicle Damage Assessment Report for [SKT9026G]

Estimate Created: 21/03/2022 02:00 by LKK_admin-a
(LKK_Auto_Consultants_Pte_Ltd)

Owned: 04/10/2022 04:07 by LKK_cs-a (LKK_Auto_Consultants_Pte_Ltd)

General Information

Insurance Company		Claim Number
Claim Type	TP	
Workshop	LKK_Auto_Consultants_Pte_Ltd	Reference Number

Vehicle Information

Brand	Lexus	Model	UX
Engine Type			
License Plate Number	SKT9026G	VIN (or Chassis #)	

Vehicle Condition

Damaged Diagram	Odometer	36,741.00 Km
	Tyres Condition	
	Front Left	mm
	Front Right	mm
	Rear Left	mm
	Rear Right	mm

Comments

- Final review based on information provided by LKK Auto Consultants Pte Ltd:
Concluded lump sum repair of \$23353.4 with 8 working days.

Insurlogic 4 (04/10/2022 04:04)

Materials

Description	Number/Type	Qty	Cost	Markup/Disc.%	Sum
SUNDRIES		1.0	50.00	0.00 %	50.00
SEALANT		1.0	100.00	0.00 %	100.00
GRILLE SUB ASSY		1.0	1311.00	0.00 %	1,311.00
TAPE MOULDING NO.1		1.0	111.00	0.00 %	111.00
GUARD ,FR BUMPER		1.0	411.10	0.00 %	411.10
BRACKET ,FR BUMPER		1.0	170.70	0.00 %	170.70
RETAINER ,ULTRASONIC		1.0	44.10	0.00 %	44.10
RETAINER ,ULTRASONIC		1.0	44.10	0.00 %	44.10
RETAINER ,OUTSIDE		1.0	16.80	0.00 %	16.80
CLIP		1.0	40.50	0.00 %	40.50
GLASS SUB-ASSY ,BACK		1.0	1395.30	0.00 %	1,395.30
MOULDING ,BACK		1.0	34.30	0.00 %	34.30
SPACER ,QUARTER		1.0	31.00	0.00 %	31.00
W/SCREEN DAM KIT		1.0	128.50	0.00 %	128.50
SIKA 182010 SIKA TACK GO (BLA)		1.0	216.00	0.00 %	216.00
SIKA 207 G+P ADHESIVE PRIMER		1.0	200.00	0.00 %	200.00
PLATE ,BACK DOOR		1.0	72.30	0.00 %	72.30
EMBLEM		1.0	193.40	0.00 %	193.40
PLATE ,BACK DOOR		1.0	72.30	0.00 %	72.30
REINFORCEMENT		1.0	441.60	0.00 %	441.60
PANEL SUB-ASSY ,BACK		1.0	6452.00	0.00 %	6,452.00
COVER ,RR BUMPER		1.0	844.40	0.00 %	844.40
TAPE MOULDING ,NO.1		1.0	111.00	0.00 %	111.00
COVER ,RR BUMPER		1.0	456.70	0.00 %	456.70
PLATE ,RR BUMPER		1.0	18.40	0.00 %	18.40
TAPE ,SEAL		1.0	10.40	0.00 %	10.40
RETAINER ,OUTSIDE		1.0	37.80	0.00 %	37.80
BUMPER CLIPS		1.0	55.90	0.00 %	55.90
RETAINER,ULTRANO NIC		1.0	88.20	0.00 %	88.20
RETAINER,ULTRANO NIC		1.0	88.20	0.00 %	88.20
CLIP		1.0	5.40	0.00 %	5.40
REGN PLATE (REAR)		1.0	96.00	0.00 %	96.00

Materials Subtotal 13,348.40

Labor**Replace/RnR**

Description	Type	Cost	Markup/Disc %	Price
CHECK WIRING SYSTEM AND FOCUS HEADLAMP	RnR	216.50	0.00 %	216.50
REMOVE/REFIX FRONT PARKING SENSORS	RnR	216.50	0.00 %	216.50
TO CONDUCT ADJUSTMENT ON WAVE RADAR SENSOR	RnR	216.50	0.00 %	216.50
TO CONDUCT ADJUSTMENT ON FRONT CAMERA FOWARD	RnR	216.50	0.00 %	216.50
REMOVE/REPLACE FRONT BUMPER COVER AND REALIGN	RnR	866.00	0.00 %	866.00
REMOVE/REFIX REAR WINDSHIELD TO ASSIST REPAIR	RnR	866.00	0.00 %	866.00
INSTALLING SOLAR FILM FOR REAR WINDSHIELD	RnR	480.00	0.00 %	480.00
TRANSFER BACK DOOR COMPONENT AND MECHANISM TO NEW DOOR SHELL	RnR	866.00	0.00 %	866.00
REMOVE/REFIX REVERSE CAMERA	RnR	216.50	0.00 %	216.50
CHECK WIRING SYSTEM AND CONDUCT WATER SEEPAGE	RnR	216.50	0.00 %	216.50
REMOVE/REFIX REVERSE SENSORS	RnR	216.50	0.00 %	216.50
REMOVE /REFIX REAR LUGGAGE COMPARTMENT INTERIOR TRIM GARNISH TO ASSIST REPAIR	RnR	433.00	0.00 %	433.00
REMOVE ALL NECESSARY PARTS ,TO ENABLE REPAIRING AND STRAIGHTEN REAR PANEL ,SPARE WHEEL PAN,R/R AND L/R BODY PANELS ,CUT AND WELD PANEL AND FIT NEW PARTS	RnR	2165.00	0.00 %	2,165.00
TO RESET ECU & REPROGRAMME	RnR	216.50	0.00 %	216.50

Paint

Description	Paint Type	Cost	Markup/Disc %	Price
SPRAY PAINT ON FRONT BUMPER COVER	Full spray	742.00	0.00 %	742.00
SPRAY PAINT ON DAMAGED AFFECTED PORTION OF CAR	Full spray	1855.00	0.00 %	1,855.00

Labor Rate S\$ 50 / Hour

General Labor Subtotal 7,408.00

Paint Labor Subtotal 2,597.00

Labor Subtotal 10,005.00

Summary

Repair Cost	23,353.40
Discount(0 %)	(0.00)
	23,353.40

Excess	(0.00)
GST(0.00 %)	0.00
Grand Subtotal	23,353.40