

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22002488/APA3Q2**Date:** 18/07/2023**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800025612
Claimant Vehicle No :	SLP8820X	Insured Vehicle No :	SLX1885M
Date of Loss:	16/03/2022	Nature of Claim:	TP
		Claim No:	3710264226SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLP8820X		
Make & Model:	RENAULT CAPTUR, 1.3 PRIVILEGE (A)	Engine No:	H5HB470D624472
Reg. Date:	14/05/2021 (Man. Year: 2021)	Chassis No:	VF1RJB00567081348
Colour:	Blue	Odometer:	21531 km
Engine Capacity:	1332 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/55 R18	Rear Tyre Size:	215/55 R18
Front Left Side:	Goodyear 6 mm	Rear Left Side:	Goodyear 6 mm
Front Right Side:	Goodyear 6 mm	Rear Right Side:	Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	109,178.80	52,474.90	56,703.90	51.94
Miscellaneous Items	0.00	0.00	0.00	
Labour	11,100.00	7,000.00	4,100.00	36.94
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	120,278.80	59,474.90	60,803.90	50.55
Approved Total (Overridden) (S\$)		47,500.00		
(S\$)	120,278.80	47,500.00	72,778.80	60.51
+ GST 7.00/7.00% (S\$)	8,419.52	3,325.00	5,094.52	60.51
Nett Amount (S\$)	128,698.32	50,825.00	77,873.32	60.51
+ Loss of Use (45.0 x S\$70.00/day) (S\$)		3,150.00		
+ Car Rental (2.0 x S\$110.00/day) (S\$)		220.00		
+ Doc/Search Fee (S\$)		2.00		
+ Other Costs (S\$)		120.00		
Nett Liability (S\$)		54,317.00		
Global Sum Settlement (S\$)		54,300.00		

INSPECTION

Date of Assignment:	17/03/2022		SM Automotive (HQ)
Date Inspected:	17/03/2022	Inspected At:	756 JURONG WEST STREET 74, #12-60
			Singapore 640756
Estimated Period of Repair:	24.0 days		

Adjuster: ADRIAN LING

Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

MARKET VALUE

MV: \$108,000.00 (EST) LESS REBATE \$59,141.00 (EST) = NV: \$48,859.00 (EST)

SPECIAL REMARKS

DOA:16/03/2022

DOI: 17/03/2022

PARTES ORDERED ON 23/03/2022

LAST BATCH OF PARTS RECEIVED ON 18/05/2022

57DAYS WAITING PARTS + 24 REPAIR DAYS = 81DAYS

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Distorted	1,750.00 FL	*1,620.00 FL
2	1		*REAR BUMPER REINFORCEMENT	Distorted	1,350.00 FL	*950.00 FL
3	2		*REAR BUMPER SIDE RETAINER	Necessary	720.00 FL	*310.00 FL
4	4		*REAR BUMPER SIDE RETAINER RIVET	Necessary	48.00 FL	*30.00 FL
5	1		*REAR BUMPER CENTER BRACKET GARNISH	Necessary	720.00 FL	*255.00 FL
6	1		*REAR BUMPER CENTER BRACKET GARNISH RIVET (6 PCS)	Necessary	72.00 FL	*20.00 FL
7	2		*REAR BUMPER SIDE GRILLE	Distorted	1,040.00 FL	*520.00 FL
8	2		*REAR BUMPER SIDE GRILLE OUTER CHROME	Distorted	960.00 FL	*310.00 FL
9	2		*REAR BUMPER SIDE LAMP	N/S Cracked / O/S Missing	1,920.00 FL	*500.00 FL
10	1		*REAR BUMPER SIDE LAMP WIRE HARNESS	Not Necessary	1,260.00 FL	*- FL
11	1		*REAR BUMPER LOWER GARNISH	Distorted	660.00 FL	*320.00 FL
12	1		*REAR BUMPER EXHAUST GARNISH	Not Necessary	320.00 FL	*- FL
13	2		*REAR BUMPER SIDE	Deformed	2,360.00 FL	*1,020.00 FL
14	1		*REAR BUMPER UNDER COVER	Cracked	920.00 FL	*390.00 FL
15	1		*REAR END PANEL (OUTER)	Distorted	1,780.00 FL	*950.00 FL
16	1		*REAR END PANEL (INNER)	Not Necessary	980.00 FL	*- FL
17	1		*REAR END PANEL TOP GARNISH	Deformed	799.00 FL	*310.00 FL
18	2		*REAR END PANEL AIR VENT	Deformed	115.00 FL	*115.00 FL
19	1		*REAR END PANEL INSULATOR	Not Necessary	390.00 FL	*- FL
20	4		*REAR END PANEL RUBBER STOPPER (SMALL)	Not Necessary	36.00 FL	*- FL
21	2		*REAR END PANEL RUBBER STOPPER (BIG)	Not Necessary	32.00 FL	*- FL
22	1		*REAR WEATHERSTRIPE	Cut	386.00 FL	*386.00 FL
23	1		*REAR SPARE TYRE COMPARTMENT PANEL	Distorted	1,996.00 FL	*1,750.00 FL
24	1		*REAR SPARE TYRE COMPARTMENT PANEL TOP BOARD	Deformed	794.00 FL	*350.00 FL
25	1		*REAR SPARE TYRE COMPARTMENT PANEL TOP CARPER	Not Necessary	610.00 FL	*- FL
26	1		*REAR EXHAUST MUFFLER	Dented	1,180.00 FL	*1,180.00 FL
27	1		*REAR EXHAUST MUFFLER CONNECTOR	Bent	330.00 FL	*120.00 FL
28	1		*REAR EXHAUST MUFFLER ALUMINIUM SHIELD	Crumpled	530.00 FL	*245.00 FL
29	2		*REAR EXHAUST MUFFLER RUBBER MOUNTING	Torn	82.00 FL	*40.00 FL
30	2		*REAR EXHAUST MUFFLER RUBBER MOUNTING BRACKET	Damaged	76.00 FL	*76.00 FL
31	1		*REAR EXHAUST CENTER PIPE	Bent	1,576.00 FL	*1,576.00 FL
32	2		*REAR CHASSIS FRAME	Repair	3,300.00 FL	*- FL
33	1		*REAR TOOLS TRAY	Deformed	386.00 FL	*386.00 FL
34	1		*REAR TOOLS TRAY SPONGE	Not Necessary	223.00 FL	*- FL
35	1		*REAR TOOLS TRAY INSULATOR	Torn	386.00 FL	*185.00 FL
36	1		*AIR TYRE PUMP	Not Necessary	460.00 FL	*- FL
37	1		*REAR FENDER	O/S Buckled	7,680.00 FL	*1,680.00 FL
38	2		*REAR FENDER INNER TRIM BOARD CENTER	Not Necessary	960.00 FL	*- FL
39	2		*REAR FENDER INNER TRIM BOARD BOTTOM	Deformed	712.00 FL	*712.00 FL
40	2		*REAR FENDER INNER COWLING	Torn	1,040.00 FL	*560.00 FL
41	2		*REAR FENDER OUTER GARNISH	Deformed	512.00 FL	*512.00 FL
42	2		*REAR TAILLAMP	Cracked	2,480.00 FL	*1,650.00 FL
43	2		*REAR TAILLAMP LOWER BRACKET	Cracked	252.00 FL	*184.00 FL
44	2		*REAR TAILLAMP LOWER BRACKET RIVET	Necessary	24.00 FL	*24.00 FL
45	2		*REAR TAILLAMP INNER PANEL	Repair	700.00 FL	*- FL
46	2		*REAR TAILLAMP SIDE GARNISH	Not Necessary	240.00 FL	*- FL
47	1		*REAR TAILGATE	Dented	3,920.00 FL	*2,950.00 FL
48	1		*REAR TAILGATE LOCK	Damaged	448.00 FL	*448.00 FL
49	1		*REAR TAILGATE LOCK CATCH	Bent	144.00 FL	*144.00 FL
50	1		*REAR TAILGATE LOCK DETECTOR	Damaged	268.00 FL	*268.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
51	2		*REAR TAILGATE SHOCK ABSORBER	Not Necessary	1,464.00 FL	*- FL
52	1		*REAR TAILGATE OUTER GARNISH	Distorted	1,950.00 FL	*1,050.00 FL
53	1		*REAR TAILGATE EMBLEM LOGO	Necessary	175.00 FL	*100.00 FL
54	1		*REAR TAILGATE EMBLEM RENAULT	Necessary	190.00 FL	*110.00 FL
55	1		*REAR TAILGATE EMBLEM CAPTUR	Not Necessary	220.00 FL	*120.00 FL
56	2		*REAR NUMBER PLATE LAMP	Not Necessary	220.00 FL	*- FL
57	1		*REAR TAILGATE LAMP	O/S Cut	1,720.00 FL	*620.00 FL
58	1		*REAR TAILGATE WINDSCREEN GLASS MOULDING	Necessary	236.00 FL	*236.00 FL
59	2		*REAR TAILGATE STOPPER	Not Necessary	188.00 FL	*- FL
60	1		*REAR TAILGATE SPEAKER BOARD	Not Necessary	312.00 FL	*- FL
61	1		*REAR TAILGATE KEYLESS SENSOR	Damaged	236.00 FL	*236.00 FL
62	1		*REAR TAILGATE KEYLESS SENSOR BRACKET	Deformed	114.00 FL	*114.00 FL
63	1		*REAR AXLE	Bent	4,480.00 FL	*2,920.00 FL
64	2		*REAR SHOCK ABSORBER	Bent	890.00 FL	*700.00 FL
65	1		*REAR FUEL TANK CHARCOAL CANISTER	Cracked	820.00 FL	*558.00 FL
66	1		*REAR FUEL TANK CHARCOAL CANISTER BRACKET	Not Necessary	460.00 FL	*- FL
67	1		*REAR FUEL TANK CHARCOAL CANISTER RUBBER HOSE	Not Necessary	78.00 FL	*- FL
68	1		*REAR SPORT RIM	O/S Bent	2,960.00 FL	*1,200.00 FL
69	1		*BONNET	Repair	2,680.00 FL	*- FL
70	1		*BONNET LOCK	Not Necessary	335.00 FL	*- FL
71	1		*BONNET LOCK BRACKET	Not Necessary	214.00 FL	*- FL
72	1		*BONNET LOCK EXTENSION BRACKET	Not Necessary	225.00 FL	*- FL
73	1		*BONNET LOCK EXTENSION BRACKET GARNISH	Not Necessary	196.00 FL	*- FL
74	1		*FRONT BUMPER	Distorted	1,920.00 FL	*1,620.00 FL
75	1		*FRONT BUMPER SPONGE	Cracked	360.00 FL	*220.00 FL
76	1		*FRONT BUMPER REINFORCEMENT	Dented	1,536.00 FL	*920.00 FL
77	1		*FRONT BUMPER LOWER GRILLE	Cracked	550.00 FL	*390.00 FL
78	1		*FRONT BUMPER LOWER GRILLE SPONGE	Cracked	420.00 FL	*218.00 FL
79	1		*FRONT BUMPER LOWER GARNISH	Deformed	1,184.00 FL	*720.00 FL
80	1		*FRONT BUMPER LOWER GARNISH COVER	Not Necessary	720.00 FL	*- FL
81	1		*FRONT BUMPER TOW COVER	Not Necessary	130.00 FL	*- FL
82	1		*FRONT BUMPER TOP CENTER CHROME MOULDING	Cut	820.00 FL	*310.00 FL
83	2		*FRONT BUMPER TOP SIDE CHROME MOULDING	Cut	580.00 FL	*380.00 FL
84	2		*FRONT BUMPER SIDE AIR VENT COVER INNER	Not Necessary	290.00 FL	*- FL
85	2		*FRONT BUMPER SIDE AIR VENT COVER OUTER CHROME	Not Necessary	232.00 FL	*- FL
86	2		*FRONT BUMPER SIDE AIR VENT COVER OUTER	Not Necessary	210.00 FL	*- FL
87	1		*FRONT BUMPER SIDE AIR VENT DISTANCE SENSOR	Not Necessary	1,650.00 FL	*- FL
88	1		*FRONT BUMPER CENTER DISTANCE SENSOR	Damaged	1,750.00 FL	*600.00 FL
89	2		*FRONT BUMPER CENTER DISTANCE SENSOR COVER	Necessary	270.00 FL	*50.00 FL
90	1		*FRONT BUMPER DISTANCE SENSOR WIRE HARNESS	Not Necessary	1,450.00 FL	*- FL
91	1		*FRONT BUMPER UNDER COVER	Deformed	1,120.00 FL	*325.00 FL
92	1		*FRONT GRILLE (OUTER)	Cracked	960.00 FL	*780.00 FL
93	1		*FRONT GRILLE (INNER)	Cracked	832.00 FL	*620.00 FL
94	1		*FRONT GRILLE LOGO	Necessary	380.00 FL	*150.00 FL
95	1		*FRONT GRILLE TOP GARNISH	Not Necessary	1,100.00 FL	*- FL
96	2		*FRONT HEADLAMP	Cracked	5,760.00 FL	*5,760.00 FL
97	2		*FRONT HEADLAMP LOWER BRACKET	Not Necessary	292.00 FL	*- FL
98	4		*FRONT HEADLAMP LOWER BRACKET RIVET	Not Necessary	48.00 FL	*- FL
99	1		*FRONT SUPPORT PANEL	Damaged	1,680.00 FL	*1,280.00 FL
100	1		*FRONT SUPPORT PANEL TOP GARNISH COVER	Deformed	480.00 FL	*255.00 FL
101	1		*FRONT SUPPORT PANEL LOWER BRACKET	Not Necessary	96.00 FL	*- FL
102	4		*FRONT SUPPORT PANEL TOP SIDE BRACKET	Not Necessary	356.00 FL	*- FL
103	1		*FRONT SUPPORT PANEL LOWER SPONGE	Cracked	178.00 FL	*178.00 FL
104	1		*FRONT SUPPORT PANEL LOWER GRILLE SPONGE	Cracked	850.00 FL	*480.00 FL
105	1		*FRONT SUPPORT PANEL LOWER SPONGE WITH SENSOR	Not Necessary	1,530.00 FL	*- FL
106	1		*FRONT SUPPORT PANEL TOP SPONGE	Cracked	320.00 FL	*320.00 FL
107	1		*FRONT SUPPORT PANEL TOP SPONGE GRILLE	Deformed	480.00 FL	*325.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
108	2		*HORN	Not Necessary	260.00 FL	*- FL
109	1		*HORN BRACKET	Not Necessary	48.00 FL	*- FL
110	1		*AIR CON CONDENSER	Bent	1,850.00 FL	*1,850.00 FL
111	1		*RADIATOR	Dented	1,820.00 FL	*1,820.00 FL
112	1		*RADIATOR FAN BLADES	Not Necessary	230.00 FL	*- FL
113	1		*RADIATOR FAN MOTOR	Not Necessary	550.00 FL	*- FL
114	1		*RADIATOR FAN COWLING	Cracked	760.00 FL	*380.00 FL
115	1		*RADIATOR OUTER GARNISH	Not Necessary	320.00 FL	*- FL
116	1		*RADIATOR TOP HOSE	Not Necessary	155.00 FL	*- FL
117	1		*RADIATOR BOTTOM HOSE	Not Necessary	135.00 FL	*- FL
118	4		*RADIATOR TOP CLIPS	Not Necessary	340.00 FL	*- FL
119	2		*RADIATOR TOP RUBBER BUSH	Not Necessary	120.00 FL	*- FL
120	1		*INTER COOLER	Cracked	2,740.00 FL	*2,740.00 FL
121	1		*INTER COOLER OUTER GARNISH	Cracked	180.00 FL	*180.00 FL
122	2		*FRONT SAFETY BELT	Activated	3,300.00 FL	*1,900.00 FL
123	2		*FRONT SAFETY BELT TENSIONAL	Activated	1,300.00 FL	*900.00 FL
124	2		*REAR SAFETY BELT	Not Necessary	3,100.00 FL	*- FL
125	1		*SAFETY BELT ECU	Activated	980.00 FL	*980.00 FL
126	1		*REAR BUMPER CLIPS	Necessary	120.00 FS	*30.00 FS
127	1		*REAR END PANEL TOP GARNISH CLIPS	Necessary	80.00 FS	*20.00 FS
128	2		*REAR FENDER INNER TRIM BOARD CLIPS	Necessary	160.00 FS	*60.00 FS
129	2		*REAR FENDER OUTER GARNISH CLIPS	Not Necessary	80.00 FS	*- FS
130	1		*REAR WINDSCREEN GLASS SEALANT	Necessary	120.00 FS	*60.00 FS
131	4		*REAR TAILLAMP CLIPS	Necessary	48.00 FS	*20.00 FS
132	1		*REAR END PANEL SEALANT	Necessary	100.00 FS	*60.00 FS
133	1		*REAR SPARE TYRE COMPARTMENT PANEL SEALANT	Necessary	120.00 FS	*60.00 FS
134	1		*REAR NUMBER PLATE WITH CASING	Missing	60.00 FS	*60.00 FS
135	1		*FRONT NUMBER PLATE WITH CASING	Distorted	60.00 FS	*60.00 FS
136	1		*FRONT BUMPER CLIPS	Necessary	120.00 FS	*30.00 FS
137	1		*AIR CON GAS	Necessary	120.00 FS	*30.00 FS
138	1		*RADIATOR COOLANT	Necessary	120.00 FS	*40.00 FS
139	2		*FRONT FENDER OUTER GARNISH CLIPS	Not Necessary	80.00 FS	*- FS
140	1		*BRAKE FLUIDE	Necessary	80.00 FS	*50.00 FS
141	1		*RIVET (50 PCS)	Not Necessary	600.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	121,080.00	58,241.00
- List Item Discount on L Items 10.00/10.00% (\$\$)	11,901.20	5,766.10
Total Parts (\$\$)	109,178.80	52,474.90

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR FOR PANEL BEATING	New	4,000.00	2,800.00
2	LABOUR FOR SPRAYPAINTING	New	2,500.00	1,800.00
3	WIRING CHECK	New	120.00	60.00
4	TO APPLY TUFF COATING /RUST PROOF ACCIDENT AREAS	New	500.00	150.00
5	LABOUR FOR REMOVE & TRANSFER REAR TAILGATE FITTING	New	300.00	80.00
6	LABOUR FOR REMOVE & RENEW REAR EXHAUST MUFFLER /TO REPAIR & STRAIGHTEN REAR EXHAUST PIPE	New	300.00	160.00
7	LABOUR FOR REMOVE & REFIX REAR WINDSCREEN GLASS	New	150.00	120.00
8	LABOUR FOR REPAIR & STRAIGHTEN BOTH REAR CHASSIS FRAME	New	600.00	280.00
9	LABOUR FOR REMOVE & RENEW AIR CON CONDENSER /FAN BLADE/FAN MOTOR /FAN COWLING ,VACUUM & TOP UP AIR CON GAS	New	250.00	60.00
10	LABOUR FOR REMOVE & RENEW RADIATOR /HOSE ,TOP UP COOLANT	New	200.00	60.00
11	LABOUR FOR REMOVE & REFIX ALL REAR CARPET /UPHOLSTERY /ROOF LINING	New	400.00	300.00
12	LABOUR FOR REMOVE & RENEW REAR UNDER CARRIAGE	New	500.00	380.00
13	LABOUR FOR REPAIR & BLEEDE REAR BRAKE SYSTEM	New	180.00	0.00
14	LABOUR FOR TROUBLESHOOT & DIAGNOSE ENGINE CANNOT START	New	300.00	250.00
15	LABOUR FOR DIAGNOSE & RESET ALL DASHBOARD METER WARNING LIGHT	New	400.00	150.00
16	LABOUR FOR REMOVE & RENEW ALL SAFETY BELT /FRONT CUSHION SEAT TO RESET ALL FAULT CODE	New	400.00	350.00
Gross Labour Cost (S\$)			11,100.00	7,000.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >