

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/HLA22002837/VTY3E2

**Date:** 06/04/2022

### REFERENCE

Handling Insurer: HL Assurance Pte Ltd Policy No: MP319845  
Claimant Vehicle No : SLR2303B Insured Vehicle No : SMP3046K  
Date of Loss: 26/03/2022 Nature of Claim: TP Claim No: MPC03267/GN

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLR2303B**  
Make & Model: TOYOTA LEXUS, 3.5 GS450H CVT LUXURY (A) Engine No: 2GR8761679  
Reg. Date: 29/11/2012 (Man. Year: 2012) Chassis No: JTHBS1BL505002599  
Colour: Black Odometer: 174135 km  
Engine Capacity: 3456 cc  
Market Value/New Car Price: N/A  
Sum Insured (S\$): **Market Value/New Car Price**

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes  
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 235/45 R18 Rear Tyre Size: 235/45 R18  
Front Left Side: Yokohama 6 mm Rear Left Side: Yokohama 6 mm  
Front Right Side: Yokohama 6 mm Rear Right Side: Yokohama 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment: 28/03/2022  
Date Inspected: 28/03/2022 Inspected At: Garage 13 Pte Ltd (HQ)  
8 Kaki Bukit Ave 4, Premier @ Kaki Bukit, #03-46  
Singapore 415875  
Estimated Period of Repair: 4.0 days

**Adjuster:** Thevan Thomas Karthikesavan

**Manager:** DENISE TAY KWEE CHENG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000.00  
-\$5,000.00

# REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 06 Apr 2022)
Parts:	143	TOYOTA LEXUS 3.5 GS450H CVT LUXURY (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLR2303B)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

## Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.
---

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.
---

< END OF ESTIMATES >