

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD (TP) WS/TP RES/OD RES/EVA/INV/MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

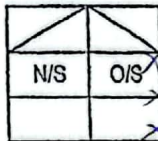
Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lump Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: GBK 3618Yr Regn: 19/11/19Type: M.Car / M.Cycle / Bus / Van / Corry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Dyna 150 c.c. 1982Colour: Silver A/C: Insured / Std / NI / NASp. Reading: 77413 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: J1PAT35480K 214208

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195R15R: 21

BS/DUN/EXNOVA/GY/FS/LIZA/MIC/OHTSU/PIR/SUMI/

TOYO/YOKO or _____

Front

Rear

R/Bal. 4 mm R/Bal. 4 mmL/Bal. 4 mm L/Bal. 4 mmD.O.A. 26/3/22 D.O.I. 19/4/22Survey held at Sin ShengDes. of Damages: Frt / Rear / O/S / NIS / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

MV-78X

Order/Time, File Pass to?

☐ : Prel. Report☐ : Final Report

Date/Time, File Return to?

2)

Rep. Format: _____

Lump Sum / L.B. (\$) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

\$ + RS. \$ _____

Photos

Others

TOTAL

SIN SHENG AUTO WORKSHOP PTE LTD

REGISTRATION NO.: 202019500G

NO. 5 TUAS AVE 3 SINGAPORE 639405

TEL: (+65) 6416 1996 FAX: (+65) 6863 1944 EMAIL: ENQUIRY@SINSHENG.COM.SG

Reefertec Pte Ltd
No. 13 Tuas Ave 11
Singapore 639079

Attn: Motor Claims Department

Estimate No : E52022/0059
Date : 19/04/2022
Vehicle No : GBK361B
Make/Model : TOYOTA / DYNA
Date of Accident : 26/03/2022
Prepared By : Hoe

S/N	Description	Qty	Unit Amount (\$\$)	Amount (\$\$)
	<u>Parts (List)</u>			
1	Rear mudguard, RH X R	2	295.50	591.00
2	Rubber stopper / MIS	1	145.50	145.50
				<u>736.50</u>
			Less: 25%	<u>(184.13)</u>
			Parts total	552.38

Labour charges

To panel beat RHS body
To dismantle/replace above-mentioned parts
To dismantle/refix diesel tank
To spray painting on affected areas
To redo advertising logo

	500.00	359
	450.00	400
	180.00	
Labour total	<u>1,130.00</u>	

Loss of Use : 4 days @ S\$100/day

8322 8813

Steve (LKK)
19/4/22, 10:00

M AL
PIP
Ry K y
3 d/s

Steve chen @ lkk auto - cm

TOTAL

1,682.38

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis

SIN SHENG AUTO WORKSHOP PTE LTD

- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: