


ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

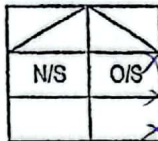

Bal. or Market Value: _____
 IDAC Accident Report: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lump Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: GBK 3618 Yr Regn: 19/11/19
 Type: M.Car / M.Cycle / Bus / Van / Corry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Toyota Dyna 150 c.c. 1982
 Colour: Silver A/C: Insured / Std / NI / NA
 Sp. Reading: 77413 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: J1PAT35480K 214208
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modl: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 195R15
 R: 195R15
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or _____

<u>Front</u>	<u>Rear</u>
R/Bal. <u>4</u> mm	R/Bal. <u>4</u> mm
L/Bal. <u>4</u> mm	L/Bal. <u>4</u> mm
D.O.A. <u>26/3/22</u>	D.O.I. <u>19/4/22</u>
Survey held at <u>Sin Sheng</u>	
Des. of Damages: Frt / Rear / <u>O/S</u> / NIS / UIC / Rooftop or	

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>MV-78X</u>

Order/Time, File Pass to?

☐ : Prel. Report
☐ : Final Report

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

\$ + RS. \$

Photos

Others

TOTAL

1) Date/Time, File Return to?

2) _____

Rep. Format: _____

Lump Sum / L.B.I. (\$) _____

Add Fee: ☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Invs (\$ _____)
☐ : Weekend (\$ _____)

SIN SHENG AUTO WORKSHOP PTE LTD

REGISTRATION NO.: 202019500G

NO. 5 TUAS AVE 3 SINGAPORE 639405

TEL: (+65) 6416 1996 FAX: (+65) 6863 1944 EMAIL: ENQUIRY@SINSHENG.COM.SG

Reefertec Pte Ltd

No. 13 Tuas Ave 11

Singapore 639079

Attn: Motor Claims Department

Estimate No : E52022/0059

Date : 19/04/2022

Vehicle No : GBK361B

Make/Model : TOYOTA / DYNA

Date of Accident : 26/03/2022

Prepared By : Hoe

S/N	Description	Qty	Unit Amount (\$\$)	Amount (\$\$)
	<u>Parts (List)</u>			
1	Rear mudguard, RH X R	2	295.50	591.00
2	Rubber stopper / MIS	1	145.50	145.50
				<u>736.50</u>
			Less: 25%	<u>(184.13)</u>
			Parts total	552.38

Labour charges

To panel beat RHS body

To dismantle/replace above-mentioned parts

To dismantle/refix diesel tank

To spray painting on affected areas

To redo advertising logo

	500.00	359
	450.00	400
	<u>180.00</u>	
Labour total	1,130.00	

Loss of Use : 4 days @ S\$100/day

8322 8813

Steve (LKK)

19/4/22, 10:00

M AL
PIP

Ry K y
3 d/s

Steve chen @ lkk auto - cm

TOTAL

1,682.38

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis

SIN SHENG AUTO WORKSHOP PTE LTD

- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: