

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG22003026/AVCE2

Date: 22/07/2022

REFERENCE

Insured/Claimant:	CHIA JIA EN, EDWIN	Policy No:	7210041192	
Date of Loss:	28/03/2022	Nature of Claim:	OD	Claim No: 6522883213SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMZ4169E	Engine No:	DEM024276
Make & Model:	AUDI A4, 2.0 TFSI S-TRONIC (A)	Chassis No:	WAUZZZF42LN014594
Reg. Date:	26/04/2021 (Man. Year: 2020)	Odometer:	6519 km
Colour:	Black		
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$175,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/50 R17	Rear Tyre Size:	225/50 R17
Front Left Side:	Hankook 6 mm	Rear Left Side:	Hankook 6 mm
Front Right Side:	Hankook 6 mm	Rear Right Side:	Hankook 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,314.00	9,747.36	6,566.64	40.25
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,122.00	3,022.00	2,100.00	41.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	21,436.00	12,769.36	8,666.64	40.43
+ GST 7.00/7.00% (S\$)	1,500.52	893.86	606.66	40.43
Nett Amount (S\$)	22,936.52	13,663.22	9,273.30	40.43

INSPECTION

Date of Assignment:	05/04/2022		
Date Inspected:	31/03/2022	Inspected At:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	4.0 days		

Adjuster: ADRIAN LING

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	2,377.00 FS	*1,901.60 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	393.00 FS	*- FS
3	2		*FRONT BUMPER SECURING STRIP	Not Necessary	79.00 FS	*- FS
4	1		*FRONT BUMPER CLOSING ELEMENT - LOWER CENTER	Not Necessary	293.00 FS	*- FS
5	1		*FRONT BUMPER AIR GUIDE - RH	Missing	51.00 FS	*40.08 FS
6	1		*FRONT BUMPER AIR GUIDE GRILLE - RH	Missing	151.00 FS	*120.40 FS
7	1		*FRONT BUMPER TRIM - RH	Missing	54.00 FS	*42.64 FS
8	1		*FRONT BUMPER GUIDE SECTION - RH	Not Necessary	41.00 FS	*- FS
9	1		*FRONT BUMPER FOAM FILLER PIECE	Not Necessary	212.00 FS	*- FS
10	1		*FRONT BUMPER REINFORCEMENT BEAM	Not Necessary	899.00 FS	*- FS
11	1		*FRONT BUMPER TOP COVER	Not Necessary	143.00 FS	*- FS
12	1		*CAUTION STICKER	Not Necessary	16.00 FS	*- FS
13	1		*AIR COND STICKER	Not Necessary	9.00 FS	*- FS
14	1		*FRONT PARKING AID SENSOR OUTER	Not Necessary	265.00 FS	*- FS
15	4		*FRONT PARKING AID SENSOR SEAL RING	Not Necessary	10.00 FS	*- FS
16	1		*HORN - RH	Not Necessary	139.00 FS	*- FS
17	1		*HORN SUPPORT - RH	Not Necessary	33.00 FS	*- FS
18	1		*FRONT FENDER - RH	Dented	1,227.00 FS	*981.60 FS
19	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	211.00 FS	*- FS
20	1		*FRONT FENDER CLOSING ELEMENT - RH	Not Necessary	81.00 FS	*- FS
21	1		*FRONT FENDER BRACKET - RH	Not Necessary	41.00 FS	*- FS
22	6		*FRONT FENDER POP RIVET	Necessary	23.00 FS	*18.24 FS
23	1		*FRONT FENDER BRACE - RH	Bent	132.00 FS	*105.20 FS
24	1		*FRONT WHEEL HOUSING LINER - RH	Not Necessary	262.00 FS	*- FS
25	1		*FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	149.00 FS	*- FS
26	1		*FRONT WHEEL SPOILER - RH	Not Necessary	82.00 FS	*- FS
27	1		*FRONT WHEEL SPOILER LOWER - RH	Not Necessary	40.00 FS	*- FS
28	1		*FRONT FENDER LEDGE COVER LONG - RH	Not Necessary	35.00 FS	*- FS
29	1		*HEADLAMPS COVER - RH	Not Necessary	49.00 FS	*- FS
30	1		*HEADLIGHT - RH	Cut	8,172.00 FS	*6,537.60 FS
31	1		*LIFT CYLINDER - RH	Not Necessary	231.00 FS	*- FS
32	1		*LIFT CYLINDER BRACKET - RH	Not Necessary	7.00 FS	*- FS
33	1		*LIFT CYLINDER CORRUGATED PIPE	Not Necessary	107.00 FS	*- FS
34	1		*SUNDRIES	Not Necessary	300.00 FS	*- FS

F=Franchise part. S=SpcNett.

Total Parts (S\$) 16,314.00 9,747.36

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER RHS HEADLIGHTS CONTROL UNIT AND POWER MODULE	New	350.00	250.00
3	TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER RHS HEADLIGHT. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	2,100.00	1,000.00
4	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
5	TO RESPRAY FRONT BUMPER AND RHS FRONT FENDER	New	2,000.00	1,100.00
Gross Labour Cost (\$\$)			5,122.00	3,022.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >