

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS/CTI22003049/GNY3E2**Date:** 20/12/2022REFERENCEHandling Insurer: China Taiping Insurance  
(Singapore) Pte. Ltd.

Policy No: DMCVSNW00074662103

**Claimant Vehicle  
No :** SMK164Z**Insured Vehicle  
No :** YP3218P

Date of Loss: 31/03/2022

Nature of Claim: TP

Claim  
No: SNM22D202245/C02/LEWLCDESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SMK164Z**

Make &amp; Model: HONDA JAZZ, 1.5 (A)

Engine No: L15B33111909

Reg. Date: 20/02/2018 (Man. Year: 2017)

Chassis No: JHMGK5850JX204242

Colour: Red

Odometer: 53408 km

Engine Capacity: 1498 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/55 R15

Rear Tyre Size: 195/55 R15

Front Left Side: Bridgestone 6 mm

Rear Left Side: Bridgestone 6 mm

Front Right Side: Bridgestone 6 mm

Rear Right Side: Bridgestone 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	10,340.36	6,213.80	4,126.56	39.91
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,180.00	2,900.00	1,280.00	30.62
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>14,520.36</b>	<b>9,113.80</b>	<b>5,406.56</b>	<b>37.23</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>7,300.00</b>		
<b>Nett Amount (S\$)</b>	<b>14,520.36</b>	<b>7,300.00</b>	<b>7,220.36</b>	<b>49.73</b>

INSPECTION

Date of Assignment: 01/04/2022

Date Inspected: 04/04/2022 Inspected At:

Twincar Automotive Pte Ltd (Kaki Bukit)  
BLK 2 KAKI BUKIT, #01-17/18 KAKI BUKIT AUTOHUB  
Singapore 417921

Estimated Period of Repair: 8.0 days

**Adjuster:** XING GUO QIANG**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Reference

<b>Part Source:</b>	MRM-SG	Version: 1.0 (Last Synchronised: 20 Dec 2022)
<b>Parts:</b>	144	HONDA JAZZ 1.5 (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SMK164Z)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Deformed	551.50 FL	*551.50 FL
2	2		*REAR BUMPER GRILLE COVER L/R	Broken	96.20 FL	*96.20 FL
3	2		*REAR BUMPER SIDE RETAINER L/R	Broken	23.00 FL	*23.00 FL
4	1		*REAR END PANEL	Buckled	505.40 FL	*456.50 FL
5	1		*REAR END PANEL ANTENNA SENSOR	Cracked	107.40 FL	*107.40 FL
6	1		*REAR END PANEL BUZZLE SENSOR	Cracked	98.40 FL	*98.40 FL
7	1		*REAR END PANEL INNER TOP GARNISH	Deformed	60.80 FL	*60.80 FL
8	2		*REAR FENDER INNER TRIM GARNISH L/R	Deformed	399.40 FL	*399.40 FL
9	1		*REAR FLOOR PANEL	Repair	683.30 FL	*- FL
10	1		*REAR FLOOR PANEL SPONGE TRAY	Deformed	127.30 FL	*127.30 FL
11	1		*REAR FLOOR PANEL TOP BOARD COVER	Deformed	189.90 FL	*189.90 FL
12	1		*REAR FLOOR SIDE PANEL LH	Buckled	379.20 FL	*379.20 FL
13	1		*REAR LH FENDER	Repair	588.30 FL	*- FL
14	1		*REAR LH FENDER GLASS MOULDING	Not Necessary	56.90 FL	*- FL
15	1		*REAR LH FENDER INNER AIR VENT	Deformed	38.50 FL	*38.50 FL
16	1		*REAR LH FENDER INNER LOWER SHIELD	Deformed	35.70 FL	*35.70 FL
17	1		*REAR LH FENDER INNER SHIELD	Not Necessary	149.80 FL	*- FL
18	1		*REAR LH TAILLAMP PANEL	Buckled	108.90 FL	*108.90 FL
19	1		*REAR TAILGATE	Bent	1,071.10 FL	*846.00 FL
20	1		*REAR TAILGATE RS EMBLEM	Necessary	89.40 FL	*45.40 FL
21	2		*REAR TAILGATE DAMPER L/R	Not Necessary	213.60 FL	*- FL
22	2		*REAR TAILGATE HINGES L/R	Not Necessary	66.40 FL	*- FL
23	1		*REAR TAILGATE INNER PULL HANDLE	Deformed	18.50 FL	*18.50 FL
24	2		*REAR TAILGATE INNER RUBBER SIDE GUIDE STOPPER L/R	Not Necessary	31.00 FL	*- FL
25	1		*REAR TAILGATE INNER TRIM BOARD	Deformed	63.70 FL	*63.70 FL
26	1		*REAR TAILGATE MECHANISM LOCK	Cut	78.90 FL	*78.90 FL
27	2		*REAR TAILGATE NUMBER PLATE LAMP L/R	Cracked	90.00 FL	*90.00 FL
28	1		*REAR TAILGATE OUTER CHROME HANDLE	Broken	133.40 FL	*133.40 FL
29	2		*REAR TAILGATE REFLECTOR L/R	Cracked	250.00 FL	*250.00 FL
30	1		*REAR TAILGATE WEATHER STRIP	Twisted	92.30 FL	*92.30 FL
31	1		*REAR TAILGATE WINDSCREEN	Smashed	1,025.60 FL	*1,025.60 FL
32	1		*REAR TAILGATE WINDSCREEN MOULDING	Necessary	224.70 FL	*98.50 FL
33	1		*REAR TAILGATE WIPER ARM	Cut	58.20 FL	*58.20 FL
34	1		*REAR TAILGATE WIPER ARM COVER	Missing	12.40 FL	*12.40 FL
35	1		*REAR TAILGATE WIPER BLADE	Cut	69.40 FL	*26.00 FL
36	1		*REAR TAILGATE WIPER MOTOR	Bent	355.40 FL	*111.60 FL
37	2		*REAR TAILLAMP L/R	Cracked	537.80 FL	*537.80 FL
38	1		*SET REAR BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
39	1		*SET REAR BUMPER REVERSE SENSOR ( EYES)	Not Working	450.00 FS	*200.00 FS
40	1		*SET REAR END PANEL INNER TOP GARNISH CLIPS	Necessary	50.00 FS	*20.00 FS
41	2		*SET REAR FENDER INNER TRIM BOARD CLIPS L/R	Necessary	100.00 FS	*40.00 FS
42	1		*REAR FLOOR PANEL INSULATOR MAT	Not Necessary	300.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
43	1		*REAR LH FENDER GLASS SEALANT	Not Necessary	60.00 FS	*- FS
44	1		*SET REAR LH FENDER INNER SHIELD CLIPS	Necessary	50.00 FS	*20.00 FS
45	1		*REAR TAILGATE CAMERA	Cracked	800.00 FS	*280.00 FS
46	1		*SET REAR TAILGATE INNER TRIM BOARD CLIPS	Necessary	50.00 FS	*20.00 FS
47	1		*REAR TAILGATE NUMBER PLATE }	Bent	25.00 FS	*35.00 FS
48	1		*REAR TAILGATE NUMBER PLATE HOLDER }	Bent	50.00 FS	*- FS
49	1		*SET REAR TAILGATE OUTER CHROME HANDLE CLIPS	Necessary	40.00 FS	*10.00 FS
50	1		*REAR TAILGATE VIDEO RECORDER	Missing	980.00 FS	*380.00 FS
51	1		*REAR TAILGATE WINDSCREEN SOLAR FILM	Missing	250.00 FS	*200.00 FS
52	1		*REAR TAILGATE WINDSCREEN SEALANT	Necessary	80.00 FS	*40.00 FS
53	2		*SET REAR TAILLAMP CLIPS L/R	Necessary	60.00 FS	*10.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$)</b>	<b>12,076.70</b>	<b>7,446.00</b>
<b>- List Item Discount on L Items 20.00/20.00% (\$)</b>	1,736.34	1,232.20
<b>Total Parts (\$)</b>	<b>10,340.36</b>	<b>6,213.80</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO REMOVE ,REINSTALL ELECTRICAL WIRING HARNESS ,CHECK LIGHTING AND REWIRE FOR PARKING SENSOR	New	80.00	40.00
2	TO REMOVE REINSTALL TAILGATE WINDSCREEN	New	150.00	120.00
3	TO REMOVE,REINSTALL PETROL TANK (TO FR)	New	80.00	0.00
4	TO REMOVE ,REINSTALL ROOF TOP TRIM UPHOLSTERY CUSHION SEAT ,TRIM GARNISH ,TRIM LINER CARPET (TO FR)	New	120.00	60.00
5	TO SEND VEHICLE FOR CLEANING SHAMPOO UPHOLSTERY AND CUSHION SEAT	New	250.00	180.00
6	TO RE-SPRAY PAINTING ON THE REAR BOOTLID ,REAR END PANEL ,REAR FENDER (L/R) ,SPARE TYRE PANEL AND REAR BUMPER	New	1,400.00	1,200.00
7	TO PROVIDE LABOUR WORKMANSHIP TO CHARGE THE ABOVE DAMAGED BODYPARTS ,REPAIR ,RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT	New	1,900.00	1,200.00
8	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL	New	120.00	60.00
9	TO REMOVE,REINSTALL TAILGATE MECHANISM AND CHECK FOR FUNCTION	New	80.00	40.00
<b>Gross Labour Cost (\$\$)</b>			<b>4,180.00</b>	<b>2,900.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >