

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI22003140/VVY3N2**Date:** 14/04/2022**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMPCSNW00216502100

**Claimant Vehicle
No :** FBP2830A**Insured Vehicle
No :** SNB6640L

Date of Loss: 14/03/2022

Nature of Claim: TP

Claim
No: SNM22D201830/C02/IRENE**DESCRIPTION & IDENTIFICATION OF VEHICLE**Reg No: **FBP2830A**

Make & Model: YAMAHA XMAX 300, 292cc

Engine No: H336E0049269

Reg. Date: 09/03/2019 (Man. Year: 2019)

Chassis No: MH3SH0841KK006195

Colour: Black

Odometer: 0 km

Engine Capacity: 292 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 140/70-14

Rear Tyre Size: 140/70-14

Front Left Side: Pirelli 5 mm

Rear Left Side: Pirelli 5 mm

Front Right Side: 0 mm

Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 14/04/2022

Date Inspected: 05/04/2022 Inspected At:

 BLK C, #02-46 KAKI BUKIT
 AVENUE 6 @ KB
 Repairer: D&K AUTOMOTIVE SERVICES PTE LTD

Estimated Period of Repair: 5.0 days

Adjuster: Thevan Thomas Karthikesavan**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,500.00
-\$4,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 14 Apr 2022)	
Parts:	N/A	YAMAHA XMAX 300 292cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBP2830A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >