



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2301451

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 10/03/2023
Reference CC6/CTI22003238/Uya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBL 1251Z
Insured Veh. PA 7965A
Claim No. SNM22D202406/C02
Policy No. DMB1SNW00011802100
Accident Date 06/04/2022
Inspection Date 08/04/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22003238/Uya3q2 Date: 10/03/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	PA 7965A	Veh. Inspected	GBL 1251Z	
Policy No.	DMB1SNW00011802100	Coverage (\$)	0.00	
Claim No.	SNM22D202406/C02	Excess (\$)	0.00	
Assign From		Assign Date	08/04/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE DX (A)	c.c	2754	
Engine No.	HIDDEN	Year of Reg.	2021	
Chassis No.	GDH2011055190	Colour	WHITE	
Odometer	6220 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/80 R15	BRIDGESTONE	8 mm	
L/H Front Tyre	195/80 R15	BRIDGESTONE	8 mm	
R/H Rear Tyre	195/80 R15	BRIDGESTONE	8 mm	
L/H Rear Tyre	195/80 R15	BRIDGESTONE	8 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION & REAR WINDSCREEN SHATTERED. DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	06/04/2022	Inspection Date	08/04/2022	
Survey held at	LIU'S BROTHER AUTO ENGINEERING WORKSHOP 1 KAKI BUKIT AVENUE 6 #01-01 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBL 1251Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR TAILGATE	BADLY DENTED	2,051.60	2,051.60
1	REAR TAILGATE WEATHERSTRIP	TWISTED	391.20	391.20
1	REAR TAILGATE LOCK	DENTED / SHORTED	264.70	264.70
1	REAR TAILGATE LOCK OUTER GARNISH	CRACKED	137.60	137.60
1	REAR TAILGATE INNER LOCK	REPEATED	359.00	-
1	REAR TAILGATE INNER TRIM BOARD	SERVICEABLE	197.40	-
16	REAR TAILGATE INNER TRIM BOARD CLIPS @\$5.50	NOT NECESSARY	88.00	-
2	REAR TAILGATE NUMBER PLATE LAMP @\$138.60	NOT NECESSARY	277.20	-
1	REAR TAILGATE NUMBER PLATE LAMP OUTER GARNISH	GRAZED / CRACKED	346.50	346.50
2	REAR TAILGATE SUSPENSION @\$335.20	NOT NECESSARY	670.40	-
1	REAR TAILGATE 'TOYOTA LOGO' MOTIF	NECESSARY	167.00	68.10
2	REAR TAIL LAMP @\$365.10	CRACKED	730.20	730.20
1	REAR FLOOR PANEL TOP BEAM	BENT	277.80	277.80
1	REAR TAILGATE WINDSCREEN GLASS	SHORTED	1,311.30	1,148.10
1	REAR TAILGATE WINDSCREEN MOULDING	NO SUCH PARTS	219.00	-
1	REAR BUMPER	DISTORTED	465.00	465.00
1	REAR BUMPER STEP BRACKET	BENT	262.30	262.30
2	REAR BUMPER BRACKET @\$39.10	BENT	78.20	78.20
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	936.20	-
1	REAR END PANEL OUTER	BADLY DENTED	566.10	566.10
	LESS 25% DISCOUNT		-	-1,696.85
			9,796.70	5,090.55
<u>SPECIAL NETT ITEMS</u>				
1	REAR TAILGATE NUMBER PLATE & BASE (SN)	SCRATCHED	48.00	40.00
1	REAR TAILGATE VIDEO CAMERA (SN)	SERVICEABLE	450.00	-
1	REAR TAILGATE '70KM/H' STICKER (SN)	NECESSARY	15.00	10.00
1	REAR TAILGATE '8 PAX' STICKER (SN)	NECESSARY	15.00	10.00
1	REAR FLOOR PANEL TOP WOODEN BOARD (SN)	NOT NECESSARY	450.00	-

Report Ref No. CC6/CTI22003238/Uya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	48.00	48.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	220.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	'CORPORATE' ADVERTISEMENT & ARTWORK (SN)	NECESSARY	650.00	100.00
			1,996.00	498.00
	LABOUR			
	TO CHECK ALL WIRING & ELECTRICAL COMPONENT FOR PROPER FUNCTION .		80.00	30.00
	REMOVE AND REFIX REAR TAILGATE COMPONENTS & WIPER MECHANISM.		80.00	60.00
	REMOVE & REINSTALL TAILGATE GLASS TO FACILITATE REPAIRS.		120.00	120.00
	REOVE AND REFIX REAR BUMPER REVERSE SENSOR.		80.00	50.00
	LABOR FOR PANEL BEATING ,CUT ,WELD ,STRAIGHTEN & REPLACING PARTS ETCS.INCLUSIVE OF THE REPAIR OF REAR END PANEL INNER .		1,500.00	800.00
	TO PUTTY & SPRAY PAINTING & INCLUDING.		800.00	550.00
	TO APPLY RUST PROOFING ,RESEAL TUFF-COATING TREATMENT ON ACCIDENT AREA.		80.00	60.00
			2,740.00	1,670.00
GRAND TOTAL			14,532.70	7,258.55
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,800.00

Report Ref No. CC6/CTI22003238/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBL 1251Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBL 1251Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBL 1251Z

RE-INSPECTION

