



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2301668

INV Date 19/03/2023

Reference CC4/LPC22003276/Uya3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBF 8634M

Insured Veh. YN 4652Y

Claim No. 22/22/22/VC05/025607

Policy No. Z22VC05009811

Accident Date 29/03/2022

Inspection Date 12/12/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22003276/Uya3q2 Date: 19/03/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 4652Y	Veh. Inspected	GBF 8634M	
Policy No.	Z22VC05009811	Coverage (\$)	0.00	
Claim No.	22/22/22/VC05/025607	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	08/04/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA DYNA (M)	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTFAT35Y50K207040	Colour	BLUE	
Odometer	143651 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195 R15	CONDOR	6 mm	
L/H Front Tyre	195 R15	CONDOR	6 mm	
R/H Rear Tyre	155 R12 (D)	CONDOR	6/6 mm	
L/H Rear Tyre	155 R12 (D)	CONDOR	6/6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	29/03/2022	Inspection Date	12/12/2022	
Survey held at	JOO HAK KEE AUTO PTE LTD 3007 UBI ROAD 1 #01-406 KAMPONG UBI INDUSTRIAL ESTATE SINGAPORE 408701			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBF 8634M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	BADLY DENTED	1,237.10	1,237.10
1	TAILGATE HINGE OUTER LH	BENT	220.40	115.00
1	TAILGATE HINGE INNER LH	TO REPAIR SEE LABOUR	220.40	-
1	TAILGATE LATCH	BENT	95.00	95.00
1	TAILGATE LATCH CATCH	BENT	96.10	96.10
1	TAILGATE LOWER PANEL	BENT	210.40	161.00
1	TAILLAMP WHOLE SET LH	SERVICEABLE	358.10	-
	LESS 25% DISCOUNT		-609.38	-426.05
			1,828.12	1,278.15
	<u>SPECIAL NETT ITEMS</u>			
1	"70KM/H" STICKER (SN)	NECESSARY	10.00	10.00
1	"UNION" COMPANY LOGO (SN)	NECESSARY	50.00	50.00
1	"DANGER HIGHLY FLAMMABLE" STICKER (SN)	NECESSARY	100.00	80.00
			160.00	140.00
	<u>LABOUR</u>			
	TO PANEL BEAT AND RENEWAL OF ALL NECESSARY DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF TAILGATE HINGE INNER LH.		680.00	400.00
	TO SAND DOWN, PUTTY AND SPRAY PAINT ON NECESSARY DAMAGED PARTS.		780.00	500.00
	TO DISMANTLE & TAILGATE COMPONENTS.	NOT NECESSARY	80.00	-
			1,540.00	900.00
	GRAND TOTAL		3,528.12	2,318.15
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,850.00

Report Ref No. CC4/LPC22003276/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 8634M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 8634M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 8634M

RE-INSPECTION

