

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22003366/KNY3E2**Date:** 24/03/2023REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMHCSNA00003712200
Claimant Vehicle No :	SMF2583K	Insured Vehicle No :	SMC4137T
Date of Loss:	25/03/2022	Nature of Claim:	TP
		Claim No:	SNM22D202127/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMF2583K	Engine No:	PE31299527
Make & Model:	MAZDA CX-5, 2.0 (A)	Chassis No:	JM6KF2W7AK0240833
Reg. Date:	31/10/2018 (Man. Year: 2018)	Odometer:	79969 km
Colour:	Metallic Dark Blue		
Engine Capacity:	1998 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/65 R17	Rear Tyre Size:	225/65 R17
Front Left Side:	Michelin 9 mm	Rear Left Side:	Michelin 9 mm
Front Right Side:	Michelin 9 mm	Rear Right Side:	Michelin 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,446.00	6,816.20	4,629.80	40.45
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,660.00	2,405.00	2,255.00	48.39
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	16,106.00	9,221.20	6,884.80	42.75

INSPECTION

Date of Assignment:	12/04/2022	
Date Inspected:	12/04/2022	Inspected At: Spark Car Care @ Braddell (HQ) 205 BRADDELL RD Singapore 579701
Estimated Period of Repair:	6.0 days	

Adjuster: KENNETH KONG**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 24 Mar 2023)
Parts:	M1-SUV	MAZDA CX-5 2.0 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMF2583K)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Bent	1,279.00 FL	*1,279.00 FL
2	1		*REAR BUMPER SIDE RETAINER RH	Serviceable	24.00 FL	*- FL
3	1		*REAR BUMPER SIDE RETAINER LH	Distorted	24.00 FL	*24.00 FL
4	8		*REAR BUMPER CLIP	Necessary	24.00 FL	*24.00 FL
5	4		*REVERSE SENSOR	Serviceable	728.00 FL	*- FL
6	1		*TOW COVER	Serviceable	6.00 FL	*- FL
7	1		*REAR BUMPER INFORCEMENT	Bent	520.00 FL	*520.00 FL
8	1		*REAR LH BUMPER FOG LAMP	Cracked	211.00 FL	*211.00 FL
9	1		*RR LH FENDER WHEEL ARCH GARNISH	Serviceable	187.00 FL	*- FL
10	1		*REAR END PANEL	Repair	628.00 FL	*- FL
11	1		*TAILGATE	Repair	1,637.00 FL	*- FL
12	1		*REAR CX-5 EMBLEM	Necessary	41.00 FL	*41.00 FL
13	1		*REAR SKYCTIV TECHNOLOGY BADGE	Necessary	67.00 FL	*67.00 FL
14	1		*SEALANT	Not Necessary	40.00 FS	*- FS
15	1		*INNER SEAL	Not Necessary	30.00 FS	*- FS
16	1		*TAILGATE WEATHER STRIP	Serviceable	149.00 FL	*- FL
17	1		*FRT NUMBER PLATE W/CASING	Dented	45.00 FS	*45.00 FS
18	1		*FRT BUMPER	Buckled	1,024.00 FL	*1,024.00 FL
19	1		*FRT BUMPER SIDE RETAINER RH	Serviceable	16.00 FL	*- FL
20	1		*FRT BUMPER SIDE RETAINER LH	Distorted	16.00 FL	*16.00 FL
21	1		*RADIATOR GRILLE LOGO	Necessary	96.00 FL	*96.00 FL
22	1		*RADIATOR GRILLE LOGO BASE	Serviceable	58.00 FL	*- FL
23	10		*FRT BUMPER CLIP	Necessary	30.00 FL	*30.00 FL
24	1		*FRT BUMPER INFORCEMENT	Repair	615.00 FL	*- FL
25	1		*FRT SUPPORT TOP COVER	Cracked	109.00 FL	*109.00 FL
26	6		*FRT SUPPORT TOP COVER CLIP	Necessary	24.00 FL	*24.00 FL
27	1		*FRT BUMPER TOP GARNISH	Buckled	300.00 FL	*300.00 FL
28	12		*FRT BUMPER TOP GARNISH CLIP	Necessary	48.00 FL	*48.00 FL
29	1		*BRACE PANEL	Repair	27.00 FL	*- FL
30	1		*FRT NUMBER PLATE BASE	Dented	69.00 FL	*69.00 FL
31	1		*FRONT HEADLAMP	Mtg Cracked	3,562.00 FL	*3,562.00 FL
32	1		*RADIATOR GRILLE }	Cracked	1,071.00 FL	*1,020.00 FL
33	1		*RADIATOR GRILLE LOWER CHROME RH }		0.00 FL	*- FL
34	1		*RADIATOR GRILLE LOWER CHROME LH }		0.00 FL	*- FL
35	1		*RADIATOR GRILLE BASE GARNISH }		0.00 FL	*- FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	12,705.00	8,509.00
- List Item Discount on L Items 10.00/20.00% (\$)	1,259.00	1,692.80
Total Parts (\$)	11,446.00	6,816.20

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CUT WELD REAR END PANEL, PANEL BEAT ON FENDERS, PANEL BEAT ON REAR FENDER AND AFFECTED AREAS, REPLACE DAMAGE PARTS	New	1,200.00	500.00
2	TO PUTTY, RESPRAY ON REAR TAILGATE, BUMPER, END PANEL, FENDERS AND AFFECTED AREAS	New	1,200.00	750.00
3	TRANSFER PARTS TO NEW TAILGATE	New	150.00	80.00
4	REMOVE AND REFIT REAR WINDSCREEN GLASS	New	120.00	120.00
5	TUFF KOTE ON REAR AFFECTED AREAS	New	120.00	0.00
6	REMOVE REAR INTERIOR UPHOLSTERY TO ASSIST REPAIR AND REFIT	New	120.00	60.00
7	TO PANEL BEAT ON FRONT PANEL, REPLACE DAMAGED PARTS AND REALIGN AFFECTED AREAS	New	800.00	375.00
8	TO PUTTY, RESPRAY ON FRONT BUMPER, FENDER AND AFFECTED AREAS	New	900.00	500.00
9	CHECK LIGHTING AND WIRING	New	50.00	20.00
Gross Labour Cost (S\$)			4,660.00	2,405.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >