

# PRESTIGE APPRAISER SERVICES

Vehicle No : SGT 3353 M

Our Ref : PS/016/09/19

| Qty   | Descriptions                  | Conditions        | Repairer's Est. | Our Revised. |
|---|-------------------------------|-------------------|-----------------|--------------|
| <u>LIST ITEMS</u>   |                               |                   |                 |              |
| 1   | front bumper                  | dented/torn       | \$ 1,128.00     | \$ 1,128.00  |
| 1   | front bumper reinforcement    | dented            | 619.10          | 619.10       |
| 2   | front bumper sponge           | damaged           | 304.00          | 304.00       |
| 2   | front bumper bracket          | dented            | 143.20          | 143.20       |
| 2   | front bumper side retainer    | dented            | 146.00          | 146.00       |
| 1   | front bumper centre grille    | dented            | 295.00          | 295.00       |
| 1   | front bumper lower dust cover | dented            | 282.50          | 282.50 X     |
| 8   | front bumper clip             | necessary         | 64.00           | 64.00        |
| 1   | front grille                  | dented            | 625.00          | 625.00       |
| 1   | front grille emblem           | necessary         | 135.00          | 135.00       |
| 1   | R/H headlamp                  | cracked           | 943.50          | 943.50 X     |
| 1   | L/H headlamp                  | holder distorted  | 943.50          | 943.50       |
| 1   | aircon condenser              | dented/warped     | 1,347.00        | 1,347.00 X   |
| 1   | radiator assy                 | serviceable       | 1,497.00        | -            |
| 1   | bonnet                        | dented/distorted  | 1,280.60        | 1,280.60 X   |
| 2   | bonnet hinge                  | dented - repair   | 308.50          | -            |
| 1   | bonnet lock                   | dented            | 241.40          | 241.40 X     |
| 1   | L/H front fender              | dented - repair   | 785.10          | -            |
| 1   | front support panel           | dented            | 798.50          | 798.50 X     |
|   |                               |                   | 11,886.90       | 9,296.30     |
|   |                               |                   | Less 20%        | 1,859.26     |
|   |                               |                   | \$ 11,886.90    | \$ 7,437.04  |
| <u>S/NETT ITEM</u>  |                               |                   |                 |              |
| 1   | front number plate            | missing/dislodged | 120.00          | 100.00       |
| <u>Labour Charges &amp; Misc</u>                                  |                               |                   |                 |              |
| To dismantle & replace damaged parts, panel beat where necessary. |                               |                   | 1,700.00        | 1,300.00     |
| To putty, apply primer & spray-paint on the affected portion.     |                               |                   | 1,500.00        | 1,200.00     |
| To apply rust-proofing on repaired, replaced panel.               |                               |                   | 220.00          | 180.00 X     |
| To remove/renew aircon condenser & refill gas.                    |                               |                   | 260.00          | 220.00 X     |
| To check wiring functions.  |                               |                   | 120.00          | 100.00       |
|   |                               |                   | \$ 15,806.90    | \$ 10,537.04 |

**Note:** The repairer has agreed to undertake the repairs at our adjusted amount of \$9,000.00 lump sum corresponding to supply of parts, labour and spray-painting charges.

Under normal circumstances, the estimated repair period would be FIVE (5) days.

Pursuant to your instruction we have not authorised repairs on your behalf.

4 days

PRESTIGE APPRAISER SERVICES

LOUIS S C NG CAE AMIMI (UK)

Licensed Appraiser

Dip. MTM. Automotive Engineer