

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22003659/APA3Q2**Date:** 02/11/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100374667
Claimant Vehicle No :	SMH7003A	Insured Vehicle No :	SGB3121X
Date of Loss:	13/04/2022	Nature of Claim:	TP
		Claim No:	7139384061SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMH7003A		
Make & Model:	NISSAN NOTE E-POWER, 1.2 L PREMIUM (A)	Engine No:	HR12264077K
Reg. Date:	30/04/2021 (Man. Year: 2021)	Chassis No:	JN1FAAE13Z0900039
Colour:	Blue	Odometer:	20778 km
Engine Capacity:	1198 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/60 R16	Rear Tyre Size:	185/60 R16
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	51,344.74	24,886.35	26,458.39	51.53
Miscellaneous Items	0.00	0.00	0.00	
Labour	13,090.00	5,120.00	7,970.00	60.89
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	64,434.74	30,006.35	34,428.39	53.43
Approved Total (Overridden) (S\$)		24,000.00		
Nett Amount (S\$)	64,434.74	24,000.00	40,434.74	62.75
+ Car Rental (18.0 x S\$100.00/day) (S\$)		1,800.00		
+ Doc/Search Fee (S\$)		38.45		
Nett Liability (S\$)		25,838.45		
Global Sum Settlement (S\$)		25,500.00		

INSPECTION

Date of Assignment:	18/04/2022	
Date Inspected:	18/04/2022	Inspected At: HD Perfect Autowork Pte Ltd (HQ) 8 Kaki Bukit Ave 4, #08-09 Premier @ Kaki Bukit Singapore 415875
Estimated Period of Repair:	16.0 days	

Adjuster: ADRIAN LING**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER (UPPER)	Deformed	493.00 FL	*493.00 FL
2	1		*FRONT BUMPER (LOWER)	Deformed	323.00 FL	*323.00 FL
3	2		*FRONT BUMPER SIDE CHROME MOULDING	Cracked	184.00 FL	*184.00 FL
4	1		*FRONT BUMPER SPONGE	N/S Cracked	110.00 FL	*55.00 FL
5	2		*FRONT BUMPER FOGLAMP	Cracked	724.00 FL	*724.00 FL
6	1		*FRONT BUMPER TOW COVER	Not Necessary	28.00 FL	*- FL
7	1		*FRONT BUMPER REINFORCEMENT	Dented	592.00 FL	*592.00 FL
8	2		*FRONT BUMPER SIDE RETAINER	Not Necessary	80.20 FL	*- FL
9	1		*FRONT BUMPER BOTTOM COVER	Not Necessary	408.50 FL	*- FL
10	4		*FRONT BUMPER SENSOR	Damaged (2 PCS ONLY)	1,001.60 FL	*500.80 FL
11	1		*FRONT BUMPER SENSOR WIRE HARNESS	Not Necessary	132.00 FL	*- FL
12	1		*BONNET	Dented	1,004.30 FL	*1,004.30 FL
13	1		*BONNET LOCK CABLE	Not Necessary	44.00 FL	*- FL
14	1		*BONNET INSULATOR	Not Necessary	141.00 FL	*- FL
15	1		*BONNET LOCK	Not Necessary	77.00 FL	*- FL
16	1		*BONNET SWITCH CONNECTOR C/W WIRE	Not Necessary	122.00 FL	*- FL
17	4		*BONNET STOPPER	Not Necessary	24.00 FL	*- FL
18	2		*BONNET HINGE	Bent	130.00 FL	*130.00 FL
19	2		*FRONT FENDER	Dented	1,372.00 FL	*1,372.00 FL
20	2		*FRONT FENDER INNER SHIELD	Not Necessary	240.00 FL	*- FL
21	1		*FRONT GRILLE TOP COVER GARNISH	Deformed	96.00 FL	*96.00 FL
22	1		*FRONT GRILLE	Cracked	497.00 FL	*497.00 FL
23	1		*FRONT GRILLE LOGO	Necessary	85.00 FL	*85.00 FL
24	2		*HEADLAMP (LED)	Cracked	5,280.00 FL	*5,280.00 FL
25	1		*FRONT SUPPORT PANEL	Repair	605.30 FL	*- FL
26	1		*FRONT RADAR SENSOR	Not Necessary	1,878.00 FL	*- FL
27	2		*AIR CONDENSER AIR GUARD (TOP)	Deformed	176.00 FL	*176.00 FL
28	2		*AIR CON CONDENSER AIR GUARD (SIDE)	Deformed	202.00 FL	*202.00 FL
29	2		*AIR CON CONDENSER MOUNTING RUBBER	Not Necessary	202.00 FL	*- FL
30	1		*AIR CON CONDENSER	Dented	876.00 FL	*876.00 FL
31	2		*AIR CON CONDENSER BRACKET	Not Necessary	50.00 FL	*- FL
32	1		*RADIATOR	Warpped	1,135.00 FL	*1,135.00 FL
33	1		*RADIATOR FAN COWLING	Cracked	465.00 FL	*465.00 FL
34	1		*RADIATOR FAN MOTOR	Not Necessary	579.00 FL	*- FL
35	2		*HYBRID SYSTEM COOLER	Bent	1,053.00 FL	*1,053.00 FL
36	2		*HORN	Not Necessary	218.00 FL	*- FL
37	1		*REAR BUMPER	Distorted	653.00 FL	*653.00 FL
38	2		*REAR BUMPER SIDE GARNISH	Torn	990.00 FL	*580.00 FL
39	2		*REAR BUMPER BRACKET	Dented	230.00 FL	*230.00 FL
40	1		*REAR BUMPER SPONGE	Cracked	168.00 FL	*168.00 FL
41	2		*REAR BUMPER SIDE RETAINER	Not Necessary	90.00 FL	*- FL
42	4		*REAR REVERSE SENSOR	Damaged (2 PCS ONLY)	1,001.60 FL	*500.80 FL
43	4		*REAR REVERSE SENSOR HOLDER	Necessary	272.00 FL	*100.00 FL
44	1		*REAR REVERSE SENSOR WIREHARNESS	Not Necessary	342.00 FL	*- FL
45	2		*REAR FENDER	Repair	2,152.00 FL	*- FL
46	2		*REAR FENDER INNER COWLING	Not Necessary	361.20 FL	*- FL
47	2		*REAR FENDER INNER TRIM	Deformed	1,168.00 FL	*1,168.00 FL
48	2		*REAR FENDER AIR VENT	Not Necessary	146.00 FL	*- FL
49	2		*REAR WHEEL HOUSE PANEL	Not Necessary	1,608.00 FL	*- FL
50	2		*REAR QUARTER GLASS C/W MOULDING	Not Necessary	1,040.00 FL	*- FL
51	2		*REAR DOOR	Not Necessary	2,390.00 FL	*- FL
52	2		*REAR DOOR WEATHERSTRIP	Not Necessary	208.00 FL	*- FL
53	2		*REAR DOOR INNER LOCK	Not Necessary	374.00 FL	*- FL
54	2		*REAR DOOR GLASS FRAME STICKER (BLACK)	Not Necessary	136.00 FL	*- FL
55	2		*REAR DOOR OUTER MOULDING	Not Necessary	286.00 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	2		*REAR DOOR INNER TRIM BOARD	Not Necessary	2,372.00 FL	*- FL
57	2		*TAIL LAMP	N/S Cracked / O/S Cut	1,338.00 FL	*965.00 FL
58	2		*TAIL LAMP PANEL (OUTER)	Dented	1,116.00 FL	*630.00 FL
59	1		*TAIL GATE	Distorted	1,535.00 FL	*1,210.00 FL
60	2		*TAIL GATE LAMP	Cut	730.40 FL	*730.40 FL
61	1		*TAIL GATE EMBLEM NOTE	Necessary	86.20 FL	*86.20 FL
62	1		*TAIL GATE WINDSCREEN C/W MOULDING	Necessary	1,293.00 FL	*250.00 FL
63	1		*TAIL GATE WIPER MOTOR	Not Necessary	502.00 FL	*- FL
64	2		*TAIL GATE NUMBER PLATE LAMP	Not Necessary	174.00 FL	*- FL
65	2		*TAIL GATE DAMPER	Damaged	452.00 FL	*452.00 FL
66	1		*TAIL GATE DETECTOR	Cracked	172.00 FL	*172.00 FL
67	2		*TAIL GATE STOPPER	Not Necessary	56.00 FL	*- FL
68	1		*TAIL GATE INNER LOCK	Damaged	381.50 FL	*228.00 FL
69	1		*TAIL GATE LOCK CATCH	Not Necessary	38.00 FL	*- FL
70	1		*TAIL GATE WEATHER STRIP	Cut	204.00 FL	*204.00 FL
71	1		*TAIL GATE INNER TRIM	Cracked	422.00 FL	*422.00 FL
72	1		*TAIL GATE OUTER MOULDING C/W HANDLE	Not Necessary	454.00 FL	*- FL
73	1		*TAIL GATE INNER HOLDER	Not Necessary	56.00 FL	*- FL
74	1		*REAR END PANEL	Distorted	869.00 FL	*540.00 FL
75	1		*REAR END PANEL TOP GARNISH	Deformed	75.00 FL	*75.00 FL
76	1		*REAR FLOOR PANEL	Buckled	986.00 FL	*986.00 FL
77	1		*REAR FLOOR PANEL CROSSMEMBER	Not Necessary	1,300.00 FL	*- FL
78	1		*REAR FLOOR PANEL TOP BOARD	Deformed	468.00 FL	*468.00 FL
79	1		*REAR TOOLS SPONGE BOX	Deformed	195.00 FL	*195.00 FL
80	1		*REAR CHASSIS FRAME LH	Repair	1,095.00 FL	*- FL
81	1		*CENTER EXHAUST	Not Necessary	1,739.00 FL	*- FL
82	1		*CENTER EXHAUST INSULATOR	Not Necessary	163.30 FL	*- FL
83	1		*SET CENTER EXHAUST GASKET	Not Necessary	80.00 FL	*- FL
84	1		*REAR EXHAUST PIPE	Dented	695.00 FL	*695.00 FL
85	1		*REAR EXHAUST INSULATOR	Not Necessary	146.30 FL	*- FL
86	1		*SET REAR EXHAUST GASKET	Not Necessary	80.00 FL	*- FL
87	1		*REAR EXHAUST MOUNTING	Not Necessary	321.20 FL	*- FL
88	1		*FRONT NUMBER PLATE	Cracked	50.00 FS	*50.00 FS
89	1		*SET FRONT BUMPER CLIP	Necessary	80.00 FS	*30.00 FS
90	1		*SET FRONT GRILLE CLIP	Necessary	30.00 FS	*20.00 FS
91	1		*SET BONNET INSULATOR CLIP	Not Necessary	50.00 FS	*- FS
92	1		*FRONT SUPPORT PANEL SEALANT	Not Necessary	80.00 FS	*- FS
93	1		*SET FRONT FENDER COWLING CLIP	Not Necessary	80.00 FS	*- FS
94	1		*RADIATOR COOLANT	Necessary	60.00 FS	*40.00 FS
95	1		*REAR NUMBER PLATE	Deformed	50.00 FS	*50.00 FS
96	1		*SET REAR BUMPER CLIP	Necessary	80.00 FS	*30.00 FS
97	1		*SET TAIL GATE INNER TRIM CLIP	Necessary	50.00 FS	*30.00 FS
98	1		*TAIL GATE WINDSCREEN SEALANT	Necessary	80.00 FS	*40.00 FS
99	1		*TAIL GATE WINDSCREEN INNER SEAL	Necessary	60.00 FS	*30.00 FS
100	1		*SET TAIL LAMP CLIP	Necessary	40.00 FS	*20.00 FS
101	2		*TAIL LAMP PANEL SELANAT (OUTER)	Not Necessary	120.00 FS	*- FS
102	2		*REAR FENDER SEALANT	Not Necessary	160.00 FS	*- FS
103	1		*SET REAR FENDER INNER COWLING	Not Necessary	80.00 FS	*- FS
104	1		*SET REAR FENDER INNER TRIM CLIPS	Necessary	80.00 FS	*30.00 FS
105	1		*REAR WHEEL HOUSE PANEL SEALANT	Not Necessary	80.00 FS	*- FS
106	2		*REAR QUARTER GLASS SEALANT	Not Necessary	120.00 FS	*- FS
107	2		*REAR QUARTER GLASS INNER SEAL	Not Necessary	80.00 FS	*- FS
108	1		*REAR END PANEL INSULATION SEAL	Necessary	150.00 FS	*60.00 FS
109	1		*REAR FLOOR PANEL INSULATION SEAL	Necessary	350.00 FS	*200.00 FS
110	1		*BRAKE OIL	Not Necessary	30.00 FS	*- FS
111	1		*REAR TRAINGLE BREAKDOWN SIGN	Not Necessary	180.00 FS	*- FS
112	1		*REVERSE CAMERA	Not Necessary	450.00 FS	*- FS
113	1		*REVERSE SENSOR	Repeated	220.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 56,728.60 27,581.50

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
- List Item Discount on L Items 10.00/10.00% (S\$)					5,383.86	2,695.15
Total Parts (S\$)					51,344.74	24,886.35
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING ,REMOVING AND REPLACING PARTS	New	1,200.00	800.00
2	SPRAY PAINTING TO AFFECTED AREA	New	1,200.00	800.00
3	CONDUCT WATER LEAKAGE TEST	New	180.00	0.00
4	REMOVE AND REFIX AIRCON CONDENSOR AND REFILL AIRCON GAS	New	120.00	60.00
5	REMOVE AND REFIX RADIATOR AND CONDUCT PRESSURE TEST	New	80.00	60.00
6	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC	New	180.00	0.00
7	PANEL BEATING ,REMOVING AND REPLACING PARTS	New	4,500.00	1,400.00
8	SPRAY PAINTING TO AFFECTED AREA	New	2,600.00	1,400.00
9	TUFF COAT	New	250.00	120.00
10	WIRING CHECK	New	180.00	30.00
11	REMOVE AND REFIX CUSHION SEAT/UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR	New	550.00	100.00
12	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING	New	80.00	50.00
13	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING	New	80.00	50.00
14	REAR CHASSIS ALIGNMENT	New	250.00	0.00
15	TRANFER REAR DOOR MECHANISM	New	80.00	0.00
16	REMOVE AND REFIX TAILGATE WINDSCREEN	New	150.00	120.00
17	REMOVE & REINSTALL REAR QUARTER GLASS X2	New	200.00	0.00
18	TRANFER TAILGATE MECHANISM	New	80.00	80.00
19	CONDUCT WATER LEAKAGE TEST	New	80.00	0.00
20	REMOVE AND REFIX FUEL TANK TO FACILITATE FENDER REPLACEMENT	New	100.00	0.00
21	REMOVE AND REFIX REAR UNDERCARRIAGE	New	650.00	0.00
22	REMOVE AND REPLACE VIDEO RECORDER	New	120.00	50.00
23	REMOVE AND REFIX REAR EXHAUST PIPE	New	180.00	0.00
Gross Labour Cost (\$\$)			13,090.00	5,120.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >