

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/CTI17001550/AH3M2  
**Date:** 10/03/2017

### REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMHCSN1676161600
<b>Claimant Vehicle No :</b>	SGX7161M	<b>Insured Vehicle No :</b>	SLD244D
Date of Loss:	21/01/2017	Nature of Claim:	TP
			Claim No: SNM17D00476C02

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SGX7161M</b>	Engine No:	2AZF057046
Make & Model:	TOYOTA ESTIMA, 2.4 (A)	Chassis No:	ACR500043448
Reg. Date:	03/09/2007 (Man. Year: 2007)	Odometer:	157204 km
Colour:	Silver		
Engine Capacity:	2362 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

### CONDITION OF TYRES

Front Tyre Size:	225/50 R17	Rear Tyre Size:	225/50 R17
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment:	24/01/2017	
Date Inspected:	24/01/2017	Inspected At: Twincar Automotive Pte Ltd (Kaki Bukit) BLK 2 KAKI BUKIT, #01-17/18 KAKI BUKIT AUTOHUB Singapore 417921
Estimated Period of Repair:	0.0 days	

**Adjuster:** ADRIAN LING

**Manager:** Ashley Chong Chin Yan

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

**SPECIAL REMARKS**

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$9,000.00 -\$10,000.00

## REPAIR DETAILS

### Reference

**Part Source:** MRM-SG      Version: 1.0 (Last Synchronised: 09 Mar 2017)

**Parts:**      M1-MPV      TOYOTA ESTIMA 2.4 (A) (Catalogue:Merimen Singapore 1.0)

**Labour:**      Repairer's      (Price-denominated Standard List)

**Print Code:** **LKK Auto Consultants Pte Ltd/SGX7161M/10/03/2017 16:40**

**Validity:**      These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk \*.

### Recommended Parts

There are no new parts selected.

**LKK Auto Consultants Pte Ltd/SGX7161M/10/03/2017 16:40.** Not valid without Reference section.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

LKK Auto Consultants Pte Ltd/SGX7161M/10/03/2017 16:40. Not valid without Reference section.
--

< END OF ESTIMATES >