

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Email: mirage1195@gmail.com, Mobile: 90610543

INVOICE

Lee Zhi Hao c/o Blk 3023A Ubi Road 1 #01-63 Singapore 408716

Invoice no:	POS0319/22
Date:	13 April 2022
Report no:	319M22.SSH
Vehicle :	JSN7092

No	Item Description	Qty	Unit Price	Total Amount (\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			315.00
SGD(\$): Three hundred and Fifteen only			Grand Total:	315.00

"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES



Authorised Signature

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Email: mirage1195@gmail.com, Mobile: 90610543

ACCIDENT VEHICLE INSPECTION REPORT

Report no : 319M22.SSH
Vehicle no : JSN7092

1 REFERENCE

Date of inspection : 17 March 2022
Requested by : Lee Zhi Hao
c/o Blk 3023A Ubi Road 1
#01-63
Singapore 408716
Type of survey : Independent
Repairer : Sin Seng Hong Spray Painting & Services
Blk 3023A Ubi Road 1, #01-63 Singapore 408717
Date of accident : 10 March 2022

2 VEHICLE DATA

Make/model : Yamaha Y15ZR
Chassis no : PMYUG0510J0129230
Engine no : G3D3E129330
Year of manufacture : 2018
Engine capacity : 150 cc
Colour : Blue

3 STATIC CONDITION CHECK

Steering : Serviceable
Foot brakes : Serviceable
Hand brakes : Serviceable
Paintwork : Good
General Condition : Good

<u>4 TIRE CONDITION CHECK</u>	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 5 mm/Maxxis	5 mm/Maxxis	80/90-17
Rear tread	: 5 mm/Metzeler	5 mm/Metzeler	110/70-17

5 BRIEF DESCRIPTION OF DAMAGE

Mirror scraped/glass cracked, handlebar bent, RH leg shield scraped, RH rear side board grazed, exhaust muffler protector & end cap abraded, etc. Please see para. 8 of this report for more details.

6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and we have not authorized any repairs.

7 RECOMMENDATION

Cost of repairs : **\$1,000.00** (lump sum)
No. of days taken : **Two (2)**

8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 319M22.SSH

Vehicle no: JSN7092

A SPARE PARTS

Description	Qty	Assessed Condition	Repairer's Amount	Revised Amount	
Mirror set ✓	1	scraped/glass cracked	48.00	48.00	
Brake lever ✓	1	end abraded	22.00	22.00	
Handlebar ✓	1	bent	70.00	70.00	
Handlebar end balancer set ✓	1	end scraped	44.00	44.00	22
Front fender ✓	1	scraped	80.00	80.00	
Front cowling base support ✓	1	side abraded	125.00	125.00	
RH leg shield ✓	1	scraped	88.00	88.00	
RH leg shield Yamaha logo ✓	1	scraped	22.00	22.00	
RH front winker light ✓	1	abraded	45.00	45.00	
Front footrest RH ✓	1	dented/scraped	35.00	35.00	
Rear brake foot pedal ✓	1	abraded/bent	39.00	39.00	
Exhaust muffler SVC	1	to reuse	350.00	0.00	
Exhaust muffler protector ✓	1	abraded	60.00	60.00	
Exhaust muffler end cap ✓	1	abraded	38.00	38.00	
Rear side board RH ✓	1	grazed	110.00	110.00	
		Subtotal of the above	1,176.00	826.00	804
		Discount 10%	117.60	82.60	
(Special nett)		Subtotal 1:	1,058.40	743.40	723.6
Body cover sticker set ✓	1	necessary	210.00	210.00	95
		Subtotal 2:	210.00	210.00	

Total cost of parts: 1,268.40 953.40

B LABOUR

Labour charges to replace and repair damaged parts and areas. 300.00 200.00 150

Total cost of labour: 300.00 200.00

Total cost of repair: 1,568.40 1,153.40

9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is \$1,153.40 968.6

(a) The recommended cost of repair based on lump sum repairs would be

\$1,000.00

-20%: 750

(b) The estimated number of days for the repairs would be

Two (2)


The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.

2 Days

Note: Lump Sum Repair Basis

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

Prepared by:

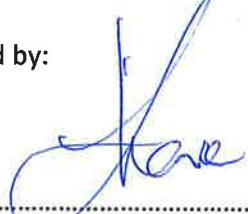

Liaw Leong San
Licensed Automotive Appraiser

Dated: 13 April 2022















