

GBJ 4042B  
OD/china

**Cheng Hoe Motor Pte Ltd**  
**#01-374/382, Blk 1019, Yishun**  
**Industrial Park A**  
**768761**

**Insurer Reference: GBJ4042B**

**Repairer Reference: A0409**

**Date calculated: 29/04/2022 12:51 PM**

**Full Report**

**Registration: GBJ4042B**

**Printed: 29/04/2022 12:51 PM**

### Summary Information

#### Claim

|                        |                |                   |                                             |
|------------------------|----------------|-------------------|---------------------------------------------|
| Location:              | Singapore (SG) | Work Provider:    | China Taiping Insurance (Singapore) Pte Ltd |
| Printed by:            | CHENG HOE      | Currency:         | SGD                                         |
| Claim Reference:       | GBJ4042B       | Date of Incident: | 21/04/22                                    |
| Estimated Repair Time: |                | Hire Car Start:   |                                             |
| Actual Repair Days:    |                | Hire Car End:     |                                             |

### Vehicle Details

#### Vehicle

|                     |                   |
|---------------------|-------------------|
| Manufacturer:       | FUSO              |
| Model:              | CANTER (FB/FE/FG) |
| Sub Model:          | BASE MODEL        |
| Model Sheet Number: | 32 87 01          |
| Registration:       | GBJ4042B          |
| VIN number:         | FEA01BA30056      |
| Odometer:           |                   |

#### Model Specs

|                     |                  |                 |                     |
|---------------------|------------------|-----------------|---------------------|
| FROM 04.2018        | AIR CONDITIONING | CENTRAL LOCKING | DUAL DOOR MIRROR    |
| EMISSION STD EURO 6 | 3.0 LTR 96 KW    | 5 SPEED GEARBOX | ABS                 |
| DRIVER AIRBAG       | REAR WHEEL DRIVE | SINGLE CAB      | PREPARE OFF VEHICLE |
| TWO COAT PEARL/MICA |                  |                 |                     |

*Not Notified*

*Ex @ 600k*  
*1. B. 1*

*12 days*

**LKK Auto Consultants** hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

| Code | Description             | Part Number | Part Source | Price SGD |   |
|------|-------------------------|-------------|-------------|-----------|---|
| 1008 | AIR DUCT TOP            | PARTS       | Original    | 380.00    | ✓ |
| 0432 | BADGE                   | MK546617    | Original    | 70.00     | ✓ |
| 0433 | BADGE                   | MK675497    |             | 0.00      |   |
| 7568 | BRAKE PEDAL SWITCH      | MK645251    | Original    | 210.00    | ✓ |
| 1009 | BRAKE VALVE             | PARTS       | Original    | 240.00    | ✓ |
| 2810 | CAB SUPPORT             | MK622579    | Original    | 480.00    | ✓ |
| 4500 | COMPRESSOR PIPE         | MK574768    | Original    | 395.00    | ✓ |
| 4499 | CONDENSER/COMPR<br>PIPE | MK629046    | Original    | 390.00    | ✓ |
| 1005 | DOOR STICKER"BLUTEC"    | PARTS       | Original    | 30.00     | ✓ |
| 1004 | DOOR<br>STICKER"DUONIC" | PARTS       | Original    | 30.00     | ✓ |
| 0281 | FRONT BUMPER            | MC978515    | Original    | 650.00    | ✓ |
| 0410 | FRONT GRILLE            | MC975208    | Original    | 350.00    | ✓ |
| 0900 | FRONT PANEL CPL         | ML230262    | Original    | 550.00    | ✓ |
| 1392 | FRONT PANEL TRIM        | MC976000    | Original    | 450.00    | ✓ |
| 2811 | FRONT TORSION BAR       | MK622762    | Original    | 390.00    | ✓ |
| 4445 | HEATER BLOWER           | MK583368    | Original    | 450.00    | ✓ |
| 4446 | HEATER CPL              | MK583360    | Original    | 980.00    | ✓ |
| 9645 | HORN                    | MX916514    | Original    | 78.00     | ✓ |
| 4369 | INSTRUMENT COVER        | MK569139    | Original    | 290.00    | ✓ |
| 4331 | INSTRUMENT PANEL        | ML231452    | Original    | 800.00    | ✓ |
| 2813 | L/CAB ATTACHMENT        | MK622439    | Original    | 165.00    | ✓ |
| 0283 | L/F BUMPER BRACKET      | MK617973    | Original    | 95.00     | ✓ |
| 0289 | L/F BUMPER CORNER       | MK617983    | Original    | 170.00    | ✓ |
| 2825 | L/F DAMPER BUFFER       | MK622528    | Original    | 520.00    | ✓ |
| 1453 | L/FR WIPER ARM          | ML259169    | Original    | 105.00    | ✓ |
| 4359 | LWR INSTR PANEL TRIM    | MK620586    | Original    | 280.00    | ✓ |
| 2814 | R/CAB ATTACHMENT        | MK622440    | Original    | 165.00    | ✓ |
| 0320 | R/COVER BRACKET         | MK580695    | Original    | 0.00      |   |
| 7166 | R/F BRAKE HOSE          | MK584368    | Original    | 145.00    | ✓ |
| 0284 | R/F BUMPER BRACKET      | MK617974    | Original    | 95.00     | ✓ |
| 0290 | R/F BUMPER CORNER       | MK617989    | Original    | 170.00    | ✓ |
| 0888 | R/F CORNER PANEL        | MC976411    | Original    | 260.00    | ✓ |
| 2826 | R/F DAMPER BUFFER       | MK622528    | Original    | 520.00    | ✓ |
| 0678 | R/F INDICATOR           | MX915955    | Original    | 120.00    | ✓ |
| 2206 | R/F STEP                | MK677507    | Original    | 160.00    | ✓ |
| 1007 | R/HEADLAMP RUBBER       | PARTS       | Original    | 18.00     | ✓ |
| 1578 | R/INN DOOR LOCK         | MK434990    | Original    | 185.00    | ✓ |
| 1496 | R/LOWER DOOR HINGE      | MK997204    | Original    | 65.00     | X |
| 0718 | R/POSITION LAMP         | MK580530    | Original    | 130.00    | ✓ |
| 4497 | REAR PRESSURE HOSE      | MK629045    | Original    | 70.00     | ✓ |
| 2228 | RIGHT A-PILLAR          | MK704924    | Original    | 750.00    | ✓ |
| 2280 | RIGHT B-PILLAR          | MK702616    | Original    | 380.00    | X |
| 0562 | RIGHT HEADLAMP ASSY     | MK580526    | Original    | 290.00    | ✓ |
| 1401 | WINDSCREEN              | MK403591    | Original    | 440.00    | ✓ |
| 1411 | WINDSCREEN BOND KIT     | Z2156507    |             | 0.00      |   |
| 1410 | WINDSCREEN SEAL         | MX943765    | Original    | 220.00    | ✓ |
| 1469 | WIPER LINKAGE           | MK580573    | Original    | 198.00    | ✓ |

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

**Savings**  
**Subtotal**

**Total**

0.00  
12,929.00  
12,929.00

## Extras

| Code                | Description      | Price SGD               |
|---------------------|------------------|-------------------------|
| 1002                | FRT NO.PLATE     | B <sub>1</sub> 18.00* ✓ |
| 1003                | DOOR COY STICKER | me 20.00* ✓             |
| 1006                | ERP BRACKET      | me 20.00* ✓             |
| <b>Total Extras</b> |                  | <b>58.00</b>            |

### Final Calculation

|                                       | SGD       | SGD              |
|---------------------------------------|-----------|------------------|
| <b>Parts</b>                          | 12,929.00 |                  |
| <b>Total Parts</b>                    |           | <b>12,929.00</b> |
| <b>Labour Time Base 10 WU/h</b>       |           |                  |
| Total 572.0 WU X 42.00 SGD/h          | 2,402.40  |                  |
| <b>Total of Labour</b>                |           | <b>2,402.40</b>  |
| <b>Total Of Extras</b>                |           | <b>58.00</b>     |
| <b>Paint Work Time Base 10 WU/h</b>   |           |                  |
| Labour Cost 183.0 WU X 42.00 SGD/h    | 768.60    |                  |
| Material Cost                         | 262.25    |                  |
| <b>Total Paint Including Material</b> |           | <b>1,030.85</b>  |
| <b>Repair Cost Excludes GST</b>       |           | <b>16,420.25</b> |
| GST (+7.0%)                           |           | <b>1,149.42</b>  |
| <b>Repair Cost Included GST</b>       |           | <b>17,569.67</b> |

### Comments

\* - USER SUPPLIED DATA  
 NN - NO MANUFACTURERS CODE EXISTS  
 ) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.

| Code                             | Description                         | WU           | Price SGD       |
|----------------------------------|-------------------------------------|--------------|-----------------|
| NO NUMBER                        | R + R RIGHT FRONT DOOR              | 6.0          | 25.20           |
| NO NUMBER                        | R + R RIGHT FRONT DOOR TRIM         | 3.0          | 12.60           |
| NO NUMBER                        | R + R RIGHT FRONT DOOR WINDOW       | 2.0          | 8.40            |
| NO NUMBER                        | R + R R/DOOR MIRROR CPL             | 8.0          | 33.60           |
| NO NUMBER                        | R + R R/DOOR LOCK                   | 3.0          | 12.60           |
| NO NUMBER                        | R + R R/DOOR HINGE/S                | 1.0          | 4.20            |
| NO NUMBER                        | R + R FRONT FLOOR CARPET            | 4.0          | 16.80           |
| NO NUMBER                        | R + R UPPPR REAR PANEL TRIM         | 4.0          | 16.80           |
| NO NUMBER                        | R + R R/F SEAT                      | 2.0          | 8.40            |
| NO NUMBER                        | R + R DEFROSTER HOUSING             | 15.0         | 63.00           |
| NO NUMBER                        | R + R HEATING CPL                   | 4.0          | 16.80           |
| NO NUMBER                        | RENEW DASHBOARD                     | 49.0         | 205.80          |
| NO NUMBER                        | R + R STEERING WHEEL                | 3.0          | 12.60           |
| NO NUMBER                        | R + R BRAKE PEDAL CONTACT           | 1.0          | 4.20            |
| NO NUMBER                        | R + R HEAT EXCHANGER                | 6.0          | 25.20           |
| NO NUMBER                        | DETACH + REFIT RADIATOR             | 4.0          | 16.80           |
| NO NUMBER                        | R + R CONDENSER                     | 8.0          | 33.60           |
| NO NUMBER                        | R + R PRESSURE PIPE                 | 3.0          | 12.60           |
| NO NUMBER                        | R + R AIR CON COMPRESSOR/DRYER PIPE | 5.0          | 21.00           |
| NO NUMBER                        | R + R CONDENSER/COMPRESSOR PIPE     | 4.0          | 16.80           |
| NO NUMBER                        | R + R RADIATOR                      | 10.0         | 42.00           |
| NO NUMBER                        | DRAIN + REFILL AIR CONDITIONING     | 5.0          | 21.00           |
| NO NUMBER                        | VENT FRONT BRAKE SYSTEM             | 3.0          | 12.60           |
| NO NUMBER                        | R + R R/F BRAKE PIPE                | 1.0          | 4.20            |
| NO NUMBER                        | R + R R/F WHEEL                     | 1.0          | 4.20            |
| NO NUMBER                        | ADJUST HEADLAMPS                    | 2.0          | 8.40            |
| 1000                             | CABIN REMOVE&REFIT                  | 40 50.0*     | 210.00          |
| 0901                             | FRONT PANEL REPAIR                  | 20.0*        | 84.00           |
| 1482                             | RIGHT FRONT DOOR REPAIR             | 15 20.0*     | 84.00           |
| 4232                             | R/SIDE MEMBER REPAIR                | 20.0*        | 84.00           |
| 4242                             | R/F WHEELARCH PANEL REPAIR          | 10 20.0*     | 84.00           |
| 4253                             | FRONT PEDAL FLOOR REPAIR            | 15 20.0*     | 84.00           |
| 1001                             | WIRE HARNESS REPAIR                 | 20.0*        | 84.00           |
| <b>Labour Cost</b>               |                                     | <b>Hrs</b>   | <b>WU</b>       |
| <b>Panel / Mechanical Labour</b> |                                     | <b>57.20</b> | <b>572.0</b>    |
| <b>Total of Labour</b>           |                                     |              | <b>2,402.40</b> |

## Paint

| Paint Work | SYSTEM AZT                           | Time Basis 10 WU/h |
|------------|--------------------------------------|--------------------|
| Code       | Description - TWO COAT PEARL/MICA    | WU Price SGD       |
|            | FRONT BUMPER NEW PART PAINTING       | 11.0               |
|            | R/F CORNER PANEL NEW PART PAINTING   | 8.0                |
|            | FRONT PANEL CPL NEW PART PAINTING    | 30.0               |
|            | RIGHT A-PILLAR NEW PART PAINTING     | 8.0                |
|            | RIGHT B-PILLAR NEW PART PAINTING     | 16.0               |
|            | CAB SUPPORT SURFACE PAINT            | 5.0                |
|            | FRONT TORSION BAR SURFACE PAINT      | 4.0                |
|            | L/CAB ATTACHMENT SURFACE PAINT       | 4.0                |
|            | R/CAB ATTACHMENT SURFACE PAINT       | 4.0                |
|            | R/SIDE MEMBER SURFACE PAINT          | 4.0                |
|            | L/F BUMPER CORNER NEW PART PAINT K1R | 4.0                |
|            | R/F BUMPER CORNER NEW PART PAINT K1R | 4.0                |