

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/HLA22004157/RVCE2

Date: 20/06/2022

REFERENCE

Handling Insurer: HL Assurance Pte Ltd Policy No: MP311283
Claimant Vehicle No : SFW5148H Insured Vehicle No : SML7566X
Date of Loss: 01/05/2022 Nature of Claim: TP Claim No: MPC03370/ANA

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SFW5148H**
Make & Model: TOYOTA PRIUS, 1.5 (A) Engine No: 1NZ5264296
Reg. Date: 10/03/2009 (Man. Year: 2008) Chassis No: NHW207851138
Colour: Grey Odometer: 216275 km
Engine Capacity: 1496 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65 R15 Rear Tyre Size: 195/65 R15
Front Left Side: West Lake 6 mm Rear Left Side: West Lake 6 mm
Front Right Side: West Lake 6 mm Rear Right Side: West Lake 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	13,383.45	8,569.32	4,814.13	35.97
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,180.00	2,940.00	4,240.00	59.05
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	20,563.45	11,509.32	9,054.13	44.03
Approved Total (Overridden) (S\$)		9,200.00		
Nett Amount (S\$)	20,563.45	9,200.00	11,363.45	55.26

INSPECTION

Date of Assignment: 05/05/2022
Date Inspected: 05/05/2022 Inspected At: Ngiak Motor Works - Sin Ming Blk 1 (HQ)
Singapore 575636
Estimated Period of Repair: 10.0 days

Adjuster: MOHD RASUL

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 20 Jun 2022)
Parts:	144	TOYOTA PRIUS 1.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SFW5148H)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BONNET	Buckled	736.10 FL	*736.10 FL
2	1		*FRONT BONNET TOYOTA LOGO	Necessary	49.80 FL	*49.80 FL
3	1		*FRONT BONNET HINGES (2PCS)	Bent (1Pc Only)	98.60 FL	*49.30 FL
4	1		*FRONT BONNET LOCK	Not Necessary	145.70 FL	*- FL
5	1		*FRONT RH DOOR SIDE MIRROR ASSY	Cracked	756.10 FL	*756.10 FL
6	1		*FRONT RH FENDER	Buckled	689.00 FL	*689.00 FL
7	1		*FRONT RH FENDER SIGNAL LAMP ASSY	Not Necessary	55.70 FL	*- FL
8	1		*FRONT RH FENDER HYBRID PLATE	Necessary	39.50 FL	*39.50 FL
9	1		*FRONT RH FENDER INNER SHIELD	Torn	161.40 FL	*161.40 FL
10	1		*SET INNER SHIELD CLIPS	Necessary	30.00 FL	*30.00 FL
11	1		*FRONT BUMPER	Torn	520.80 FL	*520.80 FL
12	1		*FRONT BUMPER REINFORCEMENT	Bent	495.60 FL	*495.60 FL
13	1		*FRONT BUMPER INNER FOAM	Cracked	148.50 FL	*148.50 FL
14	1		*SET FRONT BUMPER CLIPS	Necessary	45.00 FL	*45.00 FL
15	1		*FRONT BUMPER SIDE RETAINER (2PCS)	Distorted (1Pc Only)	100.60 FL	*50.30 FL
16	1		*FRONT BUMPER RH FOG LAMP ASSY	Cracked	296.30 FL	*296.30 FL
17	1		*FRONT BUMPER RH FOG LAMP GRILLE	Scratched	39.40 FL	*39.40 FL
18	1		*FRONT BUMPER LOWER CENTRE GRILLE	Deformed	99.50 FL	*99.50 FL
19	1		*FRONT BUMPER TOP GARNISH	Cracked	137.20 FL	*137.20 FL
20	1		*SET TOP GARNISH CLIPS	Necessary	25.00 FL	*25.00 FL
21	1		*FRONT RH HEADLAMP ASSY	Broken	669.00 FL	*669.00 FL
22	1		*FRONT SUPPORT PANEL	Bent	700.80 FL	*700.80 FL
23	1		*FRONT RH WHEEL HOUSE	Buckled	1,050.90 FL	*1,050.90 FL
24	1		*FRONT RH ENGINE MOUNTING	Not Necessary	368.10 FL	*- FL
25	1		*RADIATOR ASSY	Not Necessary	730.90 FL	*- FL
26	1		*AIRCON CONDENSER	Not Necessary	498.50 FL	*- FL
27	1		*AIRCON DISCHARGE PIPE	Not Necessary	215.00 FL	*- FL
28	1		*AIRCON SUCTION PIPE	Not Necessary	238.00 FL	*- FL
29	1		*WIPER WASHER TANK ASSY	Deformed	150.50 FL	*150.50 FL
30	1		*FRONT WINDSCREEN MOULDING	Not Necessary	168.20 FL	*- FL
31	1		*ENGINE LOWER CROSS-MEMBER	Not Necessary	635.60 FL	*- FL
32	1		*SET STEERING RACK ASSY	Bent	1,900.90 FL	*1,900.90 FL
33	2		*STEERING TIE-ROD END	Bent	118.60 FL	*118.60 FL
34	1		*FRONT RH ABSORBER	Not Necessary	365.00 FL	*- FL
35	1		*FRONT RH ABSORBER TOP MOUNTING	Not Necessary	259.00 FL	*- FL
36	1		*DRIVESHAFT ASSY (RH)	Not Necessary	650.00 FL	*- FL
37	1		*FRONT RH LOWER ARM	Bent	395.30 FL	*395.30 FL
38	1		*FRONT RH LOWERARM BALL JOINT	Bent	189.20 FL	*189.20 FL
39	1		*SET FRONT RH ABS SENSOR	Not Necessary	258.60 FL	*- FL
40	1		*FRONT RH KNUCKLE	Bent	439.60 FL	*439.60 FL
41	1		*FRONT RH WHEEL BEARING	Not Necessary	186.10 FL	*- FL
42	1		*FRONT STABILIZER BAR	Not Necessary	398.50 FL	*- FL
43	1		*FRONT RH STABILIZER BAR LINKAGE	Not Necessary	75.90 FL	*- FL
44	1		*FRONT RH WHEEL BEARING HUB	Not Necessary	289.10 FL	*- FL
45	1		*AIR VACUUM HOUSING	Missing	125.00 FL	*125.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
46	1		*ENGINE UNDERCOVER RH	Torn	118.00 FL	*118.00 FL
47	1		*FRONT TYRE (RH)	Not Necessary	160.00 FS	*- FS
48	1		*FRONT TYRE RIM (RH) (70%)	Scratched	320.00 FS	*224.00 FS
49	1		*FRONT WINDSCREEN SEALANT	Not Necessary	150.00 FS	*- FS
50	1		*FRONT RH FENDER 1/4 GLASS SEALANT	Not Necessary	60.00 FS	*- FS
51	4		*LITRES RADIATOR COOLANT	Necessary	60.00 FS	*60.00 FS
52	4		*LITRES AUTO-FLUID (HYBRID)	Not Necessary	120.00 FS	*- FS
53	1		*RESONATOR VACUUM BOX	Deformed	196.10 FL	*196.10 FL
54	1		*AIR VACUUM PLASTIC PIPE	Missing	185.90 FL	*185.90 FL
55	1		*SET FRONT RH WHEEL BEARING HUB	Bent	438.50 FL	*438.50 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	17,554.60	11,331.10
- List Item Discount on L Items 25.00/25.00% (S\$)	4,171.15	2,761.78
Total Parts (S\$)	13,383.45	8,569.32

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	FOCUS HEADLAMP & CHECK WIRING	New	100.00	30.00
2	COMPUTERISED RESETTNG	New	180.00	80.00
3	COMPUTERISED ALIGNMENT WHEEL	New	180.00	60.00
4	RENEW TYRE & BALANCING	New	80.00	50.00
5	RENEW FRONT RH SUSPENSION, STEERING, CROSS-MEMBER & STABILIZER BAR	New	650.00	200.00
6	REMOVE & REFIX ENGINE, RENEW ENGINE MTG	New	780.00	0.00
7	REMOVE & REFIX FRONT WINDSCREEN, FRONT RH FENDER 1/4 GLASS	New	350.00	0.00
8	REMOVE & REFIX DESKBOARD	New	600.00	0.00
9	TO PUMP IN WHEEL BEARING	New	80.00	0.00
10	PANEL BEATING	New	2,000.00	1,200.00
11	SPRAY PAINTING	New	1,500.00	1,200.00
12	REMOVE & REFIX CUSHION, CARPETS & UPHOLSTERY	New	300.00	0.00
13	REMOVE & RENEW RADIATOR, AIRCON CONDENSER, PIPES WITH VACUUM & REFILL AIRCON GAS	New	380.00	120.00
Gross Labour Cost (\$\$)			7,180.00	2,940.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >