5/23/22, 3:46 PM Adjuster Report

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG22004198/UPA3Q2

Date: 23/05/2022

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1800133539

Claimant Vehicle YQ4277G Insured Vehicle No: SMF685M

No: 1Q42776 Insured verticle No. SWIF000W

Date of Loss: 22/04/2022 Nature of Claim: TP Claim No: 5440617184SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: YQ4277G

 Make & Model:
 MITSUBISHI FUSO, 7.5 D FK62FMZ5RDEA (M)
 Engine No:
 6M60275683

 Reg. Date:
 06/08/2021 (Man. Year: 2021)
 Chassis No:
 FK62FMA40274

 Colour:
 Blue
 Odometer:
 36816 km

Engine Capacity: 7545 cc
Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/70 R19.50 Rear Tyre Size: 245/70 R19.50 (D)
Front Left Side: Bridgestone 6 mm Rear Left Side: Bridgestone 6/6 mm
Front Right Side: Bridgestone 6 mm Rear Right Side: Bridgestone 6/6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	350.00	0.00	350.00	100.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	700.00	600.00	100.00	14.29
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	1,050.00	600.00	450.00	42.86

Global Sum Settlement (S\$) 0.00

INSPECTION

Date of Assignment: 06/05/2022

Liu's Brother Auto Engineering Workshop (HQ)

Date Inspected: 06/05/2022 Inspected At: BLK 1 KAKI BUKIT AVE 6, #01-01 AUTO BAY @

KAKI BUKIT

Singapore 417883

Estimated Period of Repair: 3.0 days

Adjuster: MARCUS CHUA Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No. Qty Part No.	Particulars	Condition	Repairer's	Amount
1 1 F=Franchise part.	*REAR RH LADDLE PANEL	Repair	350.00 F	*-F
		Total Parts (S\$)	350.00	0.00
	Report was unsubmit	ted during this print-out.		

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Lab</u>	our Items			
1	LABOR FOR PANEL BEATING ,CUT ,WELD ,STRAIGHTEN & REPLACING PARTS ETCS	New	400.00	300.00
2	TO PUTTY & SPRAY PAINTING & INCLUDING TOUCH UP PAINT ON ACCIDENT AFFECTED AREAS	New	300.00	300.00
	Gross Labour Cost (S\$)		700.00	600.00
	Report was unsubmitted during this	print-out.		

< END OF ESTIMATES >