



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMK 4558U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	TAILGATE OUTER PANEL	TO REPAIR SEE LABOUR	949.28	-
1	REAR EMBLEM	NOT NECESSARY	229.39	-
1	LOGO RENAULT	NECESSARY	160.56	160.56
1	LOGO SCENIC	NECESSARY	181.44	181.44
6	RIVET CLIPS @ \$9.24	SERVICEABLE	55.44	-
1	REAR BUMPER	BUCKLED	1,482.96	1,386.40
1	REAR BUMPER LOWER	DENTED / CRACKED	689.72	689.72
1	REAR BUMPER SILVER MOULDING	CRACKED	785.68	486.00
2	REAR BUMPER CENTER SUPPORT BRACKET @ \$477.84	SERVICEABLE	955.68	-
4	SENSOR @ \$285.80	SERVICEABLE	1,143.20	-
2	BLIND SPOT SENSOR @ \$457.92	O/S DENTED	915.84	457.92
1	REAR BUMPER CENTER BRACKET	SERVICEABLE	117.36	-
1	TAILGATE LOCK CATCHER	TO REPAIR SEE LABOUR	116.72	-
1	REAR BUMPER HARDNESS	SERVICEABLE	271.16	-
1	REAR BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	685.68	-
1	REAR BUMPER LOWER REFLECTOR RH	SERVICEABLE	415.20	-
	LESS 10% DISCOUNT		-	-336.20
			9,155.31	3,025.84
<u>SPECIAL NETT ITEMS</u>				
6	REAR BUMPER CLIPS @ \$7.00 (SN)	NECESSARY	42.00	42.00
			42.00	42.00
<u>LABOUR</u>				
	TO PANEL BEATING, REALIGN AND DISMANTLE REAR BUMPER, TAILGATE PANEL AND ALL NECESSARY ETC. INCLUSIVE OF THE REPAIR OF TAILGATE OUTER PANEL, TAILGATE LOCK CATCHER AND REAR BUMPER REINFORCEMENT.		1,600.00	350.00
	TO REMOVE & REFIX REAR REVERSE SENSOR.		280.00	60.00
	TO APPLY ANTI RUST.	NOT NECESSARY	200.00	-

Report Ref No. CS/SMO22004199/Kvy3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK WIRING FOR PROPER FUNCTION.		150.00	15.00
	TO PUTTY & SPRAY PAINTING TAILGATE, REAR BUMPER AND ALL NECESSARY ETC.		1,200.00	600.00
			3,430.00	1,025.00
GRAND TOTAL			12,627.31	4,092.84
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,250.00

Report Ref No. CS/SMO22004199/Kvy3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.