

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG22004239/GNCE2**Date:** 18/11/2022REFERENCE

Insured/Claimant:	TEO CHER IN (ZHANG XUEYING)	Policy No:	1800150974-03
Date of Loss:	30/04/2022	Nature of Claim:	OD
		Claim No:	9486893460SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLW2202H	Engine No:	CHZ644887
Make & Model:	AUDI A3, 999cc TFSI S TRONIC (LED) (A)	Chassis No:	WAUZZZ8V3J1044214
Reg. Date:	02/02/2018 (Man. Year: 2017)	Odometer:	48944 km
Colour:	Grey		
Engine Capacity:	999 cc		
Market Value/New Car Price:	S\$90,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	13,082.00	8,058.16	5,023.84	38.40
Miscellaneous Items	0.00	0.00	0.00	
Labour	17,882.00	11,367.00	6,515.00	36.43
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	30,964.00	19,425.16	11,538.84	37.27
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	30,364.00	18,825.16	11,538.84	38.00
+ GST 7.00/7.00% (S\$)	2,125.48	1,317.76	807.72	38.00
Nett Amount (S\$)	32,489.48	20,142.92	12,346.56	38.00

INSPECTION

Date of Assignment:	09/05/2022	
Date Inspected:	06/05/2022	Inspected At: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	14.0 days	

Adjuster: XING GUO QIANG**Manager:** HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SIDE FRAME - LH	Buckled	3,662.00 FS	*2,929.60 FS
2	2		*GROMMET	Necessary	4.00 FS	*3.04 FS
3	1		*REAR WINDSCREEN	Necessary	905.00 FS	*724.00 FS
4	1		*QUARTER WINDOW - LH	Necessary	635.00 FS	*508.00 FS
5	2		*PRIMER	Necessary	44.00 FS	*34.72 FS
6	1		*REAR WHEEL SPOILER - LH	Not Necessary	39.00 FS	*- FS
7	1		*REAR WHEEL SPOILER COVER - LH	Not Necessary	4.00 FS	*- FS
8	1		*REAR WHEEL HOUSING LINER	Not Necessary	260.00 FS	*- FS
9	1		*REAR DOOR - LH	Buckled	3,265.00 FS	*2,612.00 FS
10	1		*REAR DOOR BUNGS - LH	Not Necessary	5.00 FS	*- FS
11	1		*REAR DOOR OUTER SEAL - LH	Necessary	179.00 FS	*142.80 FS
12	1		*BONDING AGENT	Not Necessary	51.00 FS	*- FS
13	1		*CLEANING SOLUTION	Not Necessary	74.00 FS	*- FS
14	1		*APPLICATOR	Not Necessary	8.00 FS	*- FS
15	1		*REAR DOOR CATCH - LH	Not Necessary	105.00 FS	*- FS
16	1		*REAR DOOR SEAL INNER - LH	Not Necessary	213.00 FS	*- FS
17	1		*REAR DOOR HANDLE - LH	Repair	398.00 FS	*- FS
18	1		*REAR DOOR HANDLE MOUNTING BAR - LH (NPA)	Not Necessary	0.00 FS	*- FS
19	1		*REAR DOOR HANDLE BOWDEN CABLE	Not Necessary	58.00 FS	*- FS
20	1		*REAR DOOR WINDOW REGULATOR - LH	Not Necessary	286.00 FS	*- FS
21	1		*ALUMINIUM RIM	Repair	1,303.00 FS	*- FS
22	1		*RUBBER VALVE	Not Necessary	4.00 FS	*- FS
23	1		*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
24	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
25	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS
26	1		*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
27	1		*REAR WINDSCREEN SEALANT	Necessary	200.00 FS	*200.00 FS
28	1		*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
29	1		*SUNDRIES	Necessary	500.00 FS	*24.00 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) **13,082.00** **8,058.16**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REINSTALL REAR PARKING AID	New	280.00	0.00
2	TO RENEW REAR WINDSCREEN AND 1/4 GLASS TO FACILITATE RENEWAL OF LHS REAR FENDER	New	600.00	600.00
3	TO INSTALL SOLAR FILM FOR REAR WINDSCREEN AND 1/4 GLASS	New	400.00	400.00
4	TO CARRY OUT WATER SEEPAGE TEST FOR REAR WINDSCREEN	New	200.00	150.00
5	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY	New	1,400.00	1,400.00
6	TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS, DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC	New	1,400.00	1,400.00
7	TO REMOVE AND REINSTALL LHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL LHS WING MIRROR ASSY TO FACILITATE RESPRAY OF LHS FRONT DOOR	New	280.00	0.00
8	TO REMOVE AND TRANSFER LHS REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES	New	350.00	350.00
9	TO DISMANTLE AND REINSTALL REAR BUMPER. TO CUT OUT WELD LHS REAR FENDER AND SILL PANEL. TO REPAIR LHS FRONT DOOR. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	6,500.00	3,750.00
10	TO RESPRAY LHS REAR FENDER, LHS FRONT DOOR, LHS REAR DOOR, DOOR HANDLE, LHS SILL PANEL, DOOR ENTRANCE, ROOF CHANNEL, DRAIN CHANNEL AND REAR END PANELLING	New	6,000.00	3,125.00
11	TO RENEW LHS REAR RIM. TO CARRY OUT WHEEL ALIGNMENT	New	280.00	0.00
12	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
Gross Labour Cost (\$\$)			17,882.00	11,367.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >