

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI22004432/GTY3N2**Date:** 23/05/2022**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSNW00058072100

**Claimant Vehicle
No :** FBK7862B**Insured Vehicle
No :** XD9198Z

Date of Loss: 29/04/2022

Nature of Claim: TP

Claim
No: SNM22D203061/C02/TANKL**DESCRIPTION & IDENTIFICATION OF VEHICLE**Reg No: **FBK7862B**

Make & Model: HONDA CB400SFY, 399cc

Engine No: NC42E1204360

Reg. Date: 01/02/2016 (Man. Year: 2015)

Chassis No: NC421604361

Colour: Black

Odometer: 52161 km

Engine Capacity: 399 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 120/60ZR17

Rear Tyre Size:

160/60ZR17

Front Left Side: Pirelli 5 mm

Rear Left Side:

Bridgestone 5 mm

Front Right Side: 0 mm

Rear Right Side:

0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 11/05/2022

Date Inspected: 12/05/2022

Inspected At:

EQBH PTE LTD (HQ)
25 Kaki Bukit Road 4, #03-79
Singapore 417800

Estimated Period of Repair: 4.0 days

Adjuster: XING GUO QIANG**Manager:** DENISE TAY KWEE CHENG*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000.00
-\$4,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 23 May 2022)	
Parts:	N/A	HONDA CB400SFY 399cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBK7862B)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >