



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2207355

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 29/11/2022
Reference CC6/CTI22004486/Kpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBD 7937G
Insured Veh. GBF 5321K
Claim No. SNM22D203217/C02
Policy No. DMCVSNW00149342101
Accident Date 09/05/2022
Inspection Date 11/05/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22004486/Kpa3q2 Date: 29/11/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBF 5321K	Veh. Inspected	GBD 7937G
	Policy No.	DMCVSNW00149342101	Coverage (\$)	0.00
	Claim No.	SNM22D203217/C02	Excess (\$)	0.00
	Assign From		Assign Date	11/05/2022
2. Vehicle Particulars & Condition				
	Make & Model	NISSAN NV200 (M)	c.c	1461
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	VSKYBAM20Z0094122	Colour	SILVER
	Odometer	158406 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	175/70 R14	FALKEN	3 mm
	L/H Front Tyre	175/70 R14	FALKEN	3 mm
	R/H Rear Tyre	175/70 R14	WINDFORCE	7 mm
	L/H Rear Tyre	175/70 R14	WINDFORCE	7 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	09/05/2022	Inspection Date	11/05/2022
	Survey held at	ALAN'S UNITED AUTO PTE LTD BLK 7 SIN MING INDUSTRIAL ESTATE #01-76 SINGAPORE 575642		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		14 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBD 7937G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET (N)	BUCKLED	1,189.00	1,189.00
1	BONNET INSULATOR (N)	SERVICEABLE	105.60	-
1	FRONT GRILLE LOGO (N)	NECESSARY	56.60	56.60
2	HEADLAMP @\$688.90 (N)	MTG CRACKED	1,377.80	1,377.80
2	HEADLAMP LOWER APRON @\$358.40 (N)	MTG CRACKED	716.80	716.80
1	FRONT BUMPER FASCIA (N)	BENT	1,029.70	1,029.70
1	FRONT BUMPER REINFORCEMENT (N)	BENT	1,299.50	1,299.50
1	FRONT BUMPER TOW COVER (N)	DENTED	22.60	22.60
1	FRONT BUMPER SPONGE (N)	CRACKED	298.00	298.00
2	FRONT BUMPER SIDE RETAINER @\$28.20 (N)	DISTORTED	56.40	56.40
1	FRONT SUPPORT PANEL (N)	BENT	781.40	781.40
1	FRONT SUPPORT O/S GUIDE (N)	DISTORTED	40.10	40.10
1	FRONT SUPPORT O/S GUIDE-LOWER (N)	DISTORTED	50.10	50.10
1	FRONT SUPPORT N/S GUIDE (N)	DISTORTED	36.50	36.50
1	FRONT SUPPORT N/S GUIDE-LOWER (N)	CRACKED	50.10	50.10
1	REAR N/S DOOR (N)	BENT	1,586.40	1,586.40
1	REAR N/S DOOR INNER LOCK-TOP (N)	TO REPAIR SEE LABOUR	274.10	-
1	REAR N/S DOOR INNER TRIM (N)	SERVICEABLE	229.90	-
1	REAR N/S DOOR "NV200" EMBLEM (N)	NECESSARY	152.60	152.60
1	REAR N/S DOOR LOGO (N)	NECESSARY	169.90	169.90
1	REAR N/S DOOR OUTER HANDLE (N)	SERVICEABLE	259.70	-
1	REAR O/S DOOR (N)	BENT	1,189.80	1,189.80
1	REAR O/S DOOR INNER LOCK (N)	TO REPAIR SEE LABOUR	124.60	-
1	REAR O/S DOOR INNER TRIM (N)	CRACKED	115.00	115.00
1	REAR O/S DOOR "DCI" EMBLEM (N)	NECESSARY	146.50	146.50
1	REAR END PANEL - INNER (N)	BENT	622.00	622.00
1	END PANEL TOP GARNISH (N)	CRACKED	84.30	84.30
2	END PANEL LOCK HOOK @\$37.60 (N)	SERVICEABLE	75.20	-
1	REAR FLOOR PANEL (N)	BENT	1,485.70	1,485.70

Report Ref No. CC6/CTI22004486/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR O/S TAILLAMP (N)	CRACKED	340.80	340.80
1	REAR O/S FENDER (N)	BUCKLED	1,767.00	1,767.00
2	REAR BUMPER SIDE RETAINER @\$40.20 (N)	O/S DISTORTED	80.40	40.20
1	REAR BUMPER FASCIA (N)	BENT	548.40	548.40
1	REAR BUMPER TOW COVER (N)	DENTED	20.00	20.00
2	REAR BUMPER REFLECTOR @\$66.90 (N)	O/S MISSING	133.80	66.90
1	REAR BUMPER SPONGE (N)	CRACKED	101.60	101.60
1	FRONT GRILLE (N)	CRACKED	677.40	677.40
	LESS 10% DISCOUNT		-1,729.53	-1,611.91
			15,565.77	14,507.19
1	REAR O/S DOOR RUBBER (50%) (SN)	CUT	64.80	32.40
1	REAR BODY WEATHERSTRIP (50%) (SN)	DENTED / CUT	125.90	62.95
	LESS 10% DISCOUNT		-19.07	-
			171.63	95.35
	<u>SPECIAL NETT ITEMS</u>			
1	AIR CON CONDENSER (SN)	PUNCTURE	559.20	559.20
1	RADIATOR (M) (SN)	BENT	773.40	773.40
1	RADIATOR FAN ASSY (SN)	CRACKED	590.90	590.90
1	REAR END PANEL - OUTER (SN)	BENT	189.00	189.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	DENTED	300.00	200.00
1	REAR N/S DOOR 70KM/H STICKER (SN)	NECESSARY	15.00	15.00
1	REAR O/S DOOR 6PAX STICKER (SN)	NECESSARY	15.00	15.00
1	REAR TWO DOOR BODY LETTERING (SN)	NECESSARY	250.00	200.00
1	REAR W/S GLASS SEALANT (TWO) (SN)	NECESSARY	100.00	80.00
1	REAR NO. PLATE WITH BOX (SN)	DENTED	50.00	45.00
1	FRONT NO. PLATE WITH BX (SN)	BENT	50.00	45.00
1	RADIATOR COOLANT (SN)	NECESSARY	30.00	30.00
			2,922.50	2,742.50
	<u>LABOUR</u>			
	TO REMOVE & REFIX REAR WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.		200.00	160.00

Report Ref No. CC6/CTI22004486/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE ROOF LINING, FRONT AND REAR SEATS, TRIM BOARD AND CARPET.		120.00	80.00
	TO REMOVE AIR CON CONDENSER, PIPES AND DRIER, VACUUM AND TO RECHARGE GAS.		120.00	100.00
	TO APPLY UNDERSEALING.		100.00	100.00
	TO PUTTY AND SPRAY REPLACED PARTS.		1,800.00	1,600.00
	TO REMOVE, CUT-OUT DAMAGED PARTS, PANEL BEATING, WELDING, ALIGN, REFIX AND TO RENEW ABOVE PARTS. INCLUSIVE OF THE REPAIR OF REAR N/S DOOR INNER LOCK-TOP AND REAR O/S DOOR INNER LOCK.		2,200.00	1,800.00
			4,540.00	3,840.00
GRAND TOTAL			23,199.90	21,185.04
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				16,000.00

Report Ref No. CC6/CTI22004486/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 7937G

INSPECTION

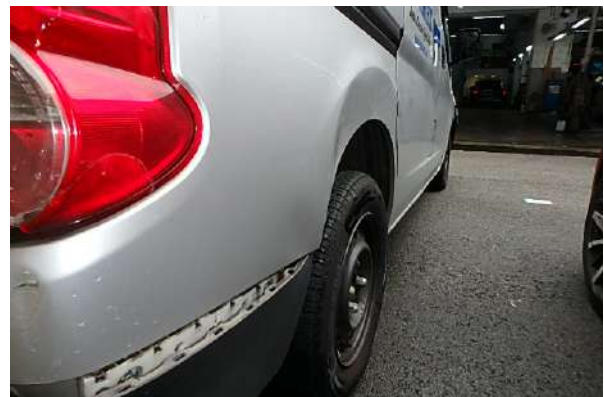



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

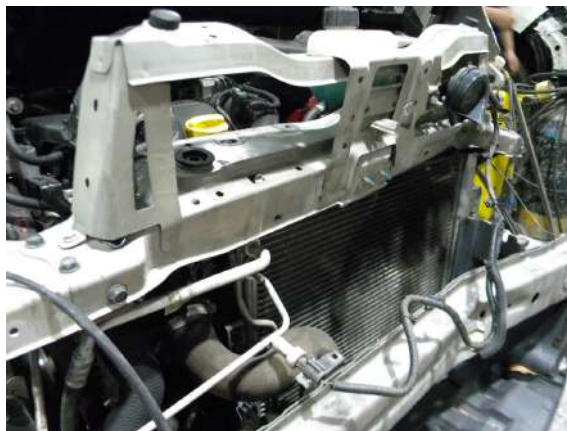



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 7937G

RE-INSPECTION

