

6 tampines st 73, #01-03, singapore 528825

tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Claim Reference : Insured Vehicle No. : Thirty Party Veh No. : Officer-In-Charge : -

Our Reference

: KAAS/KT/6323/3426/TP/04.21

Date

: 15 May 2021

To: Muhammad Salihin Bin Subari

c/o 25 Kaki Bukit Road 4

#01-83, Synergy @ Kaki Bukit

Singapore 417800

VEHICLE APPRAISAL REPORT

Name of Workshop

: CandyMotor Workshop Pte Ltd

Place of inspection

: 25 Kaki Bukit Road 4 #01-83, Synergy @ Kaki Bukit, Singapore 417800

Date of Assignment

: 19 April 2021

Date of Accident

: 14 April 2021

Date of Inspection

: 19 April 2021

PARTICULARS OF INSPECTED VEHICLE

Registration No.

: FBS 3426L

Chassis Frame No.

: MH1KF6119MK032872

Make / Model

: Honda

ADV150 ABS CVT

Engine No. (Logcard)

: KF61E1032814

Year of Manufacture/Reg

: 2021

Odometer Reading

: 1,242 KM

Colour

: Black

Class / Type

: Motorcycle

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

General Condition

: Good

Paintwork

: Good

Market Value

. 000

Scrap Value

. .

CONDITION OF TYRES ON VEHICLE

Make/Size

Thread Balance

Front

Mitas 110/80-14

8 mm

Rear

Mitas 130/70-13

8 mm

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.

^{*}The above is an estimate of the remaining life of the tyre thread in millimeters



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Our Reference Vehicle Number : KAAS/KT/6323/3426/TP/04.21

: FBS 3426L

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's		Revised	
					Estimate		Amount
		LIST ITEMS:-					
1	1	I/h front signal lamp 🗸	broken	\$	85.00	\$	85.00
2	1	I/h side mirror 🗸	grazed	\$	60.00	\$	60.00
3	1	clutch lever	grazed	\$	48.00	\$	48.00
4	1	I/h balancer	damaged	\$	45.00	\$	35 45.00
5	1	I/h front cover	grazed	\$	130.00	\$	130.00
6	1	I/h floorboard	distorted	\$	110.00	\$	110.00
7	1	I/h front top cover air filter cover	broken	\$	150.00	\$	64.2 150.00
9	1	mainstand \checkmark	scratched bent	\$	85.00 95.00	\$ \$	85.00 95.00
10	1	gearbox cover 🗸	cracked	\$	240.00	\$	240.00
11	1	handlebar X SVC	unconfirmed	\$	350.00	¥	not affected
		100		\$	1,398.00	\$	952.2 1,048.00
		Less 10%		\$	1,398.00	\$ \$	856.98 943.20
		NETT ITEMS:-		*	1,330.00	, a	830.98 343.20
12	1	rear box 🗸	grazed	\$	450.00	\$	300 400.00
				\$	450.00	\$	400.00
			-				
		W.)					
			Sub - Total	\$	1,848.00	\$	1,343.20

6 tampines st 73, #01-03, singapore 528825

tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Our Reference Vehicle Number

: KAAS/KT/6323/3426/TP/04.21

: FBS 3426L

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		B/F		\$ 1,848.00	\$ 1,343.20
		LABOUR & OTHER CHARGES:-			
1		To dismantle and repair damaged parts		\$ 600.00	\$ 250 350.00
2		To check wiring and rewire		\$ 60.00	\$ 50.00
3		To straighten and align structural body frame		\$ 480.00	not necessary
4		To spray-paint of affected areas		\$ 200.00	\$ 150.00
				\$ 1,340.00	\$ 550.00
		1406.98			
		-20%: 1100			
		3 Days			
		1.0			
		The state of the s			
				A STATE OF THE STA	
			Sub - Total	\$ 3,188.00	\$ 1,893.20



6 tampines st 73, #01-03, singapore 528825

tel: 6746 2118 fax: 6746 1148

 
reg no: 53058468m


Our Reference Vehicle Number : KAAS/KT/6323/3426/TP/04.21

: FBS 3426L

ASSESSMENT SUMMARY

Damages sustained were consistent with the accident report.



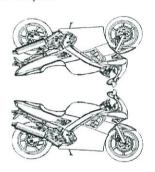



(Please refer to the parts list and photographs as attached for more information)

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs

CandyMotor Workshop Pte Ltd

is \$ 3,188.00

We have adjusted the cost to

1 00

1,893.20 and the repairer has agreed to undertake the repairs at a

Part by Part Basis of

\$ 1,500.00 to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of

working days.

33 photographs were taken at the time of static inspection.

This report is strictly done in a Without Prejudice Basis.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No.

we thank you for engaging our services.

6323

for our services rendered and

1

KELVIN TEO

Licensed Automotive Appraiser
Nitec in Automotive Technology
Cert. Crash Investigation & Reconstruction
Dip MS

MSAAA, AM SAE-A