

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/EQI22004598/GVY3E2

Date: 14/06/2022

REFERENCE

Handling Insurer: EQ Insurance Company Ltd Policy No:
Claimant Vehicle No : SHA5389X **Insured Vehicle No :** SKX3275Y
Date of Loss: 15/05/2022 Nature of Claim: TP Claim No: DM22HO00763

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHA5389X**
Make & Model: HYUNDAI IONIQ HYBRID, 1.6 GLS DCT (A) Engine No: G4LEJU081014
Reg. Date: 06/09/2018 (Man. Year: 2018) Chassis No: KMHC851CVKU107483
Colour: Blue Odometer: 0 km
Engine Capacity: 1580 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65 R15 Rear Tyre Size: 195/65 R15
Front Left Side: West Lake 6 mm Rear Left Side: West Lake 6 mm
Front Right Side: West Lake 6 mm Rear Right Side: West Lake 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,352.28	5,061.88	290.40	5.43
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,130.00	2,070.00	1,060.00	33.87
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	8,482.28	7,131.88	1,350.40	15.92
Approved Total (Overridden) (S\$)		5,700.00		
(S\$)	8,482.28	5,700.00	2,782.28	32.80
+ GST 7.00/7.00% (S\$)	593.76	399.00	194.76	32.80
Nett Amount (S\$)	9,076.04	6,099.00	2,977.04	32.80

INSPECTION

Date of Assignment: 17/05/2022 Present Location: ComfortDelGro Engineering Pte Ltd (Loyang)
Date Inspected: 18/05/2022 Inspected At: ComfortDelGro Engineering Pte Ltd (Loyang)
59 Loyang Drive
Singapore 508969
Estimated Period of Repair: 4.0 days

Adjuster: XING GUO QIANG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 10 Jun 2022)
Parts:	192	HYUNDAI IONIQ HYBRID 1.6 GLS DCT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SHA5389X)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BOOTLID	Buckled	2,549.70 FL	*2,549.70 FL
2	1		*BOOTLID LOCK LOWER	Bent	51.30 FL	*51.30 FL
3	1		*BOOTLID EMBLEM - H	Necessary	28.00 FL	*28.00 FL
4	1		*BOOTLID EMBLEM - HYBRID	Necessary	24.30 FL	*24.30 FL
5	1		*BOOTLID EMBLEM - IONIQ	Necessary	31.30 FL	*31.30 FL
6	1		*BOOTLID COMFORT LOGO	Necessary	30.00 F	*30.00 F
7	1		*BOOTLID COMFORT TEL.NO. LOGO	Necessary	30.00 F	*30.00 F
8	1		*BOOTLID APPS LOGO	Necessary	40.00 F	*40.00 F
9	2		*REAR WINDSCREEN SEALANT	Necessary	46.00 F	*46.00 F
10	1		*ANTENNA ASSY - SMARTK	Not Working	40.50 FL	*40.50 FL
11	1		*REAR FOG LAMP	Cut	201.50 FL	*201.50 FL
12	1		*REAR NUMBER PLATE	Bent	50.00 F	*50.00 F
13	1		*REAR BUMPER ASSY	Distorted	459.40 FL	*459.40 FL
14	1		*REAR BUMPER REINFORCEMENT BEAM	Bent	394.80 FL	*394.80 FL
15	1		*REAR BUMPER REINFORCEMENT BRACKET LH	Bent	138.10 FL	*138.10 FL
16	1		*REAR BUMPER REINFORCEMENT BRACKET RH	Bent	138.10 FL	*138.10 FL
17	1		*REAR BUMPER CENTRE MOULDING	Missing	451.25 FL	*451.25 FL
18	1		*REAR BUMPER CENTRE LOWER MOULDING	Missing	155.00 FL	*155.00 FL
19	1		*REAR BUMPER SIDE BRACKET LH	Necessary	55.80 FL	*55.80 FL
20	1		*REAR BUMPER SIDE BRACKET RH	Necessary	55.80 FL	*55.80 FL
21	10		*REAR BUMPER CLIPS	Necessary	22.00 FL	*22.00 FL
22	1		*REAR BUMPER UNDER CENTRE COVER	Not Necessary	255.00 FL	*- FL
23	1		*REAR BUMPER UNDER SIDE LH COVER	Not Necessary	108.00 FL	*- FL
24	1		*REAR BUMPER TOW COVER	Missing	98.80 FL	*98.80 FL
25	1		*REVERSE ESENSOR	Distorted	180.00 F	*180.00 F
26	1		*REAR END PANEL	Buckled	532.00 FL	*532.00 FL
27	1		*REAR END PANEL GARNISH	Deformed	346.80 FL	*346.80 FL
28	1		*REAR REFLECTOR LH	Missing	41.45 FL	*41.45 FL
29	1		*REAR REFLECTOR RH	Missing	41.45 FL	*41.45 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	6,596.35	6,233.35
- List Item Discount on L Items 20.00/20.00% (\$\$)	1,244.07	1,171.47
Total Parts (\$\$)	5,352.28	5,061.88

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	1,500.00	700.00
2	SPRAYPAINT	New	900.00	750.00
3	CHECK WIRING	New	50.00	30.00
4	TUFF KOTE	New	50.00	0.00
5	REMOVE/REFIX REAR WINDSCREEN GLASS	New	120.00	100.00
6	REMOVE/REFIX REVERSE SENSOR	New	60.00	40.00
7	ADVERTISEMENT LOGO - FENDER	New	200.00	200.00
8	ADVERTISEMENT LOGO - BOOTLID	New	100.00	100.00
9	TOWING FEE - KING DOLLY	New	150.00	150.00
Gross Labour Cost (\$)			3,130.00	2,070.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >