

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CTI22004650/ETY3N2**Date:** 27/05/2022**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMHCSNW00008692100

Claimant Vehicle No : FBE4893M **Insured Vehicle No :** SLS3230R

Date of Loss: 19/04/2022 Nature of Claim: TP Claim No: SNM22D203345/C02/LEEPG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBE4893M**

Make & Model: YAMAHA T135, 135cc Engine No: 5YP302465

Reg. Date: 06/05/2010 (Man. Year: 2010) Chassis No: 5YP302465

Colour: Red Odometer: 356693 km

Engine Capacity: 135 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 80-90-17 Rear Tyre Size: 80-90-17

Front Left Side: Dunlop 4 mm Rear Left Side: Dunlop 4 mm

Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 23/05/2022

Date Inspected: 18/05/2022 Inspected At: Friendship Motor Company (HQ)
BLK 125 Bukit Merah Lane 1, #01-168
Singapore 150125

Estimated Period of Repair: 3.0 days

Adjuster: CHEN TSUE YEE**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$2,000.00
-\$3,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 27 May 2022)	
Parts:	N/A	YAMAHA T135 135cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBE4893M)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >