



**AUTOMOBILE
INSPECTION REPORT
NO. 9/3/TP012**

To: TAN QWEE TECK
BLK 322 SERANGOON AVENUE 3 #08-270 S'PORE 550322

General Condition: Peer/Fair/Good/Excellent

Reg. No.	SGC 4844 G	Make/Model	TOYOTA LEXUS GS300 AUTO	Year	2006
Engine No.	3GR0129870	Chassis No.	JTHBG96S005022633	Colour	Dark Grey
Condition of Tyres			Speedometer Reading - Km		
Front N/S	PIRELLI 225/50R17	worn	20 %	Front O/S	PIRELLI 225/50R17
Rear N/S	B/STONE 225/50R17	worn	20 %	Rear O/S	B/STONE 225/50R17
As Requested By			On	19-Mar-19	
YOURSELF				The Above Vehicle	
Was Inspected At (19-Mar-19) CHOON HOCK AUTOCARE PTE LTD BLK 176 SIN MING DRIVE #05-03 S'PORE 575721					

And The Undermentioned Damage Was Noted:-

Boot lid dented and bent, inner frame bent, centre garnish dented, bent and deformed, reflectors grazed and dislodged, lock assy. bent and jammed, hinges and dampers bent and stiffened, boot rubber kinked and deformed, rear panel dented and bent, both rear lamps assy. dislodged, fenders bent, bumper assy. grazed, dented, bent, deformed and dislodged, fasteners torn, reverse sensors distorted, exhaust pipes pushed inwards, boot floor panel assy. bent.

Photographs:-	165 Copies	were taken at time of inspection and are attached
The Repairers estimate was for a total amount of	\$	13,911.02
After adjustment the estimate was revised and agreed at	\$	11,085.28

SPECIAL REMARKS

The Repairers were **NOT AUTHORISED** to proceed with the repairs.
Survey was carried out without prejudice.
The above were due to impact to the rear portion of the vehicle.

Alternatively, we recommend that repairs be carried out on a Lump Sum basis instead, **@\$8,850/- Nett.**


MICHAEL EE Dip A Eng., AMIRTE, AMSAE, AMSOE, AMIMI, MSAAA

Date 29-Mar-19



47 Jalan Pemimpin
#02-07 Halcyon 2
Singapore 577200

T 6448 8208
F 6442 9690
E kmautoassessors@gmail.com
Regn. No. 200907340Z

APPENDIX 'A'
TO REPORT NO: 9/3/TP012
REGN. NO: SGC 4844 G

Nature of Work and Materials	Repairers Estimate \$	Remarks	Amount Revised \$
1 pce boot lid	961.90	dented & bent	961.90 ✓
1 pce boot lid centre garnish	361.40	dented, bent, fasteners snapped	361.40 ✓
1 pce boot lid emblem	83.40	necessary	83.40 ✓
1 pce boot lid "LEXUS" plate	82.70	necessary	82.70 ✓
1 pce boot lid "GS300" plate	82.70	necessary	82.70 ✓
1 pce boot lid inner lock assy.	1,236.40	bent & jammed	1,236.40 X
1 pce boot lid inner lock catch (cont' see Dye)	76.10	bent	76.10 X
2 pcs boot lid hinges (cont' see Dye)	191.20	bent & jammed	191.20 X
2 pcs boot lid dampers (cont' see Dye)	543.60	bent & stiffened	543.60 X
2 pcs boot lid reflectors	592.20	grazed, dislodged, fasteners snapped	592.20 ✓
1 pce boot rubber (cont' see Dye)	195.90	kinked & deformed	195.90 X
2 pcs rear lamps assy. studs snapped	1,566.52	dislodged, fastening	1,566.52 ✓
2 pcs rear lamp panels	464.80	to repair	- X
1 pce rear panel	642.10	dented & bent	642.10 X
1 pce rear panel inner garnish	282.80	not necessary	- X
1 pce rear bumper fascia	864.90	grazed, dented, bent, fasteners torn	864.90 ✓
1 pce rear bumper inner sponge	135.70	torn	135.70 ✓
1 pce rear bumper reinforcement	578.50	dented & bent	578.50 ✓
2 pcs rear bumper side retainers	117.80	fasteners snapped	117.80 ✓
1 set no. plate lamps assy.	168.40	housing bracket snapped	168.40 ✓
			8,481.42
		less 10%	848.14
	9,229.02		7,633.28
S.NETT			
1 set boot lid centre garnish clips	28.00	necessary	28.00 ✓
1 set boot lid insulator clips	35.00	necessary	35.00 ✓
1 set rear panel inner garnish clips	14.00	necessary	14.00 ✓
1 pce rear panel sealant	60.00	necessary	60.00 X
1 set rear bumper clips	35.00	necessary	35.00 ✓
1 set reverse sensors	300.00	distorted, s/circuited	300.00 200
Remove boot lid fittings, check, renew damaged fittings, transfer all fittings to new boot lid assy. and refit.	120.00		60.00 ✓
Remove necessary interior upholsterys and fittings to enable necessary repairs, check and refit same.	150.00		80.00 ✓
c/f	9,971.02		8,245.28

Total Amount Revised \$
Lump Sum Repairs Amount \$
It is estimated that the repairs will take _____ days to complete.



47 Jalan Pemimpin
#02-07 Halcyon 2
Singapore 577200

T 6448 8208
F 6442 9690
E kmautoassessors@gmail.com
Regn.No. 200907340Z

APPENDIX 'A'
TO REPORT NO: 9/3/TP012
REGN. NO: SGC 4844 G

Nature of Work and Materials	Repairers Estimate \$	Remarks	Amount Revised \$
b/f	9,971.02		8,245.28
Remove lamps, necessary wirings and electrical fittings to enable necessary repairs, check, replace damaged parts, refit same, test electrical-circuit.	60.00		30.00 ✓
Renew reverse sensors, transfer same to new bumper assy., refit, reset and test system.	150.00	* ✓	80.00 50
Remove rear exhaust pipe assy., repair and refit same.	280.00	* ✓	180.00 100
Remove damaged parts, jack and cut out damaged body panels, jack out, straighten up damaged body panels and repair body parts and fittings, whichever possible and necessary, replace and weld necessary damaged parts, refit and align whichever parts necessary (incl. alignment of body structure).	1,400.00	* ✓	1,000.00 500
Paint replacement parts and repaint damaged sections with welded portions in and outside.	1,800.00	* ✓	1,400.00 800
Rustproof replacement parts and touch-up damaged sections.	250.00	* ✓	150.00 60
TOTAL	13,911.02		11,085.28
		<p>u/s 5600 5 day</p>	<p>5556.12 102 5036.50 312 1680 2028.50 202 5622</p>
Total Amount Revised	\$	11,085.28	
Lump Sum Repairs Amount	\$	8,850.00	
It is estimated that the repairs will take	SEVEN	days to complete.	

VALUATION (COE EXPIRY ON 17/01/2026)

Market Value:\$50,000.00

LTA Rebate :\$40,022.00 (as at 19/03/2019)

Net Value :\$ 9,978.00

INSPECTIONS

Pre-repair inspection conducted on 19/03/2019.

Dismantled parts inspection conducted on 20/03/2019.

Post-repair inspection conducted on 26/03/2019.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 18 Jan 2021)
Parts: 143 LEXUS GS300 3.0 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: AutoProbe Consultants/SGC4844G/18/01/2021 14:36
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
1	1		*Boot lid	Dented	961.90 FL	*961.90 FL ✓	
2	1		*Boot lid centre garnish	Mtg Cracked	361.40 FL	*361.40 FL ✓	
3	1		*Boot lid emblem	Necessary	83.40 FL	*83.40 FL ✓	
4	1		*Boot lid Lexus plate	Necessary	82.70 FL	*82.70 FL ✓	
5	1		*Boot lid GS300 plate	Necessary	82.70 FL	*82.70 FL ✓	
6	1		*Boot lid inner lock assy	Reuse	1,236.40 FL	*- FL ✗	
7	1		*Boot lid inner lock catch	Serviceable	76.10 FL	*- FL ✗	
8	2		*Boot lid hinges	Serviceable	191.20 FL	*- FL ✗	
9	2		*Boot lid dampers	Serviceable	543.60 FL	*- FL ✗	
10	2		*Boot lid reflectors	RH Reuse	✓ 592.20 FL	*296.10 FL ✓	
11	1		*Boot rubber	Serviceable	195.90 FL	*- FL ✗	
12	2		*Rear lamps assy	Reuse	✗ 1,566.52 FL	*- FL ✓	
13	1		*Rear panel	Repair	642.10 FL	*- FL ✗	
14	1		*Rear bumper fascia	Deformed	864.90 FL	*864.90 FL ✓	
15	1		*Rear bumper inner sponge	Cracked	135.70 FL	*135.70 FL ✓	
16	1		*Rear bumper reinforcement	Dented	578.50 FL	*578.50 FL ✓	
17	2		*Rear bumper side retainers	Necessary	117.80 FL	*117.80 FL ✓	
18	1		*Rear no plate lamps assy	Affected	168.40 FL	*168.40 FL ✓	
19	1		*Boot lid centre garnish clips (set)	Necessary	28.00 FS	*28.00 FS ✓	
20	1		*Boot lid insulator clips (set)	Necessary	35.00 FS	*35.00 FS ✓	
21	1		*Rear end panel inner garnish clips (set)	Necessary	14.00 FS	*14.00 FS ✓	
22	1		*Rear end panel sealant	Not Necessary	60.00 FS	*- FS ✗	
23	1		*Rear bumper clips (set)	Necessary	35.00 FS	*35.00 FS ✓	
24	1		*Reverse sensors	Affected	300.00 FS	*200.00 FS ✓	
					Sub Total (\$)	8,953.42	4,045.50
					- List Item Discount on L Items 10.00/10.00% (\$)	848.14	373.35
					Total Parts (\$)	8,105.28	3,672.15

F=Franchise part. S=SpcNett. L=ListItemDisc.

AutoProbe Consultants/SGC4844G/18/01/2021 14:36. Not valid without Reference section.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Remove boot lid fittings, check, renew damaged fittings, transfer all fittings to new boot lid assy and refit.	New	60.00	60.00 ✓
2	Remove necessary interior upholstery and fittings to enable necessary repairs, check and refit same.	New	80.00 ✗	40.00 Ⓢ
3	Remove lamps, necessary wiring and electrical fittings to enable necessary repairs, check, replace damaged parts, refit same, test electrical-circuit.	New	30.00	30.00 ✓
4	Renew reverse sensors, transfer same to new bumper assy, refit, reset and test system.	New	80.00	50.00 ✓
5	Remove rear exhaust pipe assy, repair and refit same.	New	180.00 ✓	0.00 100
6	Remove damaged parts, jack and cut out damaged body panels, jack out, straighten up damaged body panels and repair body parts and fittings, whichever possible and necessary, replace and weld necessary damaged parts, refit and align whichever parts necessary.	New	1,000.00 ✓	500.00
7	Paint replacement parts and repaint damaged sections with welded portions in and outside.	New	1,400.00 ✗	650.00 Ⓢ
8	Rust proof replacement parts and touch up damaged sections.	New	150.00 ✗	60.00
Gross Labour Cost (\$\$)			2,980.00	1,390.00

AutoProbe Consultants/SGC4844G/18/01/2021 14:36. Not valid without Reference section.

< END OF ESTIMATES >

Auto probe photos

Bootlid inner lock assy PRS photo 44/140
 Same Damage. and 130/140

Bootlid inner lock catch (can't see Damage)

Bootlid hinges PRS photo 121-40-127

Bootlid dampers PRS photo (45/48) 125-127
 126

rear end panel

Repair

107
 108
 109
 110 / 140

taillamp

Can't see reuse photo 29/140 30/140

can see reflector and taillamp misalign.

labour to dismantle exhaust PRS photo 54/140

submit 1/5 @ \$600
 5 days