



KM AUTO ASSESSORS PTE. LTD.

Insurance Loss Assessors / Adjusters

47 Jalan Pemimpin

#02-07 Halcyon 2

Singapore 577200

T 6448 8208

F 6442 9690

E kmautoassessors@gmail.com

Regn.No. 200907340Z

AUTOMOBILE INSPECTION REPORT

NO. 9/3/TP012

To: TAN QWEE TECK
BLK 322 SERANGOON AVENUE 3 #08-270 S'PORE 550322

General Condition: ~~Poor~~/Fair/Good/Excellent

Reg. No.	SGC 4844 G	Make/Model	TOYOTA LEXUS GS300 AUTO	Year	2006
Engine No.	3GR0129870	Chassis No.	JTHBG96S005022633	Colour	Dark Grey
Condition of Tyres			Speedometer Reading - Km		
Front N/S	PIRELLI 225/50R17	worn	20	%	126154
Rear N/S	B/STONE 225/50R17	worn	20	%	
As Requested By		YOURSELF		On	19-Mar-19
The Above Vehicle					

Was Inspected At (19-Mar-19) CHOON HOCK AUTOCARE PTE LTD BLK 176 SIN MING DRIVE #05-03 S'PORE 575721

And The Undermentioned Damage Was Noted:-

Boot lid dented and bent, inner frame bent, centre garnish dented, bent and deformed, reflectors grazed and dislodged, lock assy. bent and jammed, hinges and dampers bent and stiffened, boot rubber kinked and deformed, rear panel dented and bent, both rear lamps assy. dislodged, fenders bent, bumper assy. grazed, dented, bent, deformed and dislodged, fasteners torn, reverse sensors distorted, exhaust pipes pushed inwards, boot floor panel assy. bent.

Photographs:- 165 Copies were taken at time of inspection and are attached .

The Repairers estimate was for a total amount of \$ 13,911.02

After adjustment the estimate was revised and agreed at \$ 11,085.28

SPECIAL REMARKS

The Repairers were **NOT AUTHORISED** to proceed with the repairs.

Survey was carried out without prejudice.

The above were due to impact to the rear portion of the vehicle.

Alternatively, we recommend that repairs be carried out on a Lump Sum basis instead, @\$8,850/- Nett.


MICHAEL EE Dip A Eng., AMIRTE., AMSAE., AMSOE., AMIMI., MSAAA.

Date 29-Mar-19

**APPENDIX 'A'****TO REPORT NO: 9/3/TP012****REGN. NO: SGC 4844 G**

Nature of Work and Materials	Repairers Estimate \$	Remarks	Amount Revised \$
1 pce boot lid	961.90	dented & bent	961.90
1 pce boot lid centre garnish	361.40	dented, bent, fasteners snapped	361.40
1 pce boot lid emblem	83.40	necessary	83.40
1 pce boot lid "LEXUS" plate	82.70	necessary	82.70
1 pce boot lid "GS300" plate	82.70	necessary	82.70
1 pce boot lid inner lock assy.	1,236.40	bent & jammed	1,236.40
1 pce boot lid inner lock catch	76.10	bent	76.10
2 pcs boot lid hinges	191.20	bent & jammed	191.20
2 pcs boot lid dampers	543.60	bent & stiffened	543.60
2 pcs boot lid reflectors	592.20	grazed, dislodged, fasteners snapped	592.20
1 pce boot rubber	195.90	kinked & deformed	195.90
2 pcs rear lamps assy.	1,566.52	dislodged, fastening studs snapped	1,566.52
2 pcs rear lamp panels	464.80	to repair	-
1 pce rear panel	642.10	dented & bent	642.10
1 pce rear panel inner garnish	282.80	not necessary	-
1 pce rear bumper fascia	864.90	grazed, dented, bent, fasteners torn	864.90
1 pce rear bumper inner sponge	135.70	torn	135.70
1 pce rear bumper reinforcement	578.50	dented & bent	578.50
2 pcs rear bumper side retainers	117.80	fasteners snapped	117.80
1 set no. plate lamps assy.	168.40	housing bracket snapped	168.40
			8,481.42
		less 10%	848.14
	9,229.02		7,633.28
S.NETT			
1 set boot lid centre garnish clips	28.00	necessary	28.00
1 set boot lid insulator clips	35.00	necessary	35.00
1 set rear panel inner garnish clips	14.00	necessary	14.00
1 pce rear panel sealant	60.00	necessary	60.00
1 set rear bumper clips	35.00	necessary	35.00
1 set reverse sensors	300.00	distorted, s/circuited	300.00
Remove boot lid fittings, check, renew damaged fittings, transfer all fittings to new boot lid assy. and refit.	120.00		60.00
Remove necessary interior upholsterys and fittings to enable necessary repairs, check and refit same.	150.00		80.00
	c/f 9,971.02		8,245.28
Total Amount Revised			\$
Lump Sum Repairs Amount			\$
It is estimated that the repairs will take		days to complete.	

**APPENDIX 'A'****TO REPORT NO:****9/3/TP012****REGN. NO:****SGC 4844 G**

Nature of Work and Materials	Repairers Estimate \$	Remarks	Amount Revised \$
b/f	9,971.02		8,245.28
Remove lamps, necessary wirings and electrical fittings to enable necessary repairs, check, replace damaged parts, refit same, test electrical-circuit.	60.00		30.00
Renew reverse sensors, transfer same to new bumper assy., refit, reset and test system.	150.00		80.00
Remove rear exhaust pipe assy., repair and refit same.	280.00		180.00
Remove damaged parts, jack and cut out damaged body panels, jack out, straighten up damaged body panels and repair body parts and fittings, whichever possible and necessary, replace and weld necessary damaged parts, refit and align whichever parts necessary (incl. alignment of body structure).	1,400.00		1,000.00
Paint replacement parts and repaint damaged sections with welded portions in and outside.	1,800.00		1,400.00
Rustproof replacement parts and touch-up damaged sections.	250.00		150.00
TOTAL	13,911.02		11,085.28
Total Amount Revised	\$	11,085.28	
Lump Sum Repairs Amount	\$	8,850.00	
It is estimated that the repairs will take	SEVEN	days to complete.	



















































































