8/25/22, 9:58 AM Adjuster Report

### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS/CTI22004947/ENY3Q2

25/08/2022 Date:

**REFERENCE** 

China Taiping Insurance Handling Insurer:

(Singapore) Pte. Ltd.

Policy No:

DMCVSNW00070062101

**Claimant Vehicle** 

SBS6194K

Insured

GY6413M

No:

Vehicle No:

Date of Loss: 20/05/2022 Nature of Claim: TP Claim

Odometer:

SNM22D203577/C02/LEWLC

795584 km

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

SBS6194K Reg No:

Make & Model: SANYANG HF15W-6, 151cc (A) Engine No: 90292609016323 Reg. Date: 12/04/2012 (Man. Year: 2011) Chassis No: WEB62808323123176

Colour: Multi-colour

**Engine Capacity:** 6374 cc Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): **Engine Modification:** Pre-accident Condition: Yes Nο

**CONDITION OF TYRES** 

Front Tyre Size: 295/80R22.5 Rear Tyre Size: 295/80R22.5 Front Left Side: Rear Left Side: Bridgestone 4 mm Bridgestone 4 mm Front Right Side: Bridgestone 4 mm Rear Right Side: Bridgestone 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,434.88	2,434.88	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,128.00	1,128.00	0.00	0.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	3,562.88	3,562.88	0.00	0.00
+ GST 7.00/7.00% (S\$)	249.40	249.40	0.00	0.00
Nett Amount (S\$)	3,812.28	3,812.28	0.00	0.00

**INSPECTION** 

Date of Assignment: 25/05/2022

SBS Transit Ltd (Bukit Batok)

550 Bukit Batok Street 23 Date Inspected: 26/05/2022 Inspected At:

Singapore 659519

Estimated Period of Repair: 1.0 days

HUEY YON Adjuster: **CHEN TSUE YEE** Manager:

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

(REPAIR COST NOT CONCLUDE)

Adjuster Report

### REPAIR DETAILS

Reference

Part Source: (Last Synchronised: 25 Aug 2022)

Parts: N/A SANYANG HF15W-6 151cc (A) (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SBS6194K)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with

the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk \*.

#### **Recommended Parts**

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FASTENER ;OS/NS FRT BUMPERETTE	Necessary	11.00 F	*11.00 F
2	1		*BRACKET N/S ,FRT BUMPERETTE	Bent	268.00 F	*268.00 F
3	1		*FRONT WINDSCREEN COMPOUND SAFETY.G	Cracked	832.00 F	*832.00 F
4	1		*COVER OUTSIDE ATTACHMENT PARTS	Broken	191.00 F	*191.00 F
5	1		*BUMPERETTE FRT BUMPERETTE N/S	Broken	590.00 F	*590.00 F
6	1		*GLASS ,QUARTER FRT N/S	Broken	359.00 F	*359.00 F
7	1		*BLINKER LAMP FRT LEFT	Broken	44.00 F	*44.00 F
8	10		*SILKAFLEX 255 EXTRA BLACK	Necessary	98.00 F	*98.00 F
9	1		*PAINT C6000 MERCEDES PURPLE	Necessary	21.12 F	*21.12 F
10	1		*PAINT C6000 MERCEDES WHITE	Necessary	20.76 F	*20.76 F
F=Fra	nchise	part.		_		
				Total Parts (S\$)	2,434.88	2,434.88
				_		

Report was unsubmitted during this print-out.

# Recommended Miscellaneous Items

There are no new miscellaneous items selected.

# Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Lab</u>	our Items			
1	WORKSHOP LABOUR FOR REPAIR AND REPLACE BUS DAMAGE & PARTS	New	1,128.00	1,128.00
2	CONTRANCTORS REPAIR CHARGES (NPA)	New	0.00	0.00
	Gross Labour Cost (S\$)		1,128.00	1,128.00
	Report was unsubmitted during this	print-out.		

< END OF ESTIMATES >