

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22004971/KNY3Q2**Date:** 07/12/2022**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSNW00118282104

**Claimant Vehicle
No :** YM7943T**Insured Vehicle
No :** YP4757T

Date of Loss: 20/04/2022

Nature of Claim: TP

Claim
No: SNM22D202724/C02/TANKL**DESCRIPTION & IDENTIFICATION OF VEHICLE**Reg No: **YM7943T**

Make & Model: MITSUBISHI FE83BE6SRDEA, 3.0 D (A)

Engine No: 4M42A42149

Reg. Date: 30/11/2007 (Man. Year: 2007)

Chassis No: FE83BCA10022

Colour: White

Odometer: 341480 km

Engine Capacity: 2977 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 700 R16X10

Front Left Side: OTANI 9 mm

Front Right Side: OTANI 9 mm

The above values represent the remaining tyre treads depth

Rear Tyre Size:

Rear Left Side:

Rear Right Side:

700 R16X10 (D)

Yokohama 9/9 mm

Proforce 9/9 mm

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,686.00	3,686.00	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,800.00	300.00	1,500.00	83.33
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	5,486.00	3,986.00	1,500.00	27.34
Approved Total (Overridden) (\$\$)		3,200.00		
(\$\$)	5,486.00	3,200.00	2,286.00	41.67
+ GST 7.00/7.00% (\$\$)	384.02	224.00	160.02	41.67
Nett Amount (\$\$)	5,870.02	3,424.00	2,446.02	41.67

INSPECTION

Date of Assignment: 26/05/2022

Date Inspected: 30/05/2022 Inspected At:

ComfortDelGro Engineering Pte Ltd (Braddell)
205 Braddell Road
Singapore 579701

Estimated Period of Repair: 3.0 days

Adjuster: KENNETH KONG**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 07 Dec 2022)	
Parts:	N/A	MITSUBISHI FE83BE6SRDEA 3.0 D (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for YM7943T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*LHR DOOR W GASKET	Cracked	1,700.00 FS	*1,700.00 FS
2	1		*STAINLESS STEEL HINGE	Distorted	136.00 FS	*136.00 FS
3	1		*STICKER WRAP	Necessary	1,850.00 FS	*1,850.00 FS
Total Parts (S\$)						3,686.00

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REMOVE,REPLACE ,REPAIR & REFIT	New	700.00	300.00
2	RESPRAY PAINTING	New	900.00	0.00
3	FRT WHEEL ALIGNMENT	New	100.00	0.00
4	CHECK LIGHTS & WIRING	New	100.00	0.00
5	RECHARGE AC GAS (NPA)	New	0.00	0.00
6	REAR WHEEL ALIGNMENT (NPA)	New	0.00	0.00
Gross Labour Cost (S\$)			1,800.00	300.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >