

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS/HLA22004997/KVY3N2**Date:** 06/06/2022**REFERENCE**

Handling Insurer:	HL Assurance Pte Ltd	Policy No:	MP318482
<b>Claimant Vehicle No :</b>	SCR6328K	<b>Insured Vehicle No :</b>	SMD7667E
Date of Loss:	25/05/2022	Nature of Claim:	TP
		Claim No:	MPC03447/GN

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>SCR6328K</b>		
Make & Model:	MERCEDES-BENZ S400L, 3.0 (A)	Engine No:	27682430218832
Reg. Date:	05/06/2015 (Man. Year: 2015)	Chassis No:	WDD2221652A184194
Colour:	Metallic Black	Odometer:	118166 km
Engine Capacity:	2996 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size:	245/45R19	Rear Tyre Size:	275/40R19
Front Left Side:	Pirelli 7 mm	Rear Left Side:	Pirelli 7 mm
Front Right Side:	Pirelli 7 mm	Rear Right Side:	Pirelli 7 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	2,289.00	2,062.90	226.10	9.88
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,080.00	700.00	380.00	35.19
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>3,369.00</b>	<b>2,762.90</b>	<b>606.10</b>	<b>17.99</b>

**INSPECTION**

Date of Assignment:	26/05/2022	Ready Autocare (HQ)
Date Inspected:	30/05/2022 Inspected At:	Blk 10 #03-06 AMK Auto Point, Ang Mo Kio Industrial Park 2 A, Ang Mo Kio Ave 5 Singapore 568047
Estimated Period of Repair:	2.0 days	

**Adjuster:** KENNETH KONG**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 06 Jun 2022)
Parts:	143	MERCEDES-BENZ S400L 3.0 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SCR6328K)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Buckled/Cracked	2,261.00 F	*2,261.00 FL
2	1		*SET REAR BUMPER CLIPS	Necessary	28.00 FS	*28.00 FS
F=Franchise part. S=SpcNett. L=ListItemDisc.						
Sub Total (S\$)					2,289.00	2,289.00
- List Item Discount on L Items 0.00/10.00% (S\$)					0.00	226.10
Total Parts (S\$)					2,289.00	2,062.90

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO REMOVE ALL DAMAGED PARTS,KNOCK OUT DENTS,JACK OUT DAMAGED PANEL PANEL,ADJUST,REPLACE,RESHAPE,CUT,WELD,REFIX AND REALIGN BODY STRUCTURE	New	480.00	250.00
2	SPRAY PAINTING FOR NEW AND REPAIR PARTS INCLUDING SUPPLY OF PAINTS MATERIALS	New	400.00	300.00
3	COMPUTER DIAGNOSE TO RESET FALSE MEMORY	New	150.00	150.00
4	CAVITY PRESERVATION ON ALL AFFECTED AREAS	New	50.00	0.00
<b>Gross Labour Cost (\$\$)</b>			<b>1,080.00</b>	<b>700.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >