

ASS. REC. BY:

REF:

176W/22004997/KV y3

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured: SMD 7667E

Policy No. MP318482

Claims No. MPC03447/GN

Sum Insured:

Excess:


(Client's Record)

Make of Veh:

10.30am

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

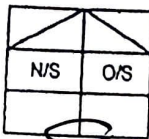

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

02

days

Res.: Yes or No

Lum Sum:

1.8.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SCR 6328K

Yr Regn:

06.15

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mw S400i

c.c.

2996

Colour

M. Black

A/C:

Insured / Std / NI / NA

Sp. Reading

118166

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WDD 2221632A 184194

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

245/45R19

275/40R19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

25/5/22

D.O.I.

30/5/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

31/5/22

Kenneth informed final fig \$2762.90 (Red 606.10, 18%)

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

Days Of Repair: 2

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

S + RS. \$

Fees

Others

TOTAL

2) 3/6/22-typist

Add Fee: ☐ Site Insp (\$☐ Interview (\$☐ Tech Invs (\$☐ Weekend (\$

Report Format: TP

Lump Sum / I.B.I: (\$ 2762.90

Ready Auto Care Pte Ltd - We Care For All Your Car Needs

Blk 10 # 03-06 AMK Auto Point, Ang Mo Kio Ind Park 2A, Ang Mo Kio Ave 5. Singapore 568047
Tel : 64810304 Fax : 64815587 Reg No : 200600989K

HLAS

Motorcar Claim Department

Estimate Repair

Date : 27/05/2022

Accident Involving SCR6328K & SMD7667E On 25/5/2022 Along Bukit Timah Road

SCR6328K

Mercedes S400

Item	Descriptions	Amount
1	Rear Bumper	\$ 2,261.00
Total For Parts (Nett)		\$ 2,261.00

S/N Item (s)

1	Rear Bumper Clips - 1 Set	\$ 28.00
2		

Total For S/N \$ 28.00

Labour & Misc

1	To Remove All Damaged Parts, Knock Out Dents, Jack Out Damaged Panel	\$ 480.00
2	Panel, Adjust, Replace, Reshape, Cut, Weld, Refix & Realign Body Structure	\$ 400.00
3	Spray Painting For New And Repair Parts Including Supply Of Paints Materials	\$ 150.00
4	Computer Diagnose To Reset False Memory	\$ 50.00
	Cavity Preservation On All Affected Areas	
		\$ 1,080.00

Ready Auto Care Pte Ltd
Sulynn - 96606551

Total For Parts & Labour \$ 3,369.00

No Of Days For Repair 3 Days

Not Authorized
Resurvey B4 paint

2 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: