

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22005003/KPA3Q2**Date:** 26/10/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1900244032
Claimant Vehicle No :	SJW2148E	Insured Vehicle No :	SKH6911J
Date of Loss:	26/05/2022	Nature of Claim:	TP
		Claim No:	0073132642SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJW2148E		
Make & Model:	BMW 318i, 2.0 L ABS D/AIRBAG 2WD 4DR SR (A)	Engine No:	B486I629N46B20BZ
Reg. Date:	10/03/2010 (Man. Year: 2010)	Chassis No:	WBAPF72040A793605
Colour:	Metallic Black	Odometer:	116719 km
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 7 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,371.94	15,374.53	997.41	6.09
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,330.00	2,790.00	540.00	16.22
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	19,701.94	18,164.53	1,537.41	7.80
Approved Total (Overridden) (S\$)		14,500.00		
(S\$)	19,701.94	14,500.00	5,201.94	26.40
+ GST 7.00/7.00% (S\$)	1,379.14	1,015.00	364.14	26.40
Nett Amount (S\$)	21,081.08	15,515.00	5,566.08	26.40
+ Loss of Use (15.0 x S\$100.00/day) (S\$)		1,500.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		17,017.00		

INSPECTION

Date of Assignment:	27/05/2022	
Date Inspected:	27/05/2022	Inspected At: Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A Singapore 768761
Estimated Period of Repair:	13.0 days	

Adjuster: KENNETH KONG**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Buckled	1,064.14 FL	*1,064.14 FL
2	1		*FRONT BUMPER RH RETAINER	Distorted	25.10 FL	*25.10 FL
3	1		*FRONT RH FENDER	Bent	670.85 FL	*670.85 FL
4	1		*FRONT RH FENDER SIGNAL LAMP	Cracked	60.50 FL	*60.50 FL
5	1		*FRONT RH FENDER INNER SHIELD (FRT)	Distorted	124.20 FL	*124.20 FL
6	1		*FRONT RH FENDER INNER SHIELD (REAR)	Distorted	124.20 FL	*124.20 FL
7	1		*WIPER WASHER TANK	Dented	130.80 FL	*130.80 FL
8	1		*RH HEADLAMP	Cracked	1,022.45 FL	*1,022.45 FL
9	1		*RH HEADLAMP LOWER BRACKET	Repair	95.10 FL	*- FL
10	1		*FRONT RH DOOR	Bent	1,416.20 FL	*1,416.20 FL
11	1		*FRONT RH DOOR INNER RUBBER (50%)	Necessary	136.23 FS	*71.70 FS
12	1		*FRONT RH DOOR TOP HINGE	Bent	75.90 FL	*75.90 FL
13	1		*FRONT RH DOOR BOTTOM HINGE	Bent	75.90 FL	*75.90 FL
14	1		*FRONT RH DOOR CHECKER	Distorted	100.50 FL	*100.50 FL
15	1		*FRONT RH DOOR POWER WINDOW MOTOR	Serviceable	328.80 FL	*- FL
16	1		*FRONT RH DOOR POWER WINDOW REGULATOR	Distorted	348.48 FL	*348.48 FL
17	1		*SET FRONT RH DOOR WIRE HARNESS	Cracked	237.45 FL	*237.45 FL
18	1		*REAR RH DOOR	Bent	1,537.20 FL	*1,537.20 FL
19	1		*REAR RH DOOR INNER RUBBER (50%)	Necessary	136.23 FS	*71.70 FS
20	1		*RH SIDE SKIRT	Buckled / Dented	354.35 FL	*354.35 FL
21	1		*SET RH SIDE SKIRT CLIPS	Necessary	30.00 FL	*30.00 FL
22	1		*REAR RH RIM 16	Dented	755.80 FL	*755.80 FL
23	1		*FRONT RH RIM 16	Dented	755.80 FL	*755.80 FL
24	1		*FRONT RH SHOCK ABSORBER	Bent	506.60 FL	*506.60 FL
25	1		*FRONT RH TOP MOUNTING	Bent	205.50 FL	*205.50 FL
26	1		*FRONT RH STOPPER	Bent	60.50 FL	*60.50 FL
27	1		*FRONT RH KNUCKLE ARM	Bent	580.50 FL	*580.50 FL
28	1		*FRONT RH WHEEL BEARING	Necessary	462.65 FL	*462.65 FL
29	1		*FRT RH ABS SENSOR WIRE	Serviceable	227.10 FL	*- FL
30	1		*FRT RH ABS BRACKET	Distorted	90.20 FL	*90.20 FL
31	1		*FRT RH BRAKE PIPE BRACKET	Dented	50.60 FL	*50.60 FL
32	1		*FRONT RH STAY LINKAGE	Bent	97.10 FL	*97.10 FL
33	1		*FRONT RH LOWER ARM	Bent	234.05 FL	*234.05 FL
34	1		*FRONT RH TRAILING ARM	Distorted	234.05 FL	*234.05 FL
35	1		*STEERING RACK ASSY	Bent / Jammed	2,559.45 FL	*2,559.45 FL
36	1		*FRONT CROSSMEMBER	Bent	1,554.10 FL	*1,554.10 FL
37	1		*FRONT BUMPER RH FOG LAMP	Serviceable	263.05 FL	*- FL
38	1		*RH TAILLAMP	Cut	421.30 FL	*421.30 FL
39	1		*ENGINE BRACKET LH	Cracked	66.35 FL	*66.35 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	17,219.28	16,176.17
- List Item Discount on L Items 5.00/5.00% (\$)	847.34	801.64
Total Parts (\$)	16,371.94	15,374.53

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOWING	New	100.00	100.00
2	REMOVE & REFIX FRT BUMPER & ATTACHMENTS ,GRILLE ,FRT RH FENDER ,HEADLAMP ,BOTH RH DOORS & ATTACHMENTS RH SIDE SKIRT ,TAILLAMP ,KNOCKING & REPAIR FRT RH DOOR PILLAR & REALIGN THE SAME	New	1,200.00	1,000.00
3	PUTTY &RESPRAY FRT & REAR BUMPER ,BOTH RH FENDER ,BOTH RH DOORS ,FRT RH SIDE MIRROR RH SIDE SKIRT ,FRT RH DOOR PILLAR & ALL AFFECTED AREAS	New	1,300.00	1,200.00
4	REMOVE & REFIX FRT RH UNDERCARRIAGE ,CROSSMEMBER ,STEERING RACK ASSY & REALIGN THE SAME	New	450.00	320.00
5	REMOVE & REFIX BOTH RH RIMS ,BALANCE & REALIGN THE SAME	New	80.00	20.00
6	TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT	New	80.00	60.00
7	RUSTPROOFING	New	120.00	90.00
Gross Labour Cost (\$\$)			3,330.00	2,790.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >