

AUTOMAX SURVEY

Blk 110 Bedok Reservoir Road , #07-280, Singapore 470110

Mobile : 9855 6879

Email : automaxsurvey@gmail.com

Registration No. 53110062J

Report Ref : TP18100016

Date: 09 JULY 2019

*Ilyia Haidhar Bin Zulkepli
c/o Eng Soon Painting SVC
Blk 4 Yew Tee Ind Est 393 - J
Woodlands Road
Singapore 677969*

THIRD PARTY SURVEY ACCIDENT OCCURED ON 29 OCT 2018

Workshop Name and Address

Eng Soon Painting SVC
Blk 4 Yew Tee Ind Est 393 - J
Woodlands Road
Singapore 677969

As per your instruction dated
We have carried out a physical inspection on the said
We enclosed herewith our report and findings as follows:

23 NOV 2018

with regard to the above matter,
FBN711J

1. VEHICLE PARTICULARS

Registration No : FBN711J
Model : HONDA CB190X
Year / Capacity : Jul 2018 / 189 cc
Chassis No : LWBPC11AXH1005376

Engine No : WH161FMK17M00234
Mileage : n.a km
Colour : Multi Colour

2. TYRES CONDITION

	<u>Size</u>	<u>Made</u>	<u>Balance</u>	<u>Rim</u>
FRONT O/S :	80/90/R17	Bridgestone	7.00 mm	Sport
REAR O/S :	80/90/R17	Bridgestone	7.00 mm	Sport
FRONT N/S :				
REAR N/S :				

AUTOMAX SURVEY

Blk 110 Bedok Reservoir Road , #07-280, Singapore 470110

Mobile : 9855 6879

Email : automaxsurvey@gmail.com

Registration No. 53110062J

3. DESCRIPTION OF DAMAGES

At the time of inspection, we noted that the vehicle has sustained an impact damages on the side portion(s). For more detail of the damages, please see photograph attached.

4. Estimated normal period of repair : 60 working days to complete

5. In accordance to your instruction, we have Not Authorised repair to the vehicle and the survey done on a "Without Prejudice" basis. We hope that this report will be of assistance to you in dealing with the matter.

6. Should you discover any discrepancy in the report, please kindly notify us within 1 week, or the report will be treated as correct.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicles and/or other accidents in other legal proceedings.

Vehicle Number : FBN711J

SPARE PARTS

QTY	PARTS DESCRIPTION	CONDITION	Workshop Estimation (S\$)	Our Revised Estimation (S\$)
<i>List Items</i>				
1 pc	Side mirror	damaged	\$ 250.00	\$ 250.00
1 pc	Brake lever assembly	bent	\$ 125.71	\$ 125.71
2 pcs	Balancer	bent	\$ 100.00	\$ 100.00
1 pc	Front mudguard	deformed	\$ 275.00	\$ 275.00
1 pc	Exhaust manifold	bent	\$ 352.00	\$ 352.00
1 pc	Exhaust pipe	bent	\$ 1,280.00	\$ 1,280.00
1 pc	Headlamp	cracked	\$ 355.00	\$ 355.00
1 pc	Headlamp bracket	bent	\$ 130.00	\$ 130.00
2 pcs	Headlamp stay	bent	\$ 96.00	\$ 96.00
1 pc	Front footrest	bent	\$ 74.80	\$ 74.80
1 set	Front footrest bracket	necessary	\$ 163.80	\$ 163.80
1 pc	Handle bar	bent	\$ 225.00	\$ 225.00
1 set	Handle grip	bent	\$ 62.00	\$ 62.00
1 pc	Fuel tank	bent	\$ 875.54	\$ 875.54
2 pcs	Front signal light	damaged	\$ 150.00	\$ 150.00
2 pcs	Inner fork left and right	bent	\$ 228.42	\$ 228.42
1 set	Steering cone	bent	\$ 165.00	\$ 165.00
1 set	Steering cone bearing	bent	\$ 125.00	\$ 125.00
1 pc	Fork under bracket	bent	\$ 230.00	\$ 230.00
2 pcs	Fork oil seal	deformed	\$ 60.00	\$ 60.00
2 pcs	Fork dust cover	deformed	\$ 30.00	\$ 30.00
2 pcs	Rear signal light	cracked	\$ 180.00	\$ 180.00
1 set	Disc	bent	\$ 548.44	\$ 548.44
1 pc	Rim	damaged	\$ 350.00	\$ 350.00
1 pc	Tyre	damaged	\$ 150.00	\$ 150.00
2 pcs	Side center fairing	damaged	\$ 255.00	\$ 255.00
1 pc	Front rim shaft	bent	\$ 105.75	\$ 105.75
1 pc	Starter switch	grazed/deformed	\$ 185.00	\$ 185.00
1 pc	Clutch lever	grazed/deformed	\$ 68.00	\$ 68.00
1 pc	Clutch cable	distorted	\$ 48.00	\$ 48.00
1 pc	Engine guard	deformed	\$ 450.00	\$ 450.00
1 pc	Meter assy	electronically shocked	\$ 1,750.00	\$ 1,750.00
1 pc	Meter casing	grazed/deformed	\$ 365.00	\$ 365.00
1 pc	Master cylinder assy	grazed/deformed	\$ 288.00	\$ 288.00
1 set	Ignition switch assy	shocked	\$ 205.00	\$ 205.00
1 pc	Body frame assy	bent - repair	\$ 2,880.00	\$ -

Vehicle Number : FBN711J

SPARE PARTS

QTY	PARTS DESCRIPTION	CONDITION	Workshop Estimation (S\$)	Our Revised Estimation (S\$)
-----	-------------------	-----------	---------------------------------	------------------------------------

List Items

1 pc	Main frame cover	broken	\$ 258.30	\$ 258.30
1 pc	Rear Swing arm assy	bent - repair	\$ 828.00	\$ -
1 set	Rear footrest bracket	necessary	\$ 318.60	\$ 318.60
1 pc	Rear footrest	bent	\$ 74.80	\$ 74.80
1 pc	Rear mudguard	grazed/deformed	\$ 148.00	\$ 148.00
2 pcs	Rear side fairing cover	cracked	\$ 288.00	\$ 288.00
1 pc	Rear tail lamp	cracked	\$ 180.00	\$ 180.00
1 pc	Headlamp front windscreen	bent/distorted	\$ 165.00	\$ 165.00
2 pcs	Front side cover	deformed	\$ 180.00	\$ 180.00

	Parts Sub-Total	\$ 15,622.16	\$ 11,914.16
Discount	10.00%	\$ 1,562.22	\$ 1,191.42
		\$ 14,059.94	\$ 10,722.74

Vehicle Number : FBN711J

QTY	PARTS DESCRIPTION	CONDITION	Workshop Estimation (S\$)	Our Revised Estimation (S\$)
<u>Special Nett Items</u>				
2 pcs	Number plate	Bent	\$ 90.00	\$ 90.00
2 pcs	Side box assy	Damaged	\$ 256.00	\$ 256.00
2 blts	Fork oil	Necessary	\$ 30.00	\$ 30.00
2 blts	Brake oil	Necessary	\$ 30.00	\$ 30.00
1 pc	Box bracket	bent/distorted	\$ 120.00	\$ 120.00
1 set	Handle grip protector	grazed/distorted	\$ 100.00	\$ 100.00
1 pc	Radiator hose	deformed	\$ 45.00	\$ 45.00
2 pcs	Horn assy	maulfunction	\$ 150.00	\$ 150.00
2 pcs	Crush bar	dented	\$ 325.00	\$ 325.00
1 pc	Brake pad	Necessary	\$ 90.00	\$ 90.00
1 pc	Brake caliper	distorted	\$ 375.00	\$ 375.00
1 pc	Seat assy	deformed	\$ 220.00	\$ 220.00
1 set	Wiring harness	open cicruit	\$ 550.00	\$ 550.00
1 pc	Fuel tank cover	torn	\$ 88.00	\$ 88.00
1 pc	ERP unit	maulfunction	\$ 186.00	\$ 186.00
1 pc	ERP unit bracket	bent/distorted	\$ 55.00	\$ 55.00
Special Nett Sub-Total			\$ 2,710.00	\$ 2,710.00
Spare Parts Total			\$ 16,769.94	\$ 13,432.74

LABOUR COST

S/No	JOB DESCRIPTIONS	Workshop Estimation (S\$)	Our Revised Estimation (S\$)
------	------------------	---------------------------	------------------------------

Spare PartsTotal c/f \$ 16,769.94 \$ 13,432.74





1	Towing charges	\$ 150.00	\$ 150.00
2	Labour charges	\$ 3,000.00	\$ 2,800.00
3	Body frame repair charges	\$ 2,000.00	\$ 1,800.00
4	To putty, apply primer & spray-paint the affected areas.	\$ 2,200.00	\$ 2,000.00
5	To apply rust-proofing on repaired/replaced panels.	\$ 210.00	\$ 180.00
6	To remove & replace fuel tank incl drainage	\$ 200.00	\$ 180.00



Total \$ 24,329.94 \$ 20,362.74




The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a Lump Sum Repair of :

\$ 18,350.00





Fong Kok Heng
Qualified Appraiser

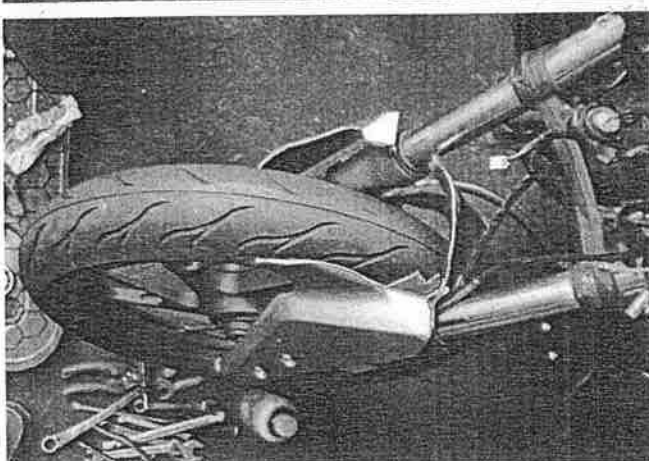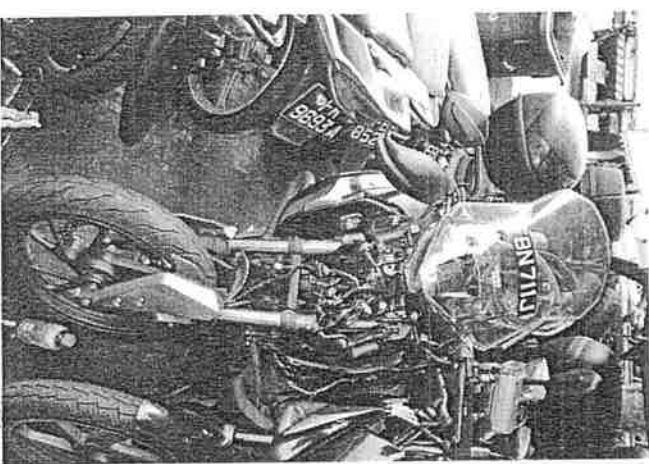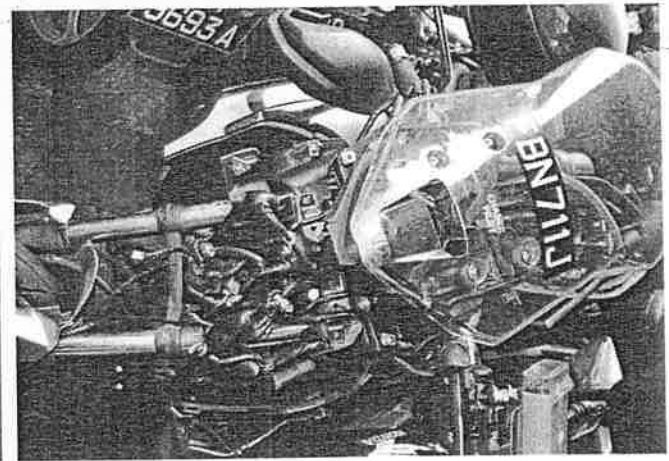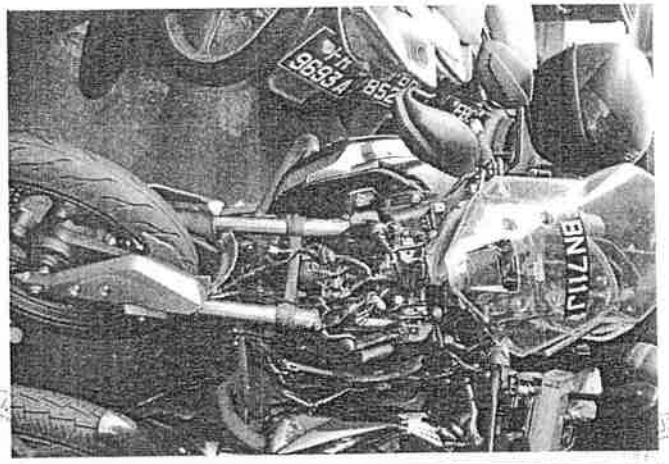


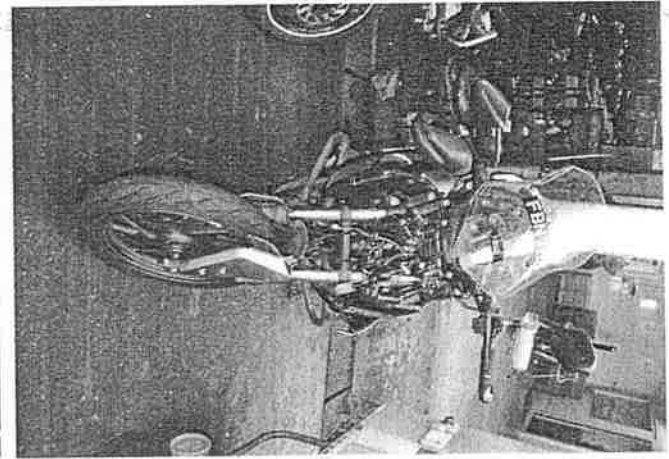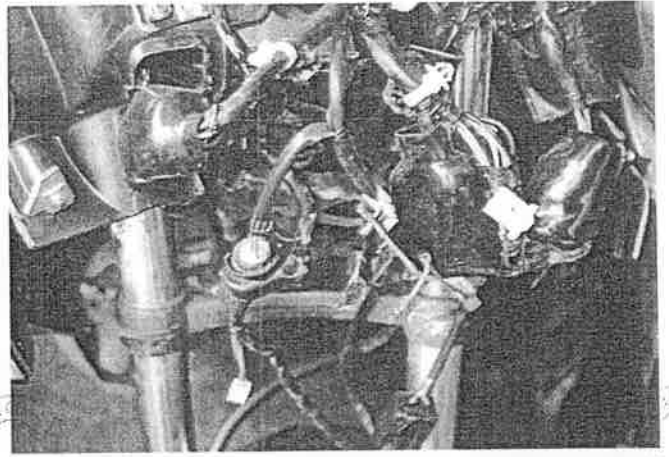


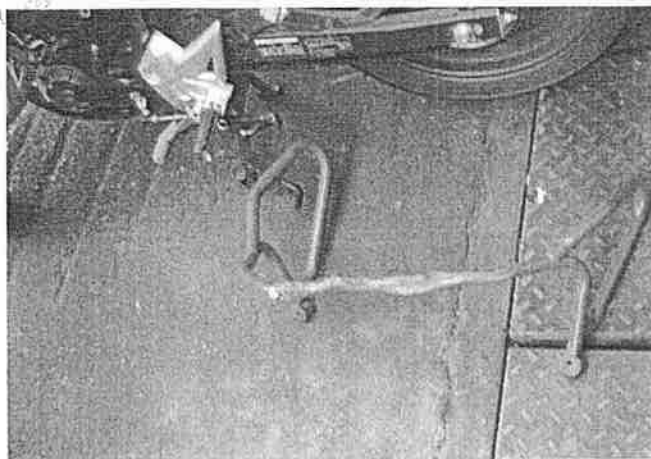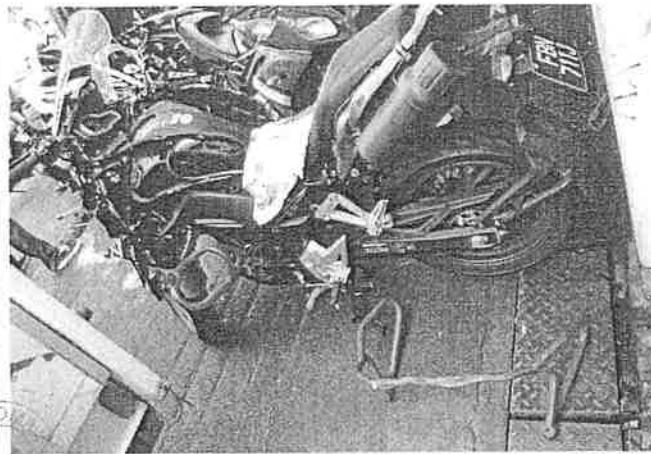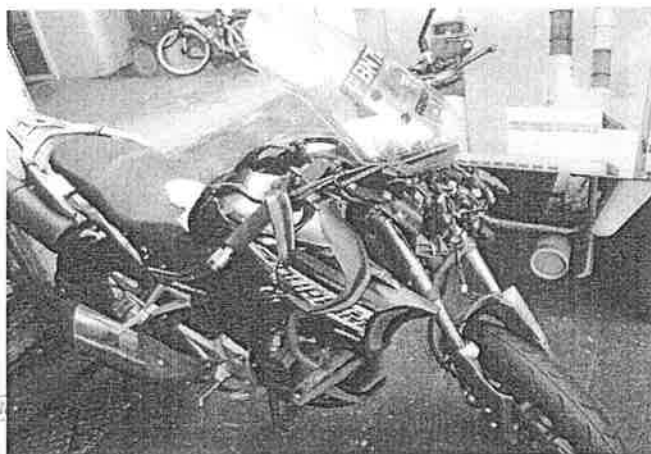







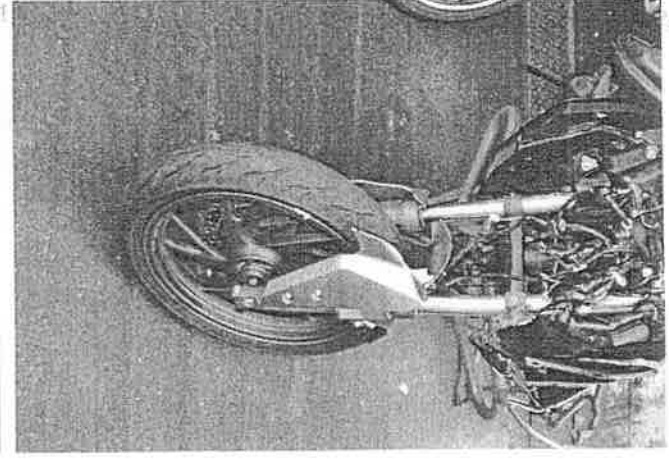
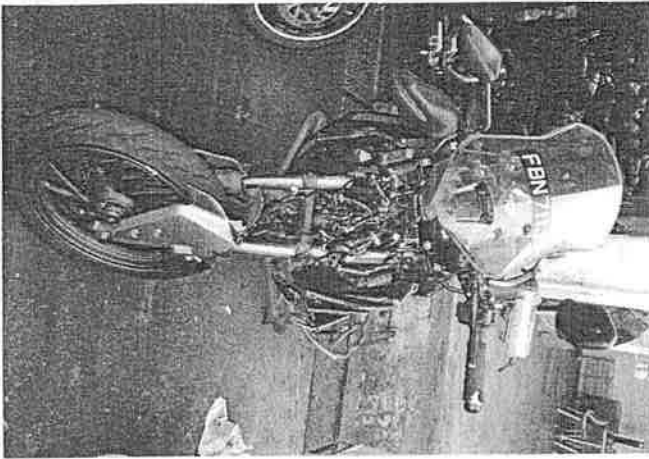
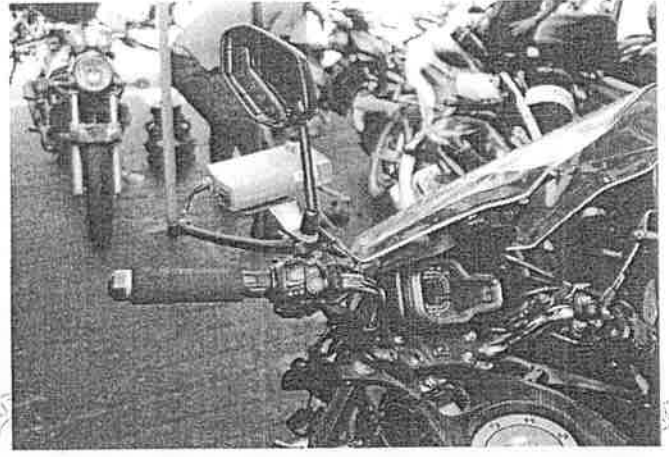





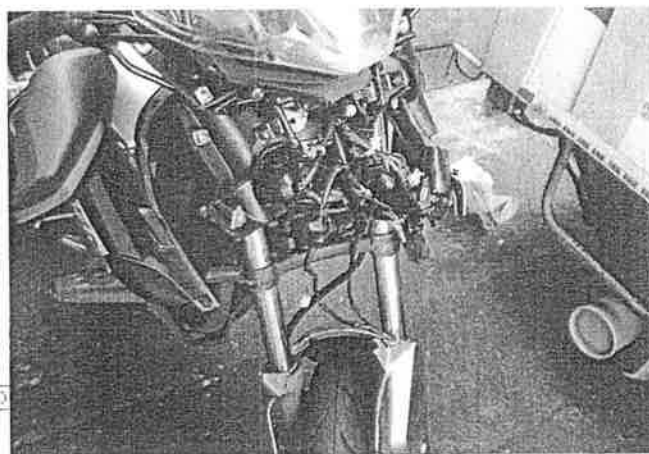




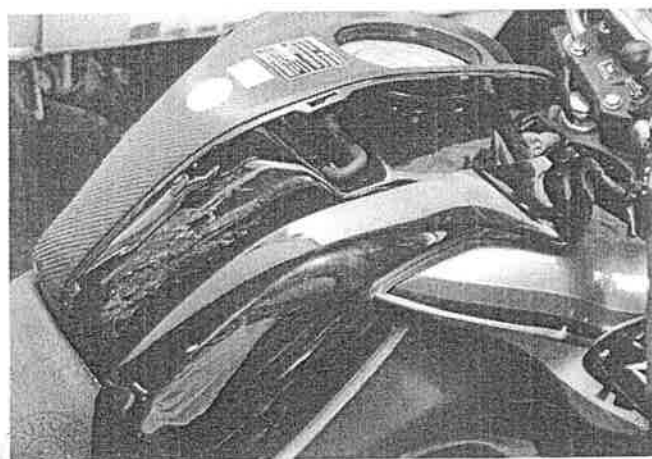




10/11/14

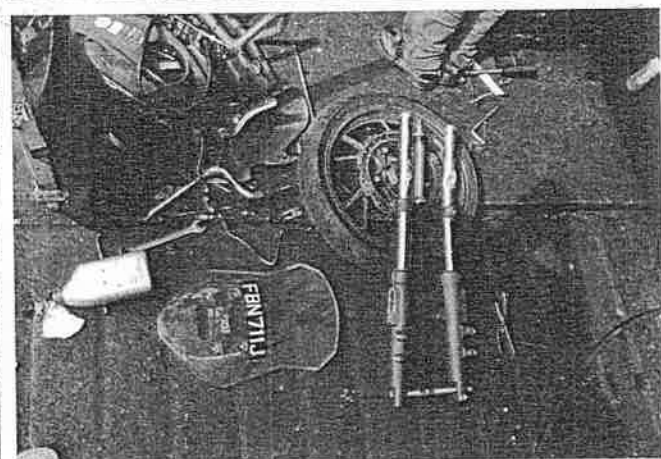
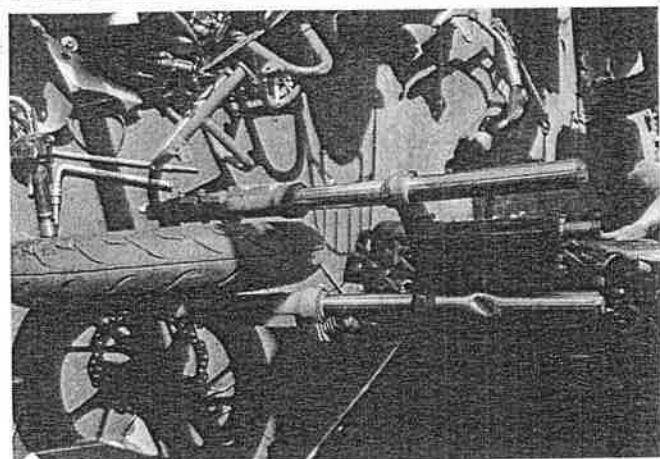
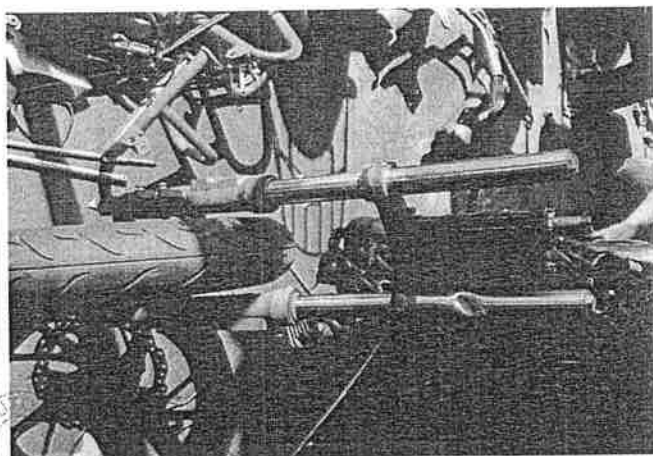
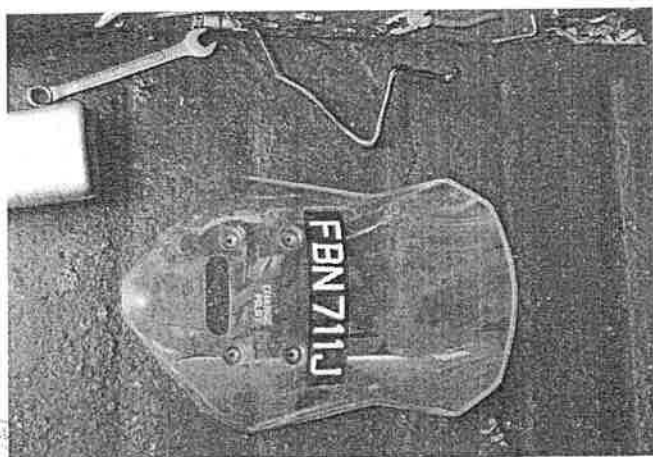


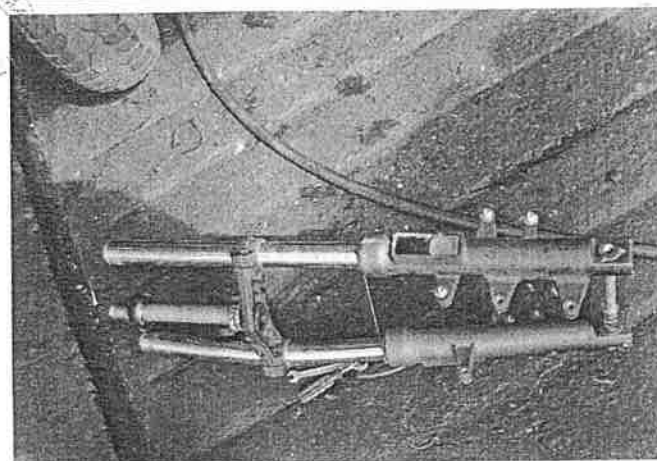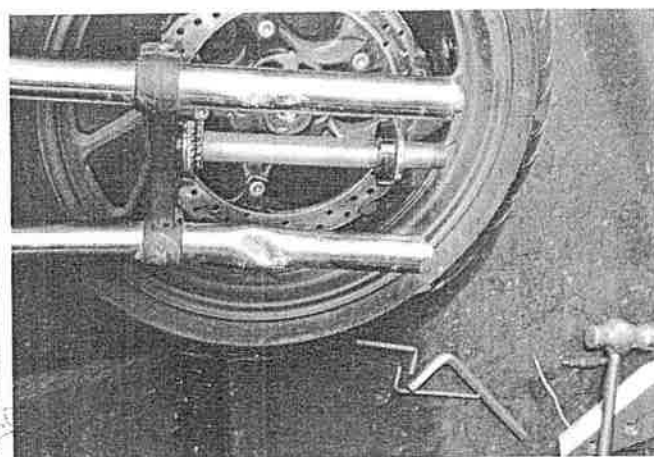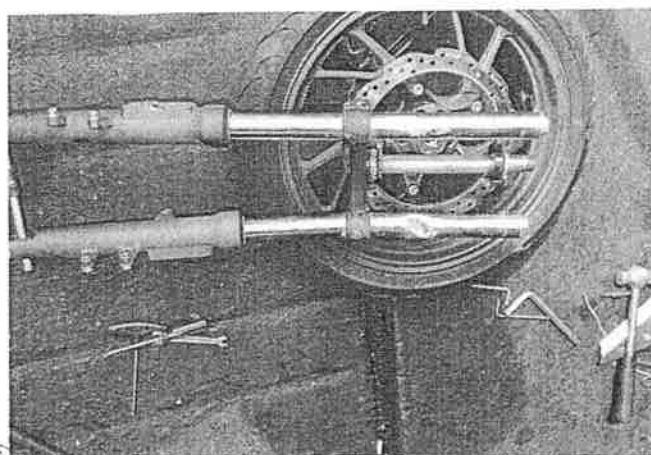

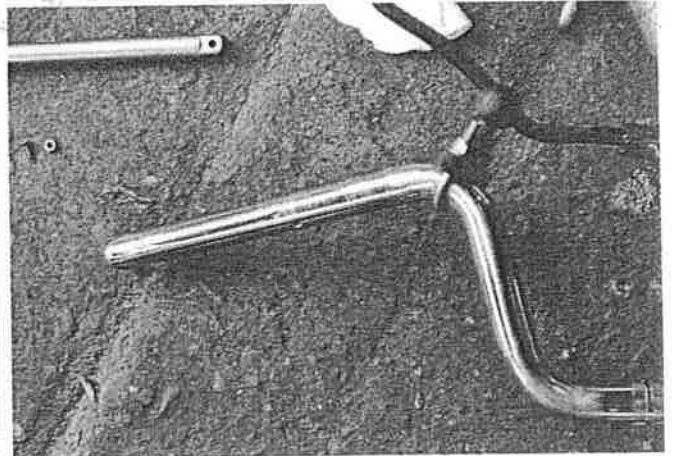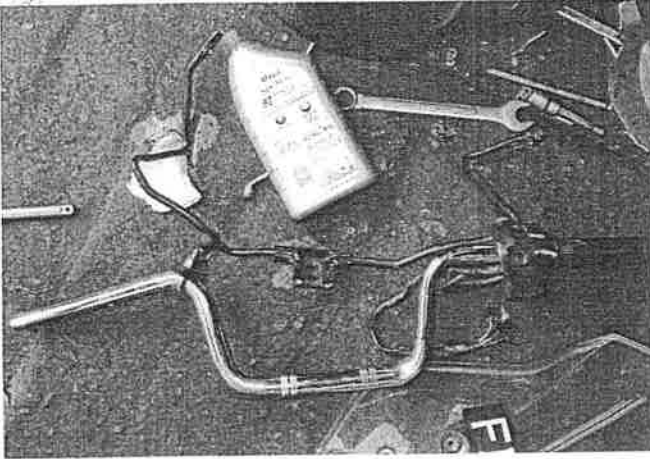
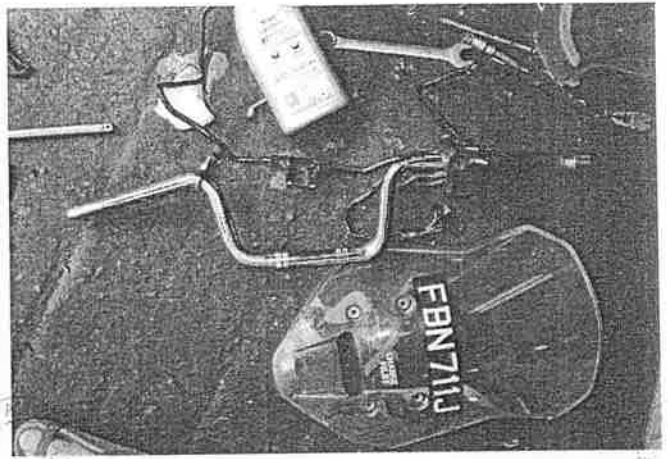
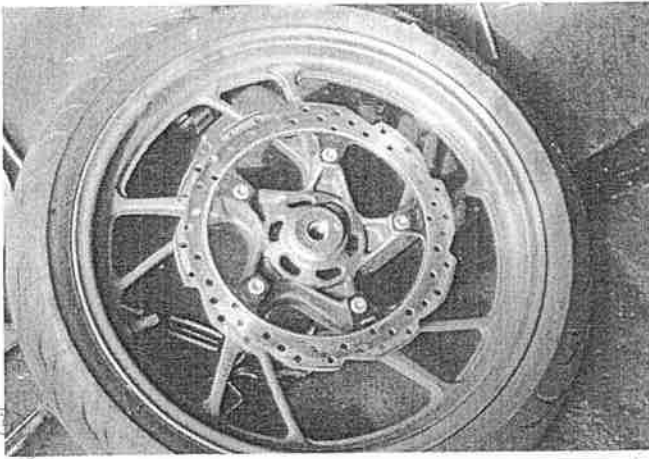


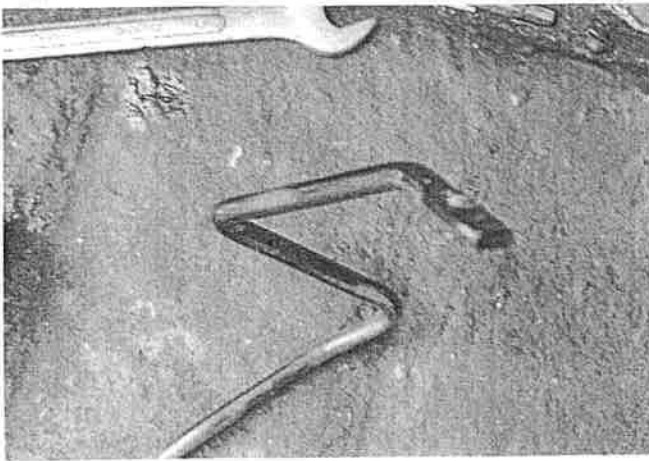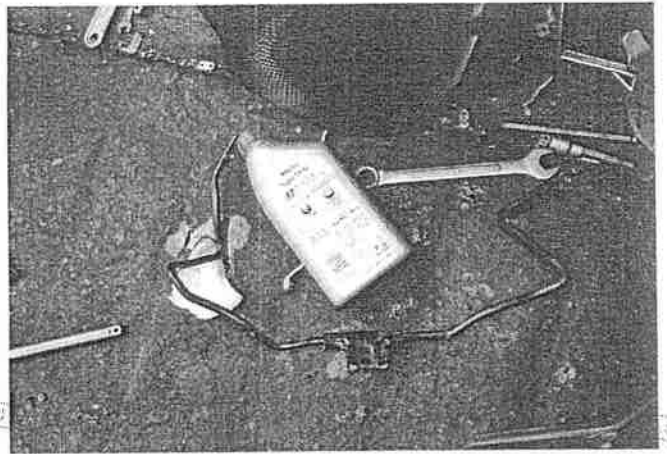
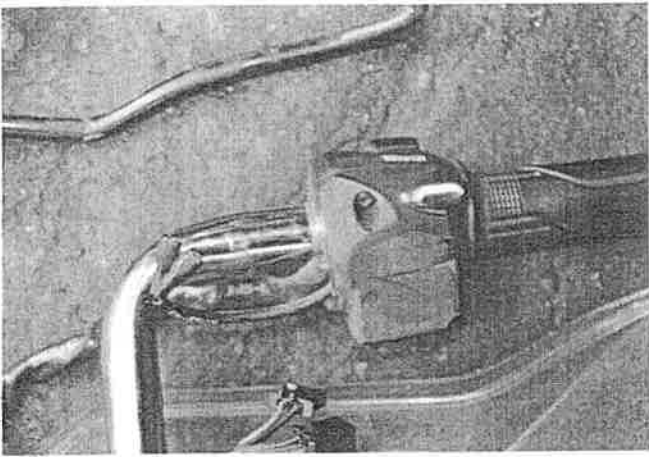



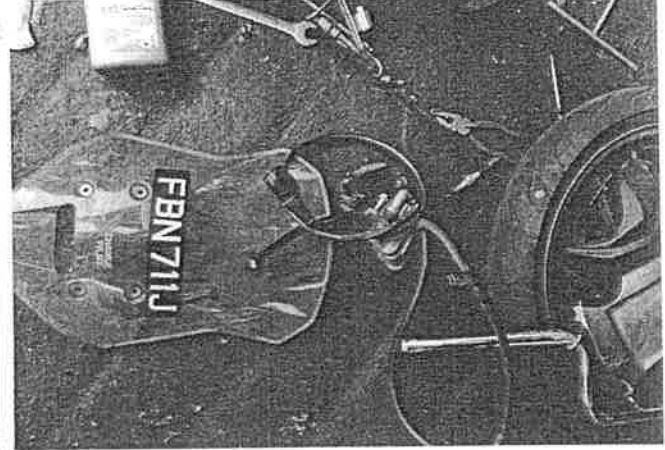
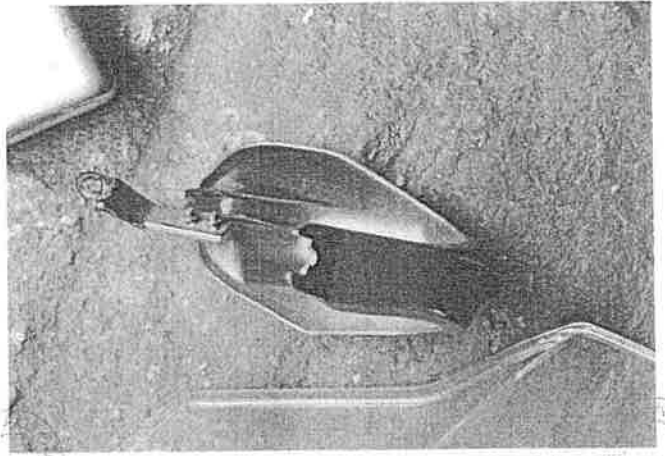


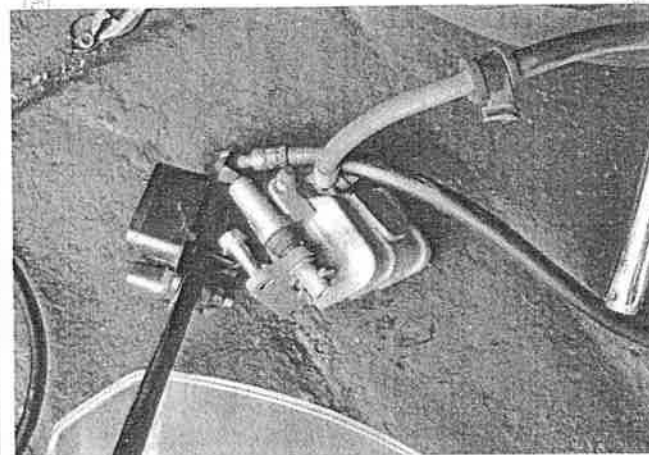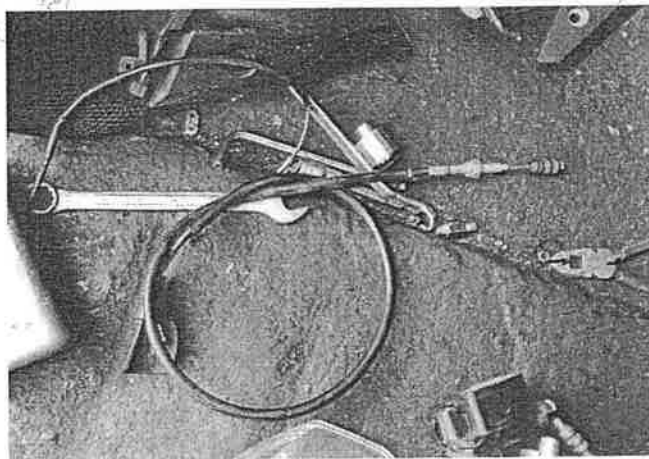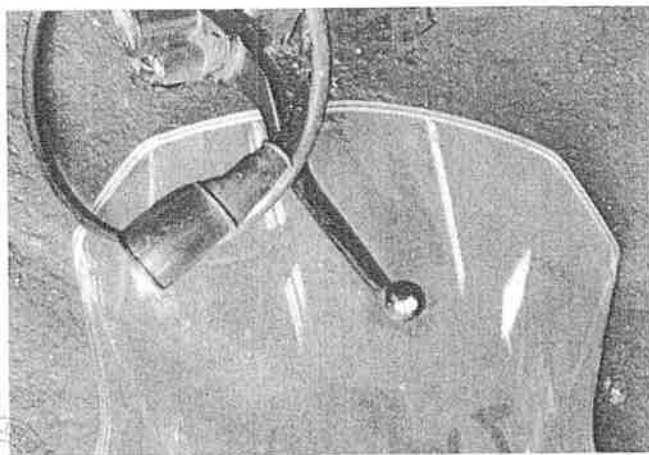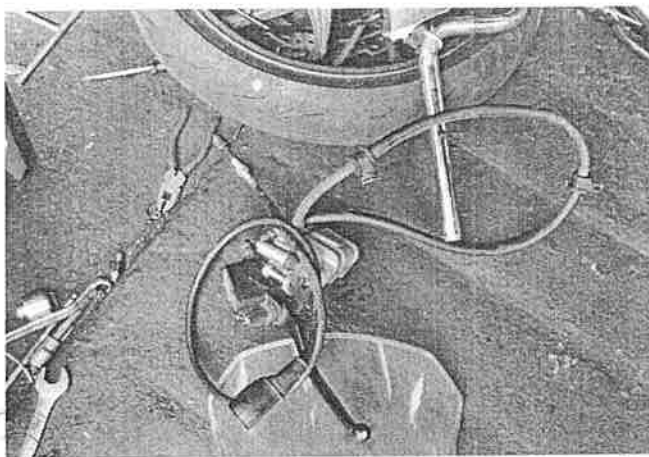


RECEIVED

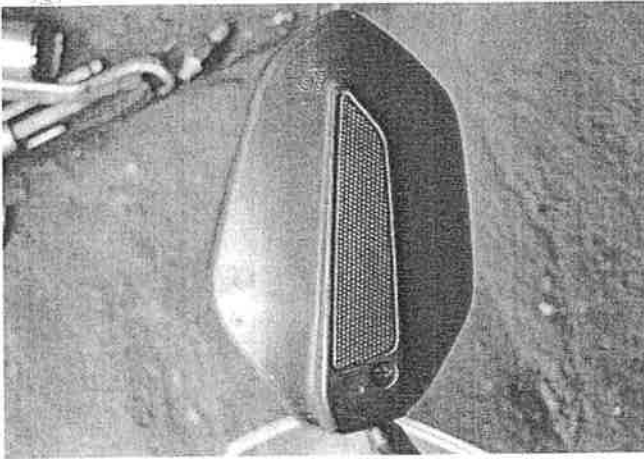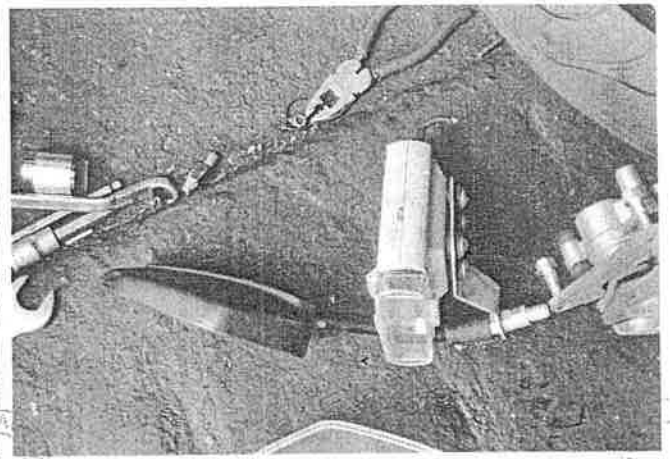
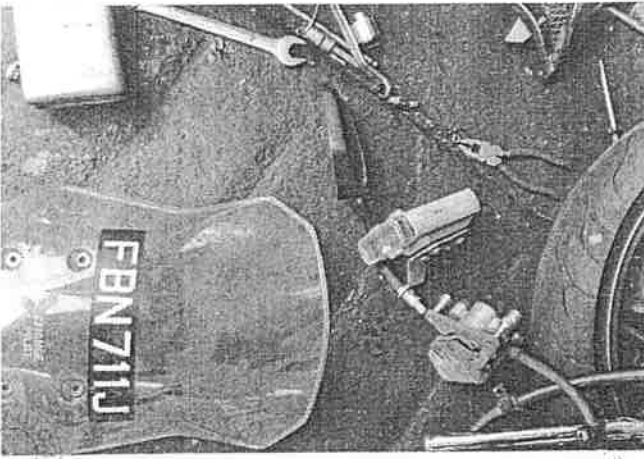


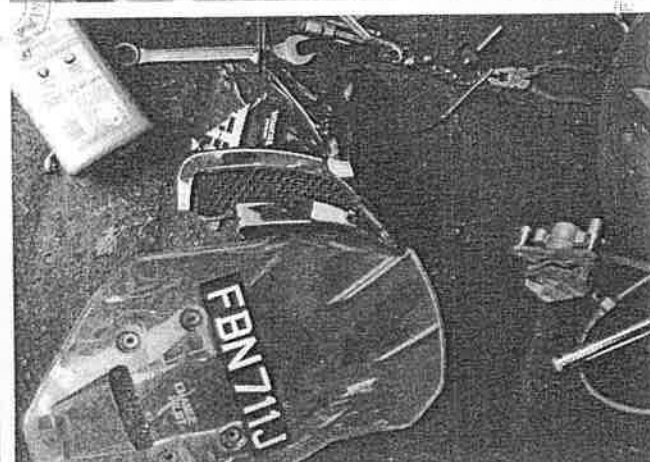
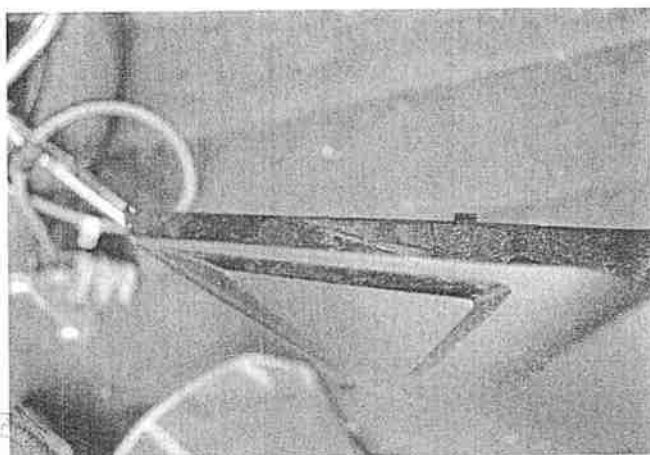



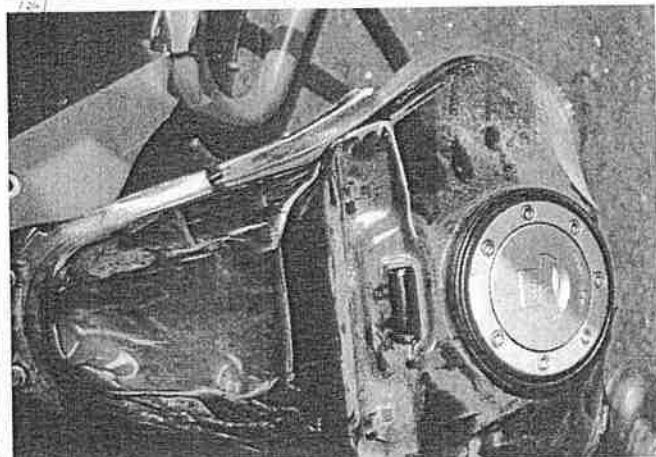
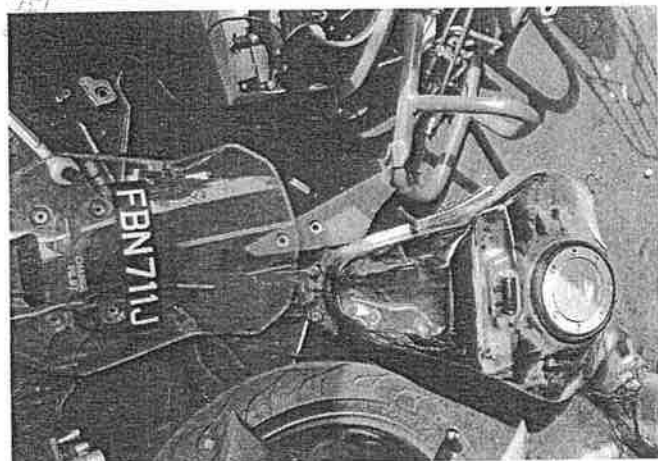
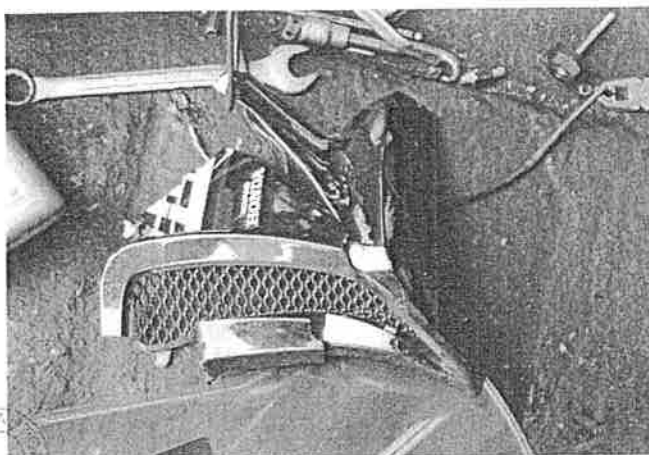




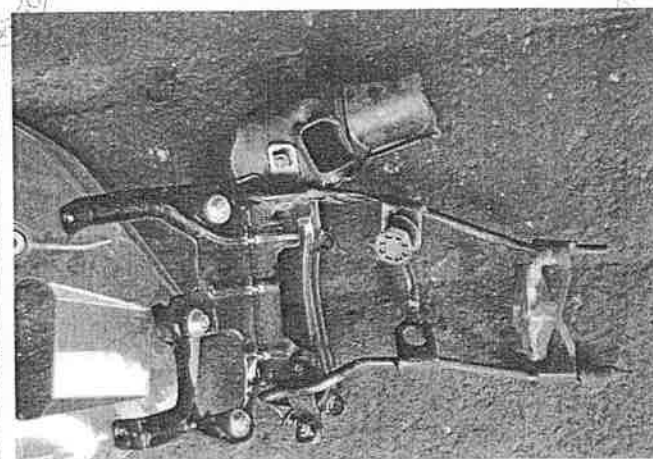



AKA
AUTOMAT

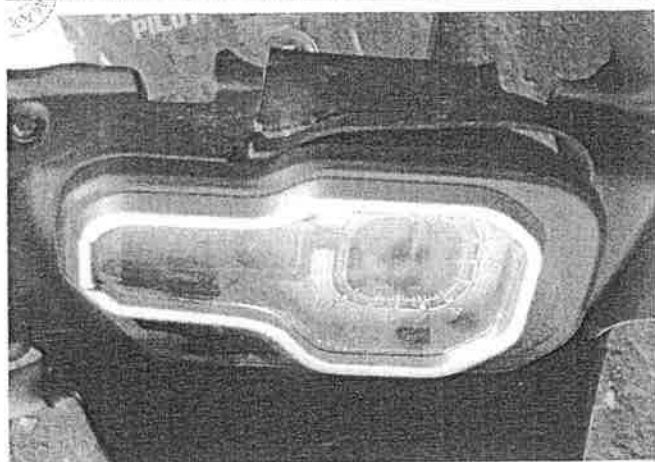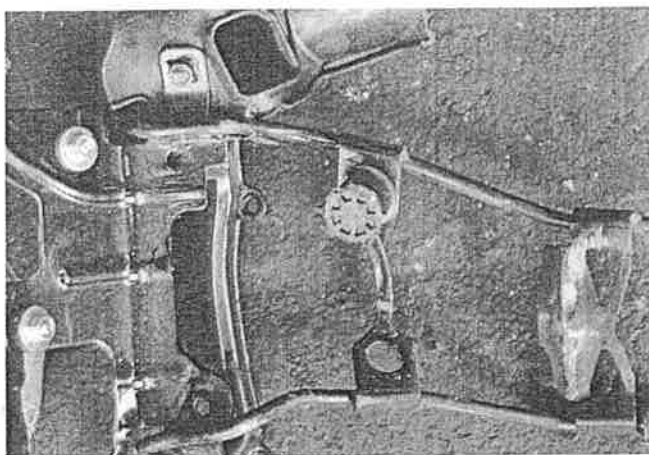


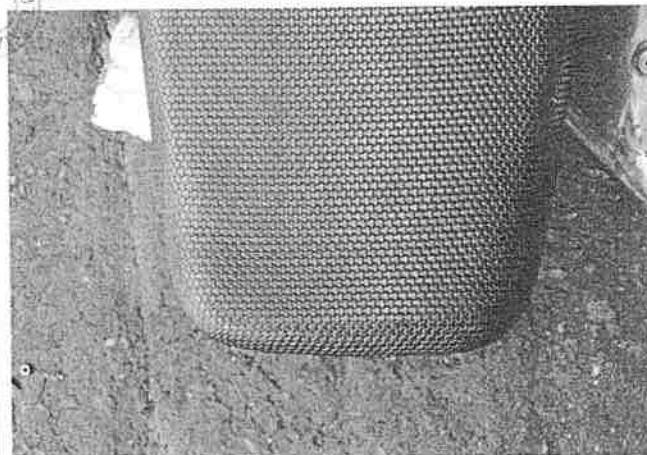
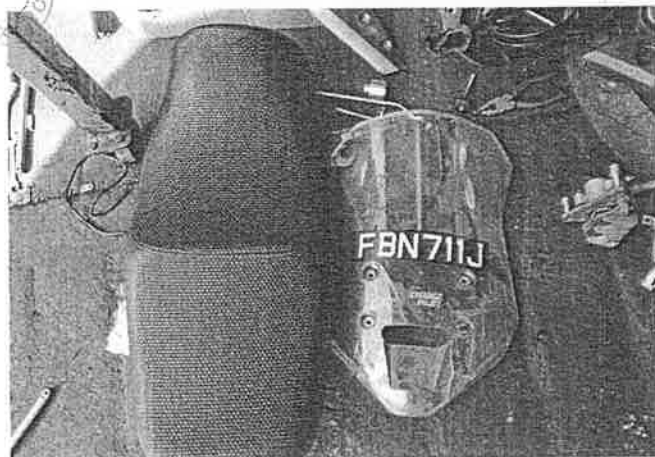


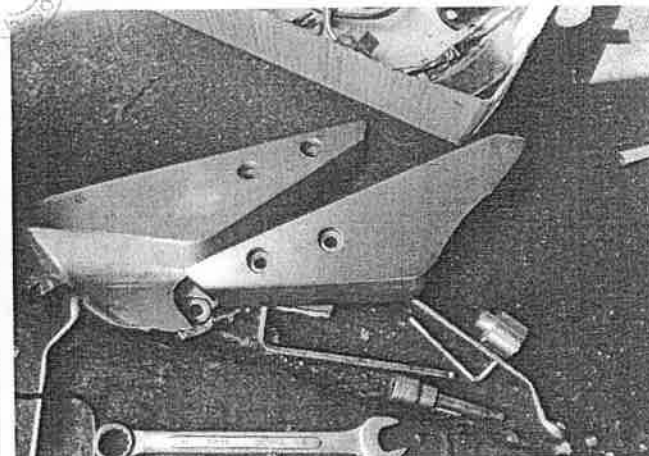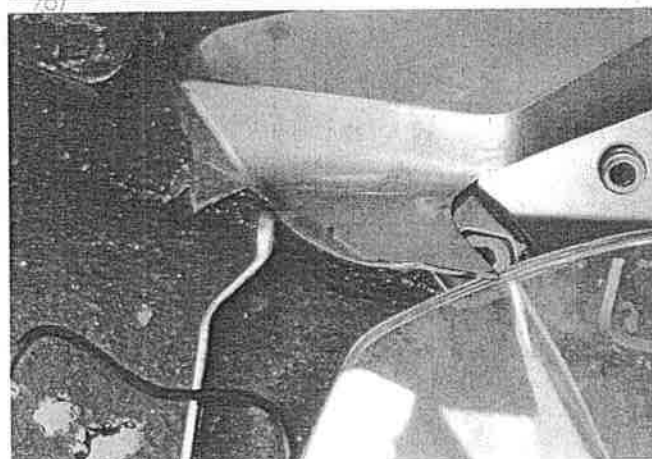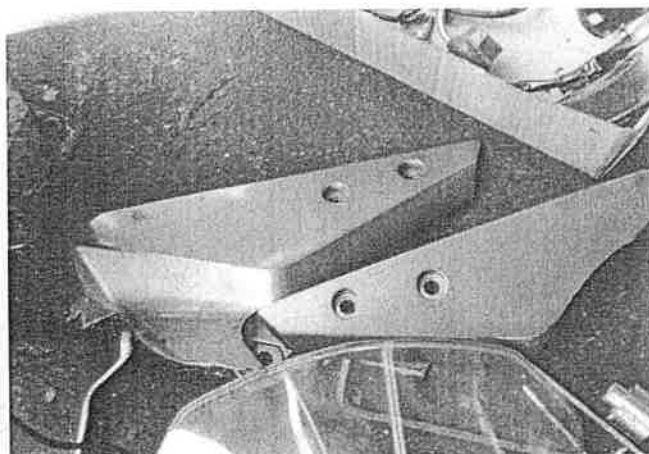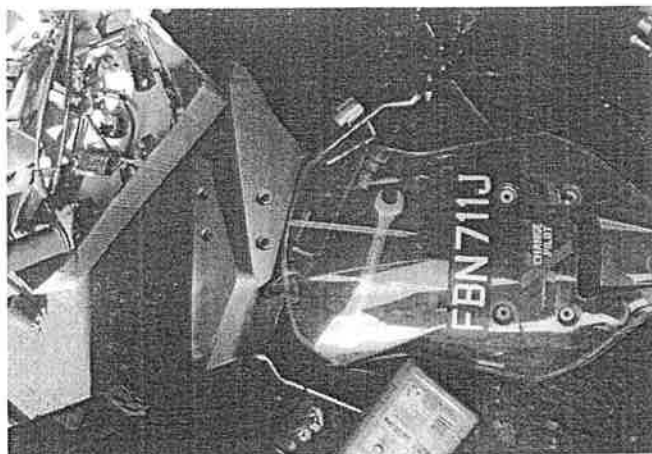

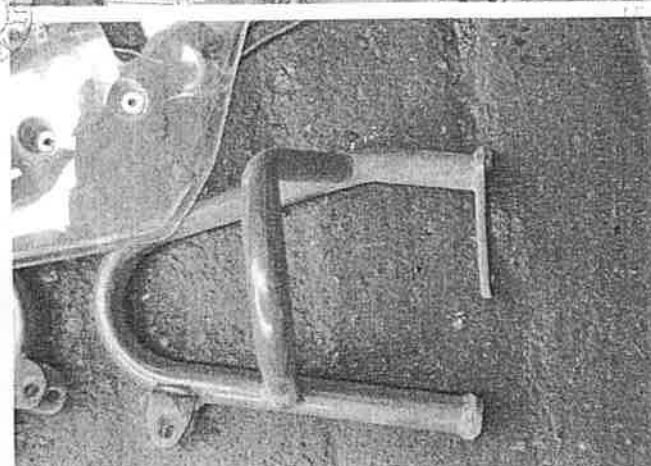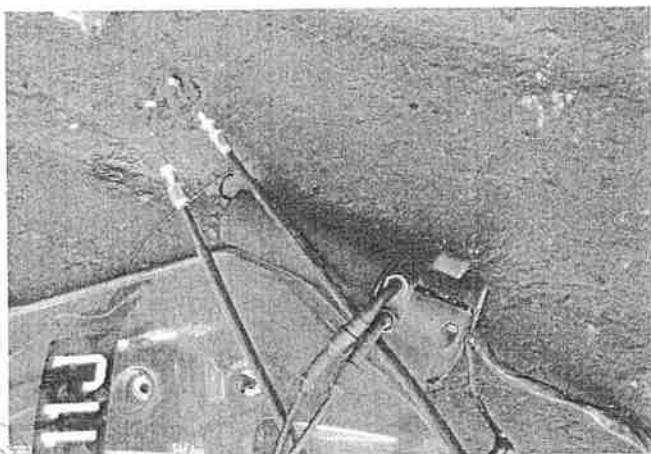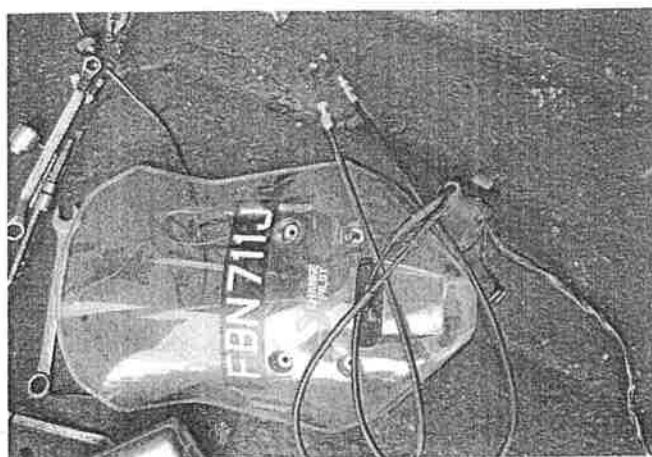

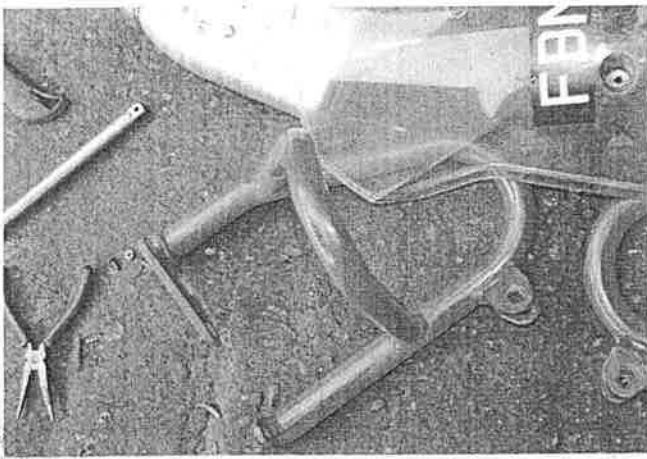

10/01/01

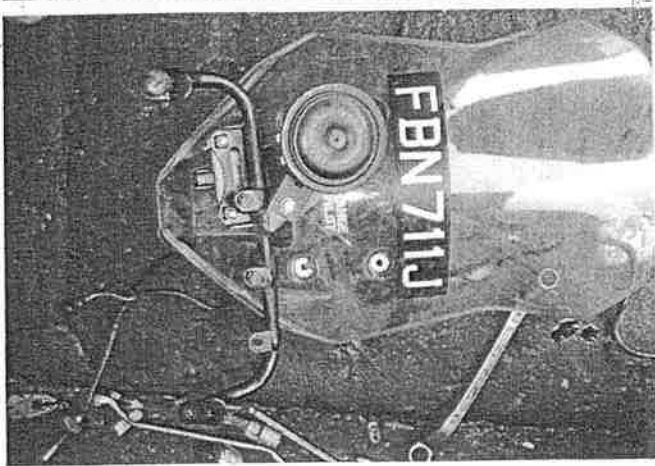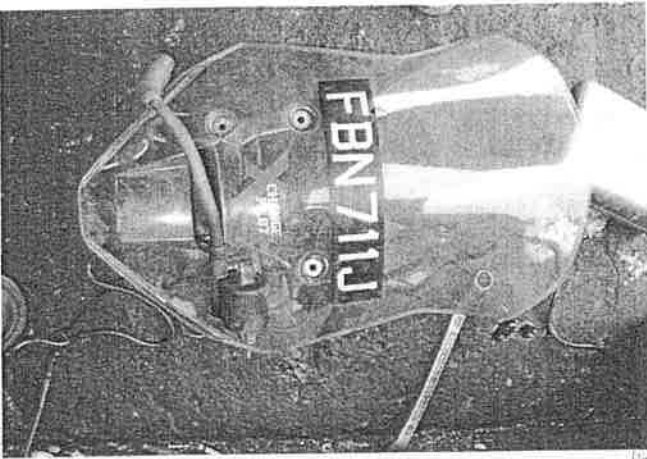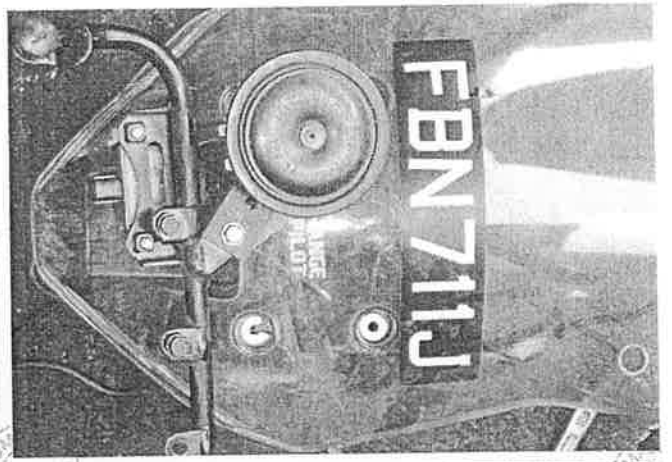

APR 1971

