

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22005055/VVY3Q2**Date:** 25/08/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00199282102	
Claimant Vehicle No :	SGN9339H	Insured Vehicle No :	SLF37X	
Date of Loss:	25/05/2022	Nature of Claim:	TP	Claim No: SNM22D203699/C02/TANCHC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SGN9339H		Engine No:	3ZZ4808453
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 (A)		Chassis No:	MR053ZEE106123289
Reg. Date:	16/12/2008 (Man. Year: 2008)		Odometer:	150625 km
Colour:	Beige			
Engine Capacity:	1598 cc			
Market Value/New Car Price:	N/A			
Sum Insured (\$\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	412.50	412.50	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	500.00	400.00	100.00	20.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	912.50	812.50	100.00	10.96
Approved Total (Overridden) (\$\$)		650.00		
(\$\$)	912.50	650.00	262.50	28.77
+ GST 7.00/7.00% (\$\$)	63.88	45.50	18.38	28.77
Nett Amount (\$\$)	976.38	695.50	280.88	28.77

INSPECTION

Date of Assignment:	30/05/2022	
Date Inspected:	31/05/2022	Inspected At: Success United Pte Ltd (HQ) 2 Kaki Bukit Ave 2 #01-33, Kaki Bukit AutoHub Singapore 417921
Estimated Period of Repair:	3.0 days	

Adjuster: Thevan Thomas Karthikesavan**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 24 Aug 2022)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SGN9339H)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT WING MIRROR ASSY LH	Cracked	550.00 FL	*550.00 FL
						F=Franchise part. L=ListItemDisc.
					Sub Total (S\$)	550.00 550.00
					- List Item Discount on L Items 25.00/25.00% (S\$)	137.50 137.50
					Total Parts (S\$)	412.50 412.50

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR TO REPAIR BODYWORKS AND CHARGE PARTS AND RESPRAY PAINTING ON FRONT DOOR LH & FRONT MIRROR LH	New	500.00	400.00
Gross Labour Cost (\$)			500.00	400.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >