

(Registration No.: 53429875C)

Address: 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874 Contact: +65-8788-5345 | Email Address: admin@ty5group.com.sg

Our Services: Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation

Reference : TY5/TA/10088/3565/TP/04.22

Date : 20 April 2022 Vehicle no : GBF 3565L

To: Leong Chai Kee Food Manufacturer Pte Ltd c/o 2 Kaki Bukit Ave 2 #01-36, Kaki Bukit Autohub Singapore 417921

INVOICE

PARTICULARS AMOUNT

Registration No.

 $; \;\; \mathbf{GBF}\,3565\mathbf{L}$

Date of accident

: 02 April 2022 : Nissan Cabstar 3.0 5MT Euro5

Make / Model Invoice No.

: 10088

Being work done and services rendered as follows:

✓ Inspection of Vehicle

✓ Re-Inspection

✓ Appraisal Report

SGD 987.00

√ 92 Colored Photographs

✓ Transport Charges

TOTAL

SGD 987.00

Dollars:

Nine Hundred and Eighty-Seven Only

(Cheque should be crossed and make payable to * TY5 CONSULTANCY *)

TY5 CONSULTANCY



(Registration No.: 53429875C)

Address: 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874
Contact: +65 8788 5345 | Email Address: admin@ty5group.com.sg

Our Services: Automotive Surveying | Vehicle Valuation

Motor Claims Investigation | Evaluation & Consultation

Reference : TY5/TA/10088/3565/TP/04.22

Date : 20 April 2022 Vehicle no : GBF 3565L

To: Leong Chai Kee Food Manufacturer Pte Ltd c/o 2 Kaki Bukit Ave 2 #01-36, Kaki Bukit Autohub Singapore 417921

VEHICLE INSPECTION REPORT

Name of Workshop : Sheng Li Lai

Place of inspection : 2 Kaki Bukit Ave 2 #01-36, Kaki Bukit Autohub, Singapore 417921

Date of Accident : 02 April 2022 Date of Inspection : 05 April 2022

VHICLE PARTICULAR

Registration No.	;	GBF 3565	L,	Chassis Frame No.	:	JN1SC2F24Z0858935
Make / Model	;	Nissan	Cabstar 3.0 5MT Euro5	Engine No.	:	ZD30013949N
Year of Registration	:	2016		Odometer Reading	:	308,414 KM
Class / Tyne	•	Lorry		Colour	:	Blue

VEHICLE CONDITION

General Condition	;	Good	Steering	:	Serviceable
Paintwork	:	Good	Foot/ Parking Brake	:	Serviceable

TYRE CONDITION

		Size	Thread Balance
Front L/H	:	LAUFENN 195 R15C	7mm
Front R/H	:	LAUFENN 195 R15C	7mm
Rear I/H	:	LAUFENN 195 R15C	7mm
Rear R/H	:	LAUFENN 195 RI5C	7mm

^{*} The above is an estimate of the remaining life of the tyre thread in percentages

COST OF REPAIR

TY5 Recommendation

	1	Repairer 88	Α	aguster 55	Lump Sum Repair :			
Parts	8	20,565.20	8	19,843.64	\$	19,000,00		
Labour	\$	4,680.00	\$	3,910.00	Ф	19,000.00		
	8	25,245.20	8	23,753.64	Estimate	ed Repair Duration		

12

working days (excluding Sat, Sun & Public Holidays)

NOTE: The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited.



(Registration No.: 53429875C)

Address: 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874 Contact: ±65 8788 5345 | Email Address: admin@ty5group.com.sg

Our Services : Automotive Surveying | Vehicle Valuation Motor Claims Investigation | Evaluation & Consultation

Reference

: TY5/TA/10088/3565/TP/04.22

Date

20 April 2022

Vehicle no

: GBF 3565L

ASSESSMENT SCHEDULE

<u>SN</u>	Qty	<u>Descriptions</u>	Conditions	Repairer's Estimate		Surveyor's Revised	
		LIST ITEMS:-					
l	1 pc	rear spare tyre carrier	buckled	\$ 152.40	8	152.40	
2	1 pc	rear no. plate bracket	buckled	\$ 46,50	\$	46,50	
3	I pe	I/h taillamp	broken	\$ 248.60	s	248.60	
4	I pc	r/h taillamp	cracked	\$ 248.60	\$	248.60	
$\tilde{\sigma}$	I pc	egr pipe	bent	\$ 427.10	\$	427.10	
6	$2~\mathrm{pcs}$	rear exhaust support bracket @\$\$72.00	necessary	\$ 144.00	\$	144.00	
7	$1~{ m pc}$	rear exhaust	bent	\$ 511.00	S	511.00	
8	l pc	rear exhaust mid pipe	bent	\$ 427.00	\$	427.00	
				\$ 2,205.20	\$	2,205.20	
		Less 30%		 	\$	661.56	
				\$ 2,205.20	\$	1,543.64	
		SPECIAL NETT ITEMS:-					
9	l set	reverse sensor	broken	\$ 300,00	\$	250,00	
10	1 pc	rear no. plate	buckled	\$ 60,00	8	50,00	
11	1 pc	rear box truck	damaged	\$ 18,000,00	\$	18,000.00	
				\$ 18,360.00	\$	18,300.00	

Total	\$ 20,565,20	\$ 19,843.64



(Registration No.: 53429875C)

Address: 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874 Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services: Automotive Surveying | Vehicle Valuation Motor Claims Investigation | Evaluation & Consultation

Reference

TY5/TA/10088/3565/TP/04.22

Date

20 April 2022

Vehicle no

 $\mathbf{GBF\,3565L}$

ASSESSMENT SCHEDULE

<u>sn</u>	Qty	Descriptions	Conditions	Repairer's Estimate		Surveyor's Revised	
		B/F		\$	20,565,20	\$	19,843.64
12		To panel beat and renewal of all necessary damaged body parts		\$	2,800.00	\$	2,400.00
13		To check wiring and rewire		\$	60.00	\$	50,00
14		To remove and reinstall rear exhaust pipe		\$	120.00	\$	00,001
15		To remove and reinstall reverse sensor		\$	140.00	\$	100.00
16		To straighten both chassis member		\$	480.00	\$	400.00
17		To apply anti-rust		\$	80.00	s	60,00
18		To putty and spray-paint of affected areas		\$	1,000.00	\$	800.00
				\$	4,680.00	\$	3,910.00



(Registration No.: 53429875C)

Address: 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact: +65-8788-5345 | Email Address: admin@ty5group.com.sg

Our Services: Automotive Surveying | Vehicle Valuation Motor Claims Investigation | Evaluation & Consultation

Reference : TY5/TA/10088/3565/TP/04.22

Date : 20 April 2022 Vehicle no : GBF 3565L

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact of the collision was delivered Squarely to the Rear portion of the vehicle.





(Please refer to the list and survey photographs as attached for more information)

ASSESSMENT RECOMMENDATIONS

COST OF REPAIR

 Repairer S\$
 Adjuster S\$

 Parts
 \$ 20,565.20
 \$ 19,843.64

 Labour
 \$ 4,680.00
 \$ 3,910.00

 \$ 25,245.20
 \$ 23,753.64

TY5 Recommendation

Estimated Repair Duration:

Contract Lump Sum of \$

12 working days

19,000.00

(excluding Sat, Sun & Public Holidays)

Enclosed No. Of Photograph: 9

(at the time of static inspection)

Our attached assessment schedule has been checked throughly by us against the actual damages sustained on the vehicle, and we recommend the replacement of parts and repair accordingly. We have adjusted the cost and the repairer has agreed to undertake the repair at the recommended sum to a acceptable quality and standards. We have not given authorization and instruction to the repairer to proceed with the repairs.

The survey was done on a Without Prejudice Basis and we are reverting the matter to you for a decision.

We thank you for engaging our services and we enclosed herewith our invoice no.

10088

TY5 CONSULTANCY

TERRENCE HONG
AUTOMOTIVE SURVEYOR

NOTE: This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company via email only and follow up with a phone call, within Fourteen (14) days from the date hereof. Otherwise this revised amount shall be treated as valid.













