



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBF 6891A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	HANDLE BAR UPPER COVER - FRONT	NOT NECESSARY	98.50	-
1	HANDLE BAR UPPER COVER - REAR	NOT NECESSARY	83.60	-
1	HANDLE BAR	BENT	105.00	105.00
1	HANDLE BAR BRACKET	DISTORTED	65.00	65.00
1	SET HANDLE GRIP	NOT NECESSARY	60.00	-
1	SET BALANCER	CUT	50.00	50.00
1	CLUTCH LEVER	NOT NECESSARY	35.30	-
1	SET MIRROR	GRAZED	110.00	60.00
1	FRONT COWLING	NOT NECESSARY	145.00	-
1	HEAD LAMP ASSY	NOT NECESSARY	130.00	-
2	FRONT SIDE SHIELD @\$103.00	O/S HDR CRACKED	206.00	103.00
1	MIDDLE FRAME COVER	NOT NECESSARY	150.00	-
1	CRANKCASE COVER LH	CRACKED	165.80	165.80
2	FRONT FORK ASSY @\$420.00	NOT NECESSARY	840.00	-
1	UNDER BRACKET	NOT NECESSARY	160.00	-
1	FRONT RIM	NOT NECESSARY	320.00	-
1	FRONT DISC PLATE	SERVICEABLE	135.00	-
1	FRONT FOOTREST BAR	BENT	90.00	90.00
1	GEAR PEDAL	NOT NECESSARY	65.00	-
1	TAIL COVER (RH)	CUT	120.00	120.00
	LESS 10% DISCOUNT		-313.42	-75.88
			2,820.78	682.92
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET STEERING CONE / BEARING (SN)	NECESSARY	120.00	60.00
1	CRANKCASE GASKET (SN)	NECESSARY	25.00	25.00
3	LITS ENGINE OIL (SN)	NECESSARY	60.00	30.00
1	CENTRAL BASKET (SN)	NOT NECESSARY	50.00	-
1	SET STICKER (SN)	NECESSARY	160.00	120.00
			415.00	235.00

Report Ref No. CS3/SMR21011558/Evy3e2-1



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>LABOUR</u></b>			
	FRONT MUDGUARD REPAIR (PAINT).		80.00	60.00
	BODY FRAME REPAIR.		550.00	200.00
	RENEW & REPAIR ACCIDENT PARTS.		500.00	200.00
			1,130.00	460.00
	<b>GRAND TOTAL</b>		<b>4,365.78</b>	<b>1,377.92</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>1,100.00</b>

Report Ref No. CS3/SMR21011558/Evy3e2-1

CHEN TSUE YEE

Automotive Assessor

ANG BRYAN TANI

Automotive Assessor / Investigator

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.