

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22005415/TNY3Q2**Date:** 16/09/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00142262100
Claimant Vehicle No :	FBQ8134G	Insured Vehicle No :	SJG256Z
Date of Loss:	31/05/2022	Nature of Claim:	TP
		Claim No:	SNM22D203931/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBQ8134G	Engine No:	G3E6E0484411
Make & Model:	YAMAHA SNIPER T150, 150cc	Chassis No:	MH3UG0740K0152637
Reg. Date:	19/12/2019 (Man. Year: 2019)	Odometer:	0 km
Colour:	Green		
Engine Capacity:	150 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	70/90 R17	Rear Tyre Size:	70/90 R17
Front Left Side:	Maxxis 5 mm	Rear Left Side:	Maxxis 5 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,698.70	4,320.20	378.50	8.06
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,750.00	700.00	1,050.00	60.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	6,448.70	5,020.20	1,428.50	22.15
Approved Total (Overridden) (S\$)		4,000.00		
(S\$)	6,448.70	4,000.00	2,448.70	37.97
+ GST 7.00/7.00% (S\$)	451.41	280.00	171.41	37.97
Nett Amount (S\$)	6,900.11	4,280.00	2,620.11	37.97

INSPECTION

Date of Assignment:	08/06/2022	
Date Inspected:	08/06/2022	Inspected At: Bike Production (HQ) No 610 Serangoon Road Singapore 218216
Estimated Period of Repair:	3.0 days	

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 15 Sep 2022)	
Parts:	N/A	YAMAHA SNIPER T150 150cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBQ8134G)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT DISK	Not Necessary	115.00 FL	*- FL
2	1		*FRONT WHEEL AXLE	Bent	75.00 FL	*75.00 FL
3	1		*RIGHT FORK ASSEMBLY	Bent	380.00 FL	*280.00 FL
4	1		*LEFT FORK ASSEMBLY	Bent	380.00 FL	*280.00 FL
5	1		*FRONT HEADLAMP LOWER COVER	Cracked	105.00 FL	*105.00 FL
6	1		*HEADLAMP LOWER ASSY	Cut	250.00 FL	*250.00 FL
7	1		*FRONT MUDGUARD	Cut	85.00 FL	*85.00 FL
8	2		*STEERING STEM BEARING	Necessary	90.00 FL	*90.00 FL
9	1		*STEERING STEM BRACKET ASSEMBLY	Bent	195.00 FL	*195.00 FL
10	1		*GEAR PEDAL ASSEMBLY	Bent	105.00 FL	*105.00 FL
11	1		*LEFT FRONT FOOTREST	Bent	65.00 FL	*65.00 FL
12	1		*LEFT FRONT SIGNAL	Cut	75.00 FL	*75.00 FL
13	1		*HANDLE BAR	Bent	125.00 FL	*125.00 FL
14	1		*RIGHT FAIRING	Cut	105.00 FL	*105.00 FL
15	1		*LEFT FAIRING	Deformed	105.00 FL	*105.00 FL
16	2		*FAIRING STICKERS	Necessary	110.00 FL	*110.00 FL
17	1		*RIGHT FRONT SIGNAL	Cut	75.00 FL	*75.00 FL
18	1		*BRAKE PEDAL ASSY	Dented	75.00 FL	*75.00 FL
19	1		*FRONT BLACK COVER BACK	Cut	125.00 FL	*125.00 FL
20	1		*FRONT FOOTREST HOLDER ASSEMBLY	Bent	145.00 FL	*145.00 FL
21	1		*BRAKE LEVER	Cut	45.00 FL	*45.00 FL
22	1		*RIGHT BALANCER	Missing	45.00 FL	*45.00 FL
23	1		*FRONT COVER LABELS	Necessary	35.00 FL	*35.00 FL
24	1		*TOP HEAD COVER	Cut	75.00 FL	*75.00 FL
25	1		*FRONT BRAKE PUMP ASSEMBLY	Cut	145.00 FL	*145.00 FL
26	1		*FRONT HEAD INNER BLACK COVER	Deformed	125.00 FL	*125.00 FL
27	1		*RIGHT REAR SIDE COVER	Cracked	105.00 FL	*105.00 FL
28	1		*RIGHT REAR SIDE COVER STICKER	Necessary	45.00 FL	*45.00 FL
29	1		*RIGHT FRONT FOOT REST	Dented	65.00 FL	*65.00 FL
30	1		*RIGHT REAR FOOTREST	Dented	45.00 FL	*45.00 FL
31	1		*RIGHT HAND GRIP	Cut	45.00 FL	*45.00 FL
32	1		*RIGHT VIEW MIRROR	Cut	55.00 FL	*55.00 FL
33	1		*EXHAUST ASSEMBLY	Dented	485.00 FL	*485.00 FL
34	1		*EXHAUST ROUND COVER	Cut	75.00 FL	*75.00 FL
35	1		*EXHAUST LONG COVER	Cut	45.00 FL	*45.00 FL
36	1		*FRONT NUMBER PLATE	Necessary	20.00 FS	*20.00 FS
37	1		*TOP BOX	Cut	195.00 FS	*150.00 FS
38	1		*FRONT SPORT RIM ASSY	Cut	350.00 FS	*300.00 FS
39	1		*LEFT LOWER BLACK COVER	Cracked	95.00 FL	*95.00 FL
40	1		*RIGHT LOWER BLACK COVER	Cracked	95.00 FL	*95.00 FL
41	1		*H COVER	Deformed	85.00 FL	*85.00 FL
42	1		*HEADLAMP BRACKET	Bent	98.00 FL	*98.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	5,158.00	4,748.00
- List Item Discount on L Items 10.00/10.00% (\$\$)	459.30	427.80

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
					Total Parts (S\$)	4,698.70
						4,320.20
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOWING CHARGES	New	100.00	100.00
2	DISMANTLE ,REPLACE REALIGN AND ADJUST ABOVE DAMAGED PARTS	New	700.00	300.00
3	TO KNOCK ,STRAIGHTEN CHASSIS & BODY BALANCING	New	380.00	0.00
4	TO REMOVE/REFIT ,REPLACE (IF DAMAGE) CHECK AND STRAIGHTEN FRONT FORK TUBES	New	180.00	120.00
5	TO REMOVE/REFIT AND BALANCE FRONT SPORT RIM	New	90.00	30.00
6	SPRAY PAINTING	New	300.00	150.00
Gross Labour Cost (S\$)			1,750.00	700.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >