

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22005704/ENCQ2**Date:** 11/10/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNA00155332100
Claimant Vehicle No :	PC9333A	Insured Vehicle No :	YM7600H
Date of Loss:	13/06/2022	Nature of Claim:	TP
		Claim No:	SNM22D204149/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	PC9333A	Engine No:	6HK1686236
Make & Model:	ISUZU LT434P 7.8 SMT, 7.8 D (M)	Chassis No:	JALLT434PG7000100
Reg. Date:	09/06/2017 (Man. Year: 2016)	Odometer:	110095 km
Colour:	Multi-colour		
Engine Capacity:	7790 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	295/80 R22.5	Rear Tyre Size:	295/80 R22.5
Front Left Side:	Dunlop 4 mm	Rear Left Side:	Dunlop 4 mm
Front Right Side:	Dunlop 4 mm	Rear Right Side:	Dunlop 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	10,046.00	8,691.00	1,355.00	13.49
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,850.00	1,530.00	320.00	17.30
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	11,896.00	10,221.00	1,675.00	14.08
Approved Total (Overridden) (S\$)		8,200.00		
(S\$)	11,896.00	8,200.00	3,696.00	31.07
+ GST 7.00/7.00% (S\$)	832.72	574.00	258.72	31.07
Nett Amount (S\$)	12,728.72	8,774.00	3,954.72	31.07

INSPECTION

Date of Assignment:	21/06/2022	
Date Inspected:	16/06/2022	Inspected At: Connect3 (woodlands) (HQ) 566 Woodlands Road Singapore 728697
Estimated Period of Repair:	4.0 days	

Adjuster: CHEN TSUE YEE**Manager:** HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 11 Oct 2022)	
Parts:	N/A	ISUZU LT434P 7.8 SMT 7.8 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for PC9333A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT RH REAR VIEW MIRROR ASSY (FULL SET)	Broken	2,250.00 F	*2,250.00 FL
2	1		*FRONT WINDSCREEN	Cut	6,800.00 F	*6,300.00 FL
3	1		*FRONT WINDSCREEN INNER SEAL	Necessary	650.00 FS	*650.00 FS
4	8		*SEALANT	Necessary	320.00 FS	*320.00 FS
5	1		*ERP BRACKET	Necessary	26.00 FS	*26.00 FS
						F=Franchise part. S=SpcNett. L=ListItemDisc.
Sub Total (S\$)					10,046.00	9,546.00
- List Item Discount on L Items 0.00/10.00% (S\$)					0.00	855.00
Total Parts (S\$)					10,046.00	8,691.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR TO REMOVE & REFIT FRONT WINDSCREEN	New	1,000.00	900.00
2	CHECK WIRING	New	50.00	30.00
3	LABOUR CHARGES	New	400.00	300.00
4	SPRAY PAINTING WITH PEARL PAINT	New	400.00	300.00
Gross Labour Cost (\$\$)			1,850.00	1,530.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >