

PAR Automotive Consultancy

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Regn. No: 52986974L

P48-112592

30

Report No: 0022-20-PM

16 January 2020

Chua Hui Xin
53 Lorong 40 Geylang #04-10
Singapore 398077

INVOICE No. 0022-20-PM

Vehicle No. SJZ1200C

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$761.00
Total amount payable		\$761.00

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy



Report No: 0022-20-PM

16 January 2020

ACCIDENT VEHICLE SURVEY REPORT

Chua Hui Xin
53 Lorong 40 Geylang #04-10
Singapore 398077

VEHICLE INFORMATION:

Vehicle Reg No.:	SJZ1200C	Odometer:	109705km
Make & Model:	BMW 730Li	Colour:	White
Chassis number:	WBAHN22010De96707	Date of accident:	31/12/2019
Year of Regn.:	26/04/2006	Date inspected:	08/01/2020
Repairer at:	Precision Motorworks	Date inspected (After Repair):	15/01/2020
	68 Kaki Bukit Ave 6 ARK @ KB #01-02		
	Singapore 417896		

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	5mm/Pirelli	5mm/Pirelli	245/40ZR20
Rear:	5mm/Pirelli	5mm/Pirelli	275/35R20

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the front LH portion.

Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

Report No: 0022-20-PM

Vehicle No: SJZ1200C

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment
Front bumper fascia	1	squashed	1,500.00	1,500.00
Front bumper reinforcement	1	bent	771.13	771.13
Front bumper side retainer LH	1	necessary	90.00	90.00
Front bumper bracket LH	1	bent	95.00	95.00
Front bumper protector LH	1	abraded	160.00	160.00
Front bumper protector chrome	1	deformed	95.00	95.00
Front bumper clip	10	necessary	30.00	30.00
Front bumper centre air grille	1	warped	125.00	125.00
Front bumper headlamp nozzle	1	fractured	145.00	145.00
Front bumper headlamp nozzle cover	1	ripped	70.00	70.00
Front bumper sponge	1	fractured	120.00	120.00
Front fog lamp LH	1	fractured	280.00	280.00
Front fog lamp cover LH	1	warped	75.00	75.00
Front headlamp LH	1	fractured	2,400.00	2,400.00
Bonnet	1	repair	2,861.00	0.00
Bonnet logo "BMW"	1	necessary	58.85	58.85
Rear number plate garnish	1	fractured	75.00	75.00
<i>Subtotal before discount</i>			8,950.98	6,089.98
<i>Percentage discount</i>	0%	<i>and</i> 0%	0.00	0.00
Sub-total 1			8,950.98	6,089.98
Front bumper parking sensor	2	shorted	760.00	760.00
Front number plate	1	bent	45.00	40.00
<i>Subtotal before discount</i>			805.00	800.00
<i>Percentage discount</i>	0%	<i>and</i> 0%	0.00	0.00
Sub-total 2			805.00	800.00
Parts-total			9,755.98	6,889.98
LABOUR				
1. To straighten and panel beating bonnet, front support panel, front fender LH and front LH frame members. To remove and refit above parts.			1,200.00	660.00
2. To putty, re-spray painting and polish affected areas.			1,200.00	880.00
3. To check and rectify wiring system.			80.00	40.00
4. To analysis and reset electrical module system.			380.00	380.00
Labour total			2,860.00	1,960.00
Parts & Labour total			12,615.98	8,849.98

PAR Automotive Consultancy

33

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is :
and the recommended number of working days for the repairs is :

\$7,000.00

6



B J Loi (I Eng. MIMI, AIRTE)

Automotive Appraiser