

LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 1198D

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT WINDSCREEN GLASS WITH SENSOR	CUT	2,340.70	2,340.70
1	FRONT N/S WINDSCREEN PILLAR	BENT	957.90	826.70
1	FRONT N/S WINDSCREEN MOULDING	NECESSARY	117.50	117.50
1	FRONT BUMPER - COLOUR CODE	TO REPAIR SEE LABOUR	1,150.70	-
1	FRONT N/S FENDER	TO REPAIR SEE LABOUR	550.90	-
1	FRONT N/S FENDER EMBLEM	NECESSARY	65.10	65.10
1	FRONT N/S DOOR ASSY	BENT	1,355.60	950.00
2	FRONT N/S DOOR HINGE @\$95.10	TO REPAIR SEE LABOUR	190.20	-
1	FRONT N/S DOOR WEATHERSTRIP	SERVICEABLE	205.10	-
1	FRONT N/S DOOR FRAME BLACK STICKER	NECESSARY	75.10	75.10
1	FRONT N/S DOOR INNER TRIM BOARD	MTG CRACKED	550.60	550.60
1	FRONT N/S DOOR INNER LOCK	TO REPAIR SEE LABOUR	255.60	-
1	FRONT N/S DOOR GLASS REGULATOR MOTOR	SERVICEABLE	420.00	-
1	FRONT N/S DOOR PILLAR WEATHERSTRIP	SERVICEABLE	225.70	-
1	FRONT N/S DOOR VIEW MIRROR	CRACKED	873.60	873.60
1	FRONT N/S DOOR VIEW MIRROR OUTER COVER	CRACKED	75.10	75.10
1	REAR N/S SLIDING DOOR ASSY	BENT	1,507.10	1,205.00
1	REAR N/S SLIDING DOOR WEATHERSTRIP WITH AUTO SENSOR WIRE SOCKET	CUT / SHORTED	624.70	624.70
1	REAR N/S DOOR INNER TRIM BOARD	SERVICEABLE	520.50	-
1	REAR N/S DOOR GLASS REGULATOR MOTOR	SERVICEABLE	420.00	-
1	REAR N/S DOOR FRAME BLACK STICKER	NECESSARY	75.10	75.10
1	REAR N/S SLIDING DOOR GLASS FRAME GARNISH	DENTED / CUT	145.60	145.60
1	REAR N/S DOOR INNER LOCK	TO REPAIR SEE LABOUR	287.50	-
1	REAR N/S DOOR PILLAR WEATHERSTRIP	SERVICEABLE	245.60	-
1	REAR N/S FENDER GLASS	CUT	355.70	355.70
1	REAR BUMPER - COLOUR CODE	MTG CRACKED	1,196.50	943.50
1	REAR N/S BUMPER SIDE RETAINER	SERVICEABLE	55.70	-

Report Ref No. CS/SPF22005820/Kvy3m4



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	N/S ROCKER PANEL	BENT	655.70	489.00
1	REAR N/S SHOCK ABSORBER	SERVICEABLE	387.50	-
1	REAR AXLE	SERVICEABLE	1,623.20	-
1	REAR N/S HUB	SERVICEABLE	399.80	-
	LESS 20% DISCOUNT		-3,581.92	-1,942.60
			14,327.68	7,770.40
	SPECIAL NETT ITEMS			
1	REAR N/S TYRE RIM (SN)	DENTED	480.00	320.00
1	REAR N/S TYRE (SN)	SERVICEABLE	250.00	-
1	FRONT WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
			770.00	360.00
	<u>LABOUR</u>			
	REMOVE/RENEW THE ABOVE PARTS. KNOCK OUT & STRAIGHTEN N/S DOOR CENTRE PILLAR ETC. INCLUSIVE OF THE REPAIR OF FRONT BUMPER - COLOUR CODE, FRONT N/S FENDER, FRONT N/S DOOR HINGE, FRONT N/S DOOR INNER LOCK, AND REAR N/S DOOR INNER LOCK.		1,800.00	1,000.00
	TO PUTTY & SPRAY PAINT ON ACCIDENT AFFECTED PORTION.		1,400.00	1,200.00
	CHECK/RECONNECT WIRING.		50.00	30.00
	REMOVE/REFIT FRONT & REAR N/S DOOR GLASS, MECHANISM , INNER LOCK, TRIM BOARD TO NEW DOOR.		120.00	120.00
	REMOVE/REFIT FRONT WINDSCREEN GLASS.		120.00	120.00
	REMOVE/RENEW REAR N/S FENDER GLASS.		80.00	60.00
	REMOVE/REFIT FRONT DASHBOARD TO FACILITATE REPAIR.		400.00	250.00
	REMOVE/REFIT ROOF LINING TO FACILITATE REPAIR.		250.00	100.00
	REMOVE/RENEW REAR N/S UNDERCARRAIGES.	NOT NECESSARY	400.00	-
	CHECK AND REALIGN WHEEL ALIGNMENT.		80.00	60.00
			4,700.00	2,940.00
	GRAND TOTAL		19,797.68	11,070.40

Report Ref No. CS/SPF22005820/Kvy3m4



Page No.:3 of 3

RECOMMENDED COST OF LUMP SUM REPAIRS		8,800.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CS/SPF22005820/Kvy3m4

NOTES : THE ESTIMATED UPPER RANGE OF REPAIR COST FOR THE DAMAGED VEHICLE IS IN THE REGION OF \$8,500.00-\$9,500.00

KONG SENG CHEONG

Licensed Appraiser