Ding Auto Pte Ltd Sin Ming Industrial Est. Sec C, Blk 10,#01-20 575645

Insurer Reference:

Repairer Reference: 048486

Date calculated: 10/08/2022 12:17 PM

Full Report Registration: SMP4721M Printed: 10/08/2022 12:18 PM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

Printed by:

Ding Auto

Currency: Date of Incident: SGD 15/06/22

Claim Reference:

21

Hire Car Start:

Estimated Repair Time: 21 Hire Car End: Actual Repair Days:

Vehicle Details

Vehicle

TOYOTA Manufacturer: NOAH Model: Sub Model: Χ

Model Sheet Number: 70 NB 03 SMP4721M Registration:

VIN number:

Odometer: 245465

Model Specs

AIR CONDITIONING 2.0 LTR 113KW CVT AUTO GEARBOX


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

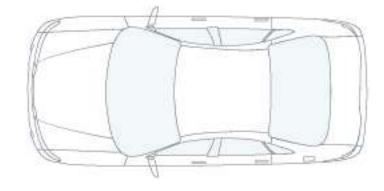

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

 $mm \hspace{1cm} mm \hspace{1cm} mm \hspace{1cm} mm \hspace{1cm} mm \hspace{1cm} Middle), \hspace{1cm} mm$

Spare Tyre Brand

Tread (Spare), mm

Labour

	Time Base 10 WU/h	Price = 42.	00 SGD/h
Code	Description	WU	Price SGD
NO NUMBER	R + R FRONT BUMPER TRIM	5.0	21.00
NO NUMBER	R + R HEADLAMPS	4.0	16.80
	(BUMPER REMOVED)		
	INCLUDES: ADJUST HEADLAMPS		
NO NUMBER	RENEW RADIATOR GRILLE	6.0	25.20
NO NUMBER	RENEW FRONT BUMPER	15.0	63.00
	(RADIATOR GRILLE REMOVED)		
	INCLUDES: FRONT BUMPER AND REQUIRED		
	ATTACHED PARTS R + R		
NO NUMBER	RENEW L/HEADLAMP (REMOVED)	1.0	4.20
NO NUMBER	RENEW FRONT PANEL CPL	13.0	54.60
NO NUMBER	RENEW LEFT FRONT WING BRACKET	5.0	21.00
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT	2.0	8.40
	(BUMPER REMOVED)		
	INCLUDES: ABSORBER REMOVE AND REFIT		
NO NUMBER	RENEW L/FRT WING	8.0	33.60
	INCLUDES: WHEELHOUSE LINER AND REQUIRED		
	ATTACHED PARTS R + R		

Code	Description		wu	Price SGD
	NOT INCLUDED: HEADLAMP AND R + R BUMPER			
NO NUMBER	R + R RIGHT FRONT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER		7.0	29.40
NO NUMBER	RENEW BONNET INCLUDES: R + R BONNET, ATTACH PARTS ASSEMBLE AND IF NEC RENEW		6.0	25.20
NO NUMBER	R + R WIRE LINKAGE		1.0	4.20
NO NUMBER	R + R WINDSCREEN INCLUDES: WIPER ARMS, COWL COVER, A-PILLAR TRIMS, INSIDE MIRROR AND ALL NECESSARY ATTACHED PARTS REMOVE & REFIT		39.0	163.80
NO NUMBER	R + R COWL PANEL TRIM INCLUDES: WIPER ARMS REMOVE AND REFIT		2.0	8.40
NO NUMBER	RENEW WINDSCREEN FRAME COVER (REMOVED)		2.0	8.40
NO NUMBER	R + R AIR CONDITIONING CONDENSER (BUMPER REMOVED) INCLUDES: FILL AIR CONDITIONING		12.0	50.40
NO NUMBER	R + R RADIATOR (BUMPER AND CONDENSER REMOVED) INCLUDES: HOSE, BLOWER HOUSING AND REQUIRED ATTACHED PARTS R + R. COOLING SYSTEM DRAIN/REFILL AND BLEED.		6.0	25.20
	Labour Cost Panel / Mechanical Labour	Hrs 13.40	WU 134.0	562.80
	Total of Labour			562.80

Paint

Paint Work SYSTEM AZT		Time Basis 10 WU/h	
Code	Description	WU Price SGD	
	BONNET NEW PART PAINTING	17.0	
	L/F WING NEW PART PAINTING	11.0	
	FRONT PANEL CPL SURFACE PAINT	5.0	
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	GRILLE NEW PART PAINT K1R	10.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	41.11
0741	L/F WING NEW PART PAINTING	20.55
1009	FRONT PANEL CPL SURFACE PAINT	5.28
0281	FRONT BUMPER NEW PART PAINT K1R	46.07
0410	GRILLE NEW PART PAINT K1R	39.09

Labour Cost - Paint Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			54.0	
Preparation Main Work Metal		0.70	7.0	29.40
Preparation Comp. Work Plastic		0.30	3.0	12.60
Total	10 WU/h	6.40	64.0	268.80
Material Cost - Paint				Price SGD
New Part Painting				61.66
New Part Painting - Plastic K1R				85.16
Surface-/Blend Paint				5.28
Material-constant Metal				18.10
Material-constant Plastic				9.00
Total				179.20

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Part Source	Price SGD
0471	BONNET	53301 28160	Original	360.00
0473	BONNET MOULDING	75770 28120	Original	250.00
1391	CENTRE COWL TRIM	55708 28191	Original	240.00
0281	FRONT BUMPER	52119 2J995	Original	330.00
0415	FRONT BUMPER TRIM	53105 28030	Original	430.00
1009	FRONT PANEL CPL	53205 28200	Original	715.00
0327	FRT BUMPER ABSORBER		Original	55.00
0340	FRT BUMPER SUPPORT	52131 28170	Original	170.00
0410	GRILLE	53101 28390	Original	490.00
1003	HV WATER PUMP BRKT	WATER PUMP BRK	Γ Supplementary	
0317	L/F BUMPER BRACKET	52116 28090	Original	55.00
0475	L/F HINGE	53420 28100	Original	42.00
0347	L/FOG LAMP COVER	52040 28030	Original	50.00
0841	L/F WHEELHOUSE COVER	53806 28100	Original	90.00
0741	L/F WING	53812 28240	Original	380.00
0773	L/F WING BRACKET	53878 28170	Original	36.00
0743	L/F WING RR MOULDING	53828 28160	Original	60.00
0561	LEFT HEADLAMP ASSY	81170 28721	Original	1,200.00
0476	R/F HINGE	53410 28100	Original	42.00
1002	TRIM PANEL LH	HEADLAMP TRIM	Original	58.00
1401	WINDSCREEN	56101 28901	Original	1,000.00
1419	WINDSCREEN SEAL	56117 64010	Original	50.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts u: Used parts	Subtotal			6,139.00
a. Osca parts	Total			6,139.00

Final Calculation

	SGD	SGD
Parts	6,139.00	
Total Parts	·	6,139.00
Labour Time Base 10 WU/h		
Total 134.0 WU X 42.00 SGD/h	562.80	
Total of Labour		562.80
Paint Work Time Base 10 WU/h		
Labour Cost 64.0 WU X 42.00 SGD/h	268.80	
Material Cost	179.20	
Total Paint Including Material		448.00
Repair Cost Excludes GST		7,149.80
GST (+7.0%)		500.49
Repair Cost Included GST		7,650.29

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.