



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKQ 2731R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	BONNET	BUCKLED	1,478.90	1,478.90
1	BONNET CHROME	CRACKED	189.95	189.95
1	HEADLAMP ASSY -RH	CRACKED	1,295.90	1,295.90
1	SUPPORT PANEL	TO REPAIR SEE LABOUR	658.35	-
1	SUPPORT PANEL TOP GARNISH	SERVICEABLE	229.95	-
1	FRONT BUMPER	BUCKLED / CRACKED	599.85	599.85
1	FRONT BUMPER REINFORCEMENT	BENT	399.50	399.50
1	FRONT BUMPER SPONGE	SERVICEABLE	115.90	-
1	FRONT BUMPER SIDE RETAINER -RH	DISTORTED	112.40	112.40
1	FRONT BUMPER LOWER GRILLE	DENTED	199.80	199.80
1	FRONT BUMPER FOG LAMP -RH	CRACKED	359.60	359.60
1	FRONT BUMPER FOG LAMP COVER-RH	MISSING	75.90	75.90
	LESS 25% DISCOUNT		-1,429.00	-1,177.95
			4,287.00	3,533.85
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FRONT NUMBER PLATE (SN)	DENTED	40.00	40.00
			40.00	40.00
	<b><u>LABOUR</u></b>			
	TO REMOVE AND REFIT AIR-CON CONDENSER ,RADIATOR AND REFILL AIR-CON GAS.	NOT NECESSARY	150.00	-
	TO REMOVE AND REFIT FRONT BUMPER SENSOR .		100.00	50.00
	TO CHECK AND RECTIFY WIRING SYSTEM.		80.00	20.00
	TO PANEL BEAT AND STRAIGHTEN RH FRONT FENDER ,RH FRONT CHASIS FRAME ,INCLUDING REPLACEMENT OF PARTS AND ALIGN WHERE NECESSARY TO REFIT AND ADJUST THE SAME.INCLUSIVE OF THE REPAIR OF SUPPORT PANEL .		1,000.00	450.00
	TO PUTTY AND SPRAY PAINT ON AFFECTED AREAS .		1,000.00	660.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO APPLY RUST-PROOFING ON REPLACED AND REPAIRED PANELS.		80.00	30.00
			2,410.00	1,210.00
<b>GRAND TOTAL</b>			<b>6,737.00</b>	<b>4,783.85</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>3,800.00</b>

Report Ref No. CS/AGI22005857/Kny3q2

**KONG SENG CHEONG**

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.