

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22006008/KCY3N2**Date:** 30/06/2022REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNW00019392202

Claimant Vehicle No : SLH4262A **Insured Vehicle No :** GBA6218X

Date of Loss: 13/06/2022 Nature of Claim: TP Claim No: SNM22D204387/C02/LEWLC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLH4262A**

Make & Model: TOYOTA COROLLA, 1.5 G AXIO HYBRID (A) Engine No: 1NZR427587

Reg. Date: 02/11/2016 (Man. Year: 2016) Chassis No: NKE1657136912

Colour: Metallic Beige Odometer: 211831 km

Engine Capacity: 1496 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 185/60R15 Rear Tyre Size: 185/60R15

Front Left Side: Firenza 4 mm Rear Left Side: Firenza 5 mm

Front Right Side: Firenza 4 mm Rear Right Side: Firenza 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,300.40	360.97	939.43	72.24
Miscellaneous Items	0.00	0.00	0.00	
Labour	760.00	395.00	365.00	48.03
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	2,060.40	755.97	1,304.43	63.31

INSPECTION

Date of Assignment: 23/06/2022

Date Inspected: 27/06/2022 Inspected At: E M Solution Pte Ltd (HQ)
160 Sin Ming Drive,, #03-18, Sin Ming Autocity
Singapore 575722

Estimated Period of Repair: 2.0 days

Adjuster: KENNETH KONG**Manager:** CELINE FONG*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

Different 1 cents -Finalise confirm amount: \$755.98

REPAIR DETAILS**Reference****Part Source:** MRM-SG Version: 1.0 (Last Synchronised: 30 Jun 2022)**Parts:** 143 TOYOTA COROLLA 1.5 G AXIO HYBRID (A) (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** (Unsubmitted, no print-code for SLH4262A)**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Recommended Parts**

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
1	1		*REAR TAILLAMP RH	Cracked	481.30 F	*481.30 FL	
2	1		*REAR BUMPER	Repair	655.10 F	*- FL	
3	1		*REAR BUMPER REFLECTOR RH	Serviceable	164.00 F	*- FL	
					Sub Total (S\$)	1,300.40	481.30
					- List Item Discount on L Items 0.00/25.00% (S\$)	0.00	120.33
					Total Parts (S\$)	1,300.40	360.97

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	350.00	180.00
2	SPRAY PAINTING	New	380.00	200.00
3	CHECK WIRING	New	30.00	15.00
			Gross Labour Cost (\$)	760.00
				395.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >