

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC3/AIG22006126/KPA3Q2**Date:** 04/11/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7210014422
Claimant Vehicle No :	SHC5962E	Insured Vehicle No :	SDH9208U
Date of Loss:	23/06/2022	Nature of Claim:	TP
		Claim No:	8043036893SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHC5962E		
Make & Model:	TOYOTA PRIUS, 1.8 5DR HATCHBACK (A)	Engine No:	2ZR2H10982
Reg. Date:	30/09/2021 (Man. Year: 2020)	Chassis No:	JTDKB3FU703092494
Colour:	Metallic Pearl White/Red	Odometer:	0 km
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Sailun 8 mm	Rear Left Side:	LANVIGATOR 9 mm
Front Right Side:	Sailun 8 mm	Rear Right Side:	LANVIGATOR 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	54,958.82	20,538.87	34,419.95	62.63
Miscellaneous Items	0.00	0.00	0.00	
Labour	9,390.00	2,700.00	6,690.00	71.25
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	64,348.82	23,238.87	41,109.95	63.89
Approved Total (Overridden) (\$\$)		18,600.00		
(\$\$)	64,348.82	18,600.00	45,748.82	71.10
+ GST 7.00/7.00% (\$\$)	4,504.42	1,302.00	3,202.42	71.10
Nett Amount (\$\$)	68,853.24	19,902.00	48,951.24	71.10
Global Sum Settlement (\$\$)		0.00		

INSPECTION

Date of Assignment:	27/06/2022		
Date Inspected:	27/06/2022	Inspected At:	Trans-cab Auto Services Pte Ltd No 2 Ang Mo Kio Street 63 Singapore 569111
Estimated Period of Repair:	13.0 days		

Adjuster: KENNETH KONG**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*COVER SUB-ASSY ,FRONT PILLAR ,UPR RH	Serviceable	100.40 FL	*- FL
2	1	*COVER SUB-ASSY ,FRONT PILLAR ,UPR LH	Serviceable	100.40 FL	*- FL
3	1	*FENDER SUB-ASSY ,FRONT RH	Buckled	977.80 FL	*977.80 FL
4	1	*LINER ,FRONT FENDER ,RH	Cracked	202.50 FL	*202.50 FL
5	1	*EMBLEM ,SIDE PANEL	Necessary	54.60 FL	*54.60 FL
6	1	*FENDER SUB-ASSY ,FRONT LH	Repair	977.80 FL	*- FL
7	1	*LINER ,FRONT FENDER ,LH	Serviceable	210.30 FL	*- FL
8	1	*EMBLEM ,SIDE PANEL	Not Necessary	54.60 FL	*- FL
9	1	*COVER ,FRONT BUMPER	Torn	521.00 FL	*521.00 FL
10	1	*MOULDING ,FRONT BUMPER SIDE ,RH	Missing	95.60 FL	*95.60 FL
11	1	*MOULDING ,FRONT BUMPER SIDE ,LH	Serviceable	95.60 FL	*- FL
12	1	*BRACKET ,FRONT BUMPER EXTENSION MOUNTING	Distorted	110.50 FL	*110.50 FL
13	1	*REINFORCEMENT SUB-ASSY ,FRONT BUMPER	Bent	716.60 FL	*716.60 FL
14	1	*REINFORCEMENT ,FRONT BUMPER ,NO.2	Bent	246.10 FL	*246.10 FL
15	1	*ABSORBER ,FRONT BUMPER ,LOWER	Cracked	132.70 FL	*132.70 FL
16	1	*ABSORBER ,FRONT BUMPER ENERGY	Cracked	80.20 FL	*80.20 FL
17	1	*SUPPORT ,FRONT BUMPER SIDE ,LH	Distorted	82.30 FL	*82.30 FL
18	1	*SUPPORT ,FRONT BUMPER SIDE ,RH	Cracked	80.10 FL	*80.10 FL
19	1	*COVER ,ENGINE UNDER NO.1	Cracked	472.40 FL	*472.40 FL
20	1	*COVER SUB-ASSY ,ENGINE UNDER NO.2	*Check	241.90 FL	*- FL
21	1	*EXTENSION ,FRONT BUMPER ,LH	Repair	120.10 FL	*- FL
22	1	*EXTENSION ,FRONT BUMPER ,RH	Bent	120.10 FL	*120.10 FL
23	1	*STAY SUB-ASSY FRONT BUMPER ,RH	Distorted	47.50 FL	*47.50 FL
24	1	*STAY SUB-ASSY FRONT BUMPER ,LH	Serviceable	47.50 FL	*- FL
25	1	*BRACKET ,FRONT BUMPER SIDE ,LH	Repair	59.30 FL	*- FL
26	1	*BRACKET ,FRONT BUMPER SIDE ,RH	Bent	59.30 FL	*59.30 FL
27	1	*COVER ,FRONT BUMPER HOLE ,RH	Missing	30.20 FL	*30.20 FL
28	1	*BRACKET ,HEADLAMP ,RH	Cracked	34.80 FL	*34.80 FL
29	1	*BRACKET ,HEADLAMP ,LH	Serviceable	34.80 FL	*- FL
30	1	*LAMP ASSY ,FOG ,LH	*Check	237.10 FL	*- FL
31	1	*LAMP ASSY ,FOG ,RH	Missing	237.10 FL	*237.10 FL
32	1	*UNIT ASSY ,HEADLAMP ,LH	Mtg Cracked	2,637.60 FL	*2,637.60 FL
33	1	*COMPUTER SUB-ASSY,HEADLAMP ,LH NO.1	*Check	3,772.50 FL	*- FL
34	1	*UNIT ASSY ,HEADLAMP ,RH	Broken	2,637.60 FL	*2,637.60 FL
35	1	*COMPUTER SUB-ASSY,HEADLAMP ,RH NO.1	*Check	3,772.50 FL	*- FL
36	1	*GRILLE SUB-ASSY ,RADIATOR	Cracked	422.50 FL	*422.50 FL
37	1	*GRILLE RADIATOR LOWER NO.1	Cracked	178.60 FL	*178.60 FL
38	1	*EMBLEM ASSY ,RADIATOR GRILLE	Missing	105.80 FL	*105.80 FL
39	1	*HOOD SUB-ASSY	Buckled	983.10 FL	*983.10 FL
40	1	*HINGE ASSY ,HOOD ,LH	Bent	58.90 FL	*58.90 FL
41	1	*HINGE ASSY ,HOOD ,RH	Bent	58.90 FL	*58.90 FL
42	1	*INSULATOR HOOD	Serviceable	410.90 FL	*- FL
43	1	*BRACE ,HOOD LOCK SUPPORT	Bent	78.30 FL	*78.30 FL
44	1	*LOCK ASSY ,HOOD	Distorted	135.00 FL	*135.00 FL
45	1	*WIRE ,ENGINE ROOM MAIN	*Check	7,323.90 FL	*- FL
46	1	*INLET ,AIR CLEANER NO.1	*Check	155.60 FL	*- FL
47	1	*INLET ,AIR CLEANER NO.3	*Check	42.10 FL	*- FL
48	1	*INLET ,AIR CLEANER NO.2	*Check	112.70 FL	*- FL
49	1	*INLET ,AIR CLEANER NO.1	*Check	74.00 FL	*- FL
50	1	*JAR ASSY ,WINDSHIELD WASHER	Dented	219.10 FL	*219.10 FL
51	1	*MOTOR AND PUMP ASSY ,WINDSHIELD WASHER	*Check	292.40 FL	*- FL
52	1	*INLET SUB-ASSY ,WASHER	*Check	67.00 FL	*- FL
53	1	*CONDENSER ASSY ,COOLER	*Check	1,783.20 FL	*- FL
54	1	*HOSE SUB-ASSY ,SUCTION	*Check	646.80 FL	*- FL
55	1	*HOSE SUB-ASSY ,DISCHARGE	*Check	402.90 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	1		*PIPE SUB-ASSY ,SUCTION	*Check	465.80 FL	*- FL
57	1		*SENSOR ,AIRCONDITIONER PRESSURE	*Check	342.80 FL	*- FL
58	1		*TUBE & ACCESSORY ASSY ,AIR CONDITIONER	*Check	691.00 FL	*- FL
59	1		*COMPRESSOR ASSY ,W/MOTOR	*Check	4,771.60 FL	*- FL
60	1		*RADIATOR ASSY	*Check	2,218.00 FL	*- FL
61	1		*TANK ASSY ,INVERTER RESERVE	*Check	443.00 FL	*- FL
62	1		*COCK ASSY ,RESERVE TANK	*Check	139.00 FL	*- FL
63	1		*INVERTER WATER PUMP ASSY (W/MOTOR)	*Check	518.60 FL	*- FL
64	1		*MOTOR ,COOLING FAN ,LH	*Check	655.10 FL	*- FL
65	1		*MOTOR COOLING FAN ,RH	*Check	535.50 FL	*- FL
66	1		*COOLVER ,MOTOR COOLING	*Check	297.20 FL	*- FL
67	1		*WIRE ,ENGINE ROOM MAIN	*Check	7,323.90 FL	*- FL
68	1		*CLAMP SUB-ASSY ,BATTERY	Repair	115.50 FL	*- FL
69	1		*BATTERY	Serviceable	1,584.90 FL	*- FL
70	1		*JAR ASSY ,WINDSHIELD WASHER	*Check	219.10 FL	*- FL
71	1		*AIR BAG ASSY ,INSTRUMENT PANEL PASSENGER W/O DOOR	*Check	3,869.30 FL	*- FL
72	1		*AIR BAG ASSY ,INSTRUMENT PANEL LOWER NO.1	Burst	1,907.00 FL	*1,907.00 FL
73	1		*AIR BAG ASSY ,CURTAIN SHIELD ,LH	Burst	1,748.10 FL	*1,748.10 FL
74	1		*AIR BAG ASSY ,CURTAIN SHIELD ,RH	Burst	1,748.10 FL	*1,748.10 FL
75	1		*SENSOR ASSY ,SIDE AIR BAG ,LH NO.2	Necessary	709.30 FL	*709.30 FL
76	1		*SENSOR ASSY ,SIDE AIR BAG ,RH NO.2	Necessary	709.30 FL	*709.30 FL
77	1		*COMPUTER ASSY ,AIR BAG	Necessary	1,546.00 FL	*1,546.00 FL
78	1		*SENSOR ,AIR BAG ,FRONT LH	Necessary	373.90 FL	*373.90 FL
79	1		*SENSOR ,AIR BAG ,FRONT RH	Necessary	373.90 FL	*373.90 FL
80	1		*HEADLINING ASSY ,ROOF	Deformed	2,125.70 FL	*2,125.70 FL
81	1		*BELT ASSY ,FRONT SEAT OUTER ,RH	Jammed	995.10 FL	*995.10 FL
82	1		*BELT ASSY ,FRONT SEAT OUTER ,LH	Jammed	995.10 FL	*995.10 FL
83	1		*BELT ASSY ,REAR SEAT 3 POINT TYPE ,OUTER ,LH	Jammed	995.10 FL	*995.10 FL
84	1		*BELT ASSY ,REAR SEAT 3 POINT TYPE ,OUTER ,RH	Jammed	995.10 FL	*995.10 FL
85	1		*FRT NUMBER PLATE WITH HOLDER	Bent	140.00 FS	*45.00 FS
86	1		*SET BUMPER CLIP FRT	Necessary	95.00 FS	*60.00 FS
87	1		*SET FRT BUMPER RETAINER CLIP	Not Necessary	85.00 FS	*- FS
88	4		*L RADIATOR COOLANT	Necessary	120.00 FS	*30.00 FS
89	1		*HOOD INSULATOR CLIP	Not Necessary	55.00 FS	*- FS
90	1		*ENGINE UNDER COVER CLIP	Necessary	60.00 FS	*60.00 FS
91	1		*FRT FENDER LINER CLIP	O/S Necessary	130.00 FS	*65.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) **73,050.10** **27,298.50**

- List Item Discount on L Items 25.00/25.00% (\$\$) 18,091.28 6,759.63

Total Parts (\$\$) **54,958.82** **20,538.87**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR	New	380.00	120.00
2	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME	New	2,200.00	900.00
3	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	380.00	0.00
4	TO TRANSFER OF TAILGATE FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	180.00	0.00
5	TO REMOVE AND REFIT ELECTRICAL WIRING ,BATTERY AND OTHER NECESSARY ITEMS TO FACILITATE BODYWORK REPAIR (*Check)	New	480.00	0.00
6	TO TRANSFER OF FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	480.00	0.00
7	TO DISMANTLE AND REFIT AIRCON ASSY AND ATTACHMENT VACUUM AND CHARGE-IN-GAS	New	380.00	100.00
8	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH ,TO FACILITATE REPAIR (*Check)	New	380.00	0.00
9	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	0.00
10	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS	New	250.00	90.00
11	TOWING FEES	New	150.00	50.00
12	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	2,200.00	1,320.00
13	TO REINSTALL REAR BUMPER PARKING SENSOR	New	170.00	0.00
14	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	20.00
15	TO REPLACE ,REFIX AND TOP UP COOLANT FOR RADIATOR	New	170.00	50.00
16	TO LIFT -UP/OUT ENGINE WITH GEAR BOX AND REFIT (*Check)	New	440.00	0.00
17	TO REMOVE AND REFIT RADIATOR SUPPORT CROSS -MEMBER AND OTHER NECESSARY ITEMS TO ENABLE BODYWORK REPAIR	New	380.00	50.00
18	TO CONDUCT AND PERFORM A COMPREHENSIVE VEHICLE DIAGNOSTIC CHECK AND RESET VEHICLE WARNING INDICATORS (*Check)	New	380.00	0.00
Gross Labour Cost (\$\$)			9,390.00	2,700.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >