

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22006311/UPA3Q2**Date:** 29/12/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7220036316
Claimant Vehicle No :	SLU2407U	Insured Vehicle No :	SKN8778H
Date of Loss:	30/06/2022	Nature of Claim:	TP
		Claim No:	5000010536SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLU2407U		
Make & Model:	MERCEDES-BENZ C180K, 1.6 (A)	Engine No:	27191031270772
Reg. Date:	27/10/2009 (Man. Year: 2009)	Chassis No:	WDD2040452A324943
Colour:	Grey	Odometer:	137303 km
Engine Capacity:	1597 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/45 R17	Rear Tyre Size:	225/45 R17
Front Left Side:	Michelin 8 mm	Rear Left Side:	Michelin 8 mm
Front Right Side:	Michelin 8 mm	Rear Right Side:	Michelin 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	189.00	0.00	189.00	100.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	460.00	300.00	160.00	34.78
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	649.00	300.00	349.00	53.78
+ GST 7.00/7.00% (S\$)	45.43	21.00	24.43	53.78
Nett Amount (S\$)	694.43	321.00	373.43	53.78
+ Loss of Use (2.0 x S\$60.00/day) (S\$)		120.00		
Nett Liability (S\$)		441.00		
Global Sum Settlement (S\$)		440.00		

INSPECTION

Date of Assignment:	25/07/2022		
Date Inspected:	25/07/2022	Inspected At:	Jin Auto Services Pte Ltd (Defu) Blk 14 Defu Lane 10, #01-410/412 Singapore 539195
Estimated Period of Repair:	2.0 days		

Adjuster: MARCUS CHUA**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	2		*FRONT BUMPER CHROME	Serviceable	210.00 FL	*- FL
F=Franchise part. L=ListItemDisc.						
Sub Total (S\$)					210.00	0.00
- List Item Discount on L Items 10.00/10.00% (S\$)					21.00	0.00
Total Parts (S\$)					189.00	0.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR CHARGE	New	180.00	100.00
2	SPRAY PAINTING	New	280.00	200.00
Gross Labour Cost (S\$)			460.00	300.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >