



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204941

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 11/08/2022
Reference CC6/CTI20007525/Kea3q2-
'
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SKR 380C
Insured Veh. SKV 9973L
Claim No. SNM20D202502
Policy No. DMPCSN3086441900
Accident Date 16/07/2020
Inspection Date 20/07/2020

Description	Total
Third Party Express Settlement	400.00
Less:AC2106559 DD 20/09/2021	-350.00
Subtotal	50.00
GST (7%)	3.50
Grand Total	53.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20007525/Krs3q2	
			Date: 20/09/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKV 9973L	Veh. Inspected	SKR 380C	
Policy No.	DMPCSN3086441900	Coverage (\$)	0.00	
Claim No.	SNM20D202502/C02	Excess (\$)	0.00	
Assign From		Assign Date	20/07/2020	
2. Vehicle Particulars & Condition				
Make & Model	LEXUS RX350	c.c	3456	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTJBZMCA302013692	Colour	METALLIC PEARL WHITE	
Odometer	32198 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/55 R20	YOKOHAMA	4 mm	
L/H Front Tyre	235/55 R20	YOKOHAMA	4 mm	
R/H Rear Tyre	235/55 R20	BRIDGESTONE	3 mm	
L/H Rear Tyre	235/55 R20	BRIDGESTONE	3 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/07/2020	Inspection Date	20/07/2020	
Survey held at	K.KIM HIN AUTOMOTIVE PTE LTD 160 SIN MING DRIVE, #02-20 SIN MING AUTOCITY SINGAPORE 575722			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKR 380C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	BUCKLED	995.00	995.00
2	REAR BUMPER SIDE RETAINER (LH/RH) @\$110.00	SERVICEABLE	220.00	-
10	REAR BUMPER CLIPS @\$5.50	NECESSARY	55.00	55.00
1	REAR BUMPER SPONGE	CRACKED	124.00	124.00
1	REAR BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	515.30	-
1	REAR BUMPER LOWER SPOILER	BENT	361.00	361.00
2	REAR BUMPER LOWER SIDE GARNISH (LH/RH) @ \$152.00	SERVICEABLE	304.00	-
1	N/S REAR BUMPER EXHAUST CHROME	SERVICEABLE	325.00	-
2	REAR BUMPER PARKING SENSOR-INNER (LH/RH) @ \$490.00	SHORTED (1 PC ONLY)	980.00	418.00
1	O/S REAR BUMPER PARKING SENSOR-OUTER	SERVICEABLE	490.00	-
4	REAR BUMPER PARKING SENSOR BRACKET @\$38.00	NECESSARY	152.00	152.00
1	TAILGATE	BENT	1,249.00	1,249.00
1	TAILGATE GLASS MOULDING	NECESSARY	107.10	107.10
1	TAILGATE LOGO	NECESSARY	195.00	195.00
1	TAILGATE "LEXUS" EMBLEM	NECESSARY	64.30	64.30
1	TAILGATE "RX350" EMBLEM	NECESSARY	77.60	77.60
1	TAILGATE LOCK	TO REPAIR SEE LABOUR	961.70	-
	LESS 10% DISCOUNT		-717.60	-379.80
			6,458.40	3,418.20
<u>SPECIAL NETT ITEMS</u>				
1	TAILGATE GLASS SEALANT (SN)	NECESSARY	40.00	40.00
1	TAILGATE GLASS DAMPING SEAL (SN)	NECESSARY	20.00	20.00
1	TO REPROGRAM REAR PARKING SENSOR AND RECALIBRATE BLIND SPOT MONITOR SENSOR (SN)	SERVICEABLE	280.00	-
			340.00	60.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>LABOUR</u>			
	TO REMOVE,CUT OUT DAMAGED PARTS,PANEL BEATING,WELDING,ALIGN,REFIX AND TO RENEW AFFECTED PARTS.INCLUSIVE OF THE REPAIR OF REAR BUMPER REINFORCEMENT AND TAILGATE LOCK.		400.00	400.00
	TO REMOVE AND REFIT REAR WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.		120.00	120.00
	TO REMOVE AND REFIT REVERSE SENSOR ASSY.		60.00	60.00
	TO PUTTY AND RESPRAY ON AFFECTED PORTIONS.		500.00	440.00
			1,080.00	1,020.00
GRAND TOTAL			7,878.40	4,498.20
RECOMMENDED COST OF REPAIRS				4,498.20

Report Ref No. CC6/CTI20007525/Krs3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKR 380C

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

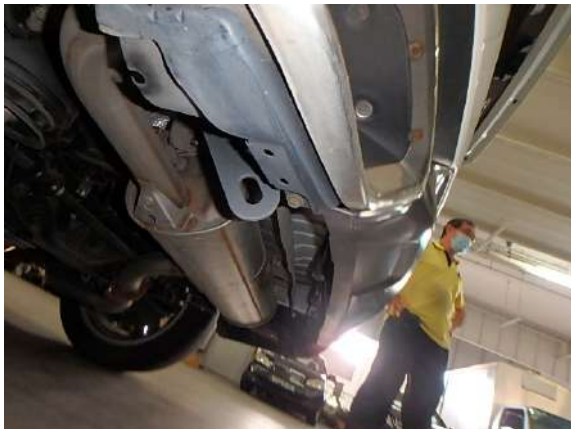



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKR 380C

RE-INSPECTION

