

ASS. REC. BY:

REF:

C72/ 2200-65951kg

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

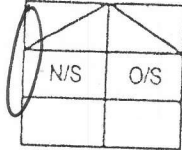
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 07 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: GB1-7561X Regn: 03, 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toy (Trace) C.C. 2982Colour: M. Blue A/C: Insured / Std / NI / NASp. Reading: 194935 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KD11 201 0210454Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim orTyre Size: F: 195R15X8

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 4 mmL/Bal. 4 mmD.O.A. 8/7/22

Survey held at

Rear

R/Bal. 4 mmL/Bal. 4 mmD.O.I. 13/7/2022

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

N/S body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

218 21 km 854501. Carhu (Red, \$3669.39, 40%)

Date/Time, File Pass to?

1) 29/8/22

Date/Time, File Return to?

2)

☐ : Prell. Report☐ : Final ReportDays Of Repair: 7Resurvey No. of Trip: 1

Survey Fee:

Transportation: _____

) Fines

) Others

TOTAL

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$ 5450)

EM Solution Pte Ltd

160 Sin Ming Drive #03-18/19, Sin Ming Autocity

Singapore 575722

Tel: 64560226 Fax: 64584500

GST Reg. No: 201016308K

*Not Asstain
11 by @ 5450/h
Patching After Rain
7 days*

ESTIMATE

Date :

M/s **Crystal Clear Contractor Pte Ltd**
Blk 1032 Eunos Ave 5A, #01-30
Singapore 409702

Veh No : **GBF 7561X**
Make/Model : **Toyot Hiace**
Chassis No : **KDH2010210454**
Date of Acc : **08.07.22**
TP Veh No : **GBD 1200M**

S/No	Qty	Description	Unit Price	Amount
Materials				
1	1 pc	Frt Door LH <i>Bl- 1999.70 → 1710.00</i>		
2	1 pc	Frt Door Wing Mirror LH <i>Dd/W- 1272.70 → 845.10</i>		
3	1 pc	Frt Door Outer Handle <i>Rx 199.30</i>		
4	1 pc	Frt Door Lock LH <i>Rx 613.30</i>		
5	1 pc	Frt Door Weatherstrip <i>Rx 244.20</i>		
6	1 pc	Sliding Door LH <i>Bl- 2080.20 → 1822.00</i>		
7	1 pc	Centre Pillar LH <i>Bl- 377.85</i>		
8	1 pc	Petrol Tank Panel <i>Rx 78.20</i>		
9	1 pc	Rear Body Panel LH <i>Bl- 1640.40</i>		
				8505.85
				\$ -
Less 25%				\$ 6739.39
				\$ -
10	1 pc	Frt Door Co's Sticker	S/Nett	\$ 50.00 <i>25m</i>
11	1 pc	Rear Road Rim LH		\$ 350.00 <i>x</i>
Parts Total :				

Labour				
1	To remove & rearrange electrical wirings, check lightings		\$	80.00 <i>200</i>
2	To remove, transfer front door components		\$	80.00 <i>600</i>
3	To remove, transfer sliding door component		\$	80.00 <i>600</i>
4	To remove, repair & replace damaged bodyparts and where consistent to the accident.		\$	1,000.00 <i>✓</i>
5	Putty and respray painting on affected portions.		\$	1,000.00 <i>800</i>
6	Rust proofing on affected portions.		\$	100.00 <i>900</i>
Labour Total :				\$ 2,340.00

Total Parts & Labour : 9119.39

for E M Solution Pte Ltd

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: