



# Advanced Automotive Consultancy Pte Ltd

159, Yishun St 11, #04-166. S(760159)  
Business Regn No : 201416413W  
Tel/ Fax no: 67568321

## Tax Invoice

JAMIL BIN ZAINI

Invoice No. : AAC 22 JUN 11

c/o EQBH PTE LTD  
Blk 25, Kaki Bukit Rd 4 Synergy@KB, #03-79  
Singapore 417800

Invoice Date : 15-Jun-2022

Terms : 30 Days

Ref No. : TP/FBP3551Z/EB/0521/05

Vehicle No. : FBP3551Z

Date of Accident : 2-May-2021

Date of Survey : 10-May-2021

### Description

### Amount

(1) Survey Of Vehicle - A set of survey report - Correspondence & Consultation	SGD \$484.00
(2) Transportation Charges including resurvey	
(3) Attached Photographs (64 pcs)	

Total SGD \$484.00

GRAND TOTAL SGD \$484.00

E. & O.E.



Cheque should be crossed and made payment to "Advanced Automotive Consultancy Pte Ltd "

Authorised By



## **Advanced Automotive Consultancy Pte Ltd**

Bussiness Regn No: 201416413W

### **ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT**

<b>1 REFERENCE</b>					
Our reference no	:	TP/FBP3551Z/EB/0521/05			
Date of request	:	10-May-2021			
Date of survey	:	10-May-2021			
Date of accident	:	2-May-2021			
Requested by	:	JAMIL BIN ZAINI C/o , Blk 25 Kaki Bukit Rd 4 Synergy@KB, #03-79.Singapore 417800			
Type of claim	:	Third party			
Workshop	:	EQBH PTE LTD Blk 25, Kaki Bukit Rd 4 Synergy@KB, #03-79 Singapore 417800			
<b>2 DETAILS OF VEHICLE</b>					
Registration No.	:	FBP3551Z			
Make & Model	:	HONDA WAVE 125R			
Date of registration	:	22/3/2005 (COE Expiry 28/2/2025)			
Engine No.	:	NF125MPE0030942			
Engine Capacity	:	125CC			
Chassis No.	:	NF125MP0030942			
Speedometer reading	:	68553KM			
Colour	:	RED			
<b>3 STATIC CHECK</b>					
Steering	:	Affected	Paintwork	:	Good
Footbrake	:	In order	Modification	:	Nil
Handbrake	:	In order	General condition	:	Good
<b>4 TYRE CONDITION</b>					
		<u>Nearside/Make</u>		<u>Size</u>	
Front tyre	:	3mm/PIRELLI		80/90-17	
Rear tyre	:	3mm/PIRELLI		90/80-17	
<b>5 POINT OF IMPACT</b>					
The said vehicle has sustained an impact damages on the front, left and right portion. Kindly refer to the attached photographs for more detail of the damages.					
<b>6 REMARK</b>					
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.					

**Advanced Automotive Consultancy Pte Ltd**

**Annex A : Assesment / Adjustment on Spare Parts**

TP/FBP3551Z/EB/0521/05

Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)	
<b>List Items</b>							
1	Honda fairing set (silver)	cracked/grazed	1300	\$380.00	10%	\$342.00	
2	Honda fairing set (matte black)	grazed/cracked	1150	\$180.00	10%	\$162.00	
3	Honda front rim	warped/wobble	1165	\$200.00	10%	\$180.00	
4	Honda front suspension (left)	distorted/affected	1280	\$380.00	10%	\$342.00	
5	Honda front suspension (right)	distorted/affected	1280	\$380.00	10%	\$342.00	
6	Honda triple clamp (bottom)	distorted/affected	1160	\$285.00	10%	\$256.50	
7	Honda steering cone bearing	necessary	1	\$120.00	10%	\$108.00	
8	Honda handlebar	distorted/affected	1	\$95.00	10%	\$85.50	
9	Honda handlebar bracket	repair	1	\$65.00	100%	\$0.00	XR
10	Honda front wheel bearing	rattle	2	\$70.00	10%	\$63.00	
11	Honda front wheel seal	necessary	2	\$30.00	10%	\$27.00	
12	Honda front wheel shaft	repair	1	\$60.00	100%	\$0.00	XR
13	Honda brake lever	scratched	1	\$25.00	10%	\$22.50	
14	Honda brake lever pin	necessary	1	\$15.00	10%	\$13.50	
15	Honda brake lever holder	intact	1	\$30.00	100%	\$0.00	XNN
16	Honda front brake master cylinder	repair	1	\$120.00	100%	\$0.00	XNN
17	Honda front brake hose	intact	1	\$85.00	100%	\$0.00	XNN
18	Honda mirror mounting screw	necessary	2	\$20.00	10%	\$18.00	
19	Honda mirror	grazed	2	\$70.00	10%	\$63.00	
20	Honda front headlight	scratched	1180	\$240.00	10%	\$216.00	
21	Honda front signal lights	scratched	2116	\$130.00	10%	\$117.00	
22	Honda plastic basket	cracked	1	\$60.00	10%	\$54.00	
23	Honda plastic basket bracket	bent	2	\$30.00	10%	\$27.00	
				<u>\$3,070.00</u>		<u>\$2,439.00</u>	22312 2007.90
<b>S/Nett Items</b>							
1	Kappa box	grazed	1	\$180.00		\$180.00	
2	Kappa box base plate	necessary	1	\$85.00		\$85.00	
3	Kappa box rack	realign	1	\$140.00		\$0.00	XNN
4	CNC bar end balancer	grazed	1	\$120.00		\$120.00	60
5	IU unit	grazed	1	\$0.00		\$50.00	
6	Front windshield	broken	1	\$50.00		\$50.00	
				<u>\$575.00</u>		<u>\$485.00</u>	425
<b>Total for Spare Parts :</b>				<b><u>\$3,645.00</u></b>		<b><u>\$2,924.00</u></b>	

**Advanced Automotive Consultancy Pte Ltd**

**Annex B : Adjustment on Labour and Spray Painting**

TP/FBP3551Z/EB/0521/05

Item	Job Description	Workshop Est. (\$)	Adjusted Cost (\$)
1	To remove & replace front rim, front wheel bearing, axle shaft, tripple clamps, front fork, steering cone, front brake disc.	\$250.00	\$180.00 120
2	To remove & replace above body damaged parts, check wiring & lighting system	\$450.00	\$350.00 200
3	To conduct chassis alignment	\$480.00	\$350.00 200
4	Towing -workshop to accident reporting center	\$60.00	\$60.00
5	Towing -accident reporting center to workshop	\$60.00	\$60.00
		<u>\$1,300.00</u>	<u>\$1,000.00</u>
	<b>TOTAL FOR LABOUR &amp; SPRAY PAINTING :</b>	<b><u>\$1,300.00</u></b>	<b><u>\$1,000.00</u></b>

640

**Summary**

	Workshop Est. (\$)	Adjusted Cost (\$)
TOTAL FOR SPARE PARTS :	\$3,645.00	\$2,924.00
TOTAL FOR LABOUR & SPRAY PAINTING :	\$1,300.00	\$1,000.00
<b>TOTAL REPAIR COSTS :</b>	<b><u>\$4,945.00</u></b>	<b><u>\$3,924.00</u></b>

3072.90

L/S ~~\$2450~~ 2400

4 DAYS

## **Advanced Automotive Consultancy Pte Ltd**

TP/FBP3551Z/EB/0521/05

### **Annex C: Recommendation**

We have inspected thoroughly the actual damages found on the vehicle and our assessment is appended in the Annex(es) attached. The condition and age of the vehicle was considered before we reached our recommendation as to whether the parts need replacement or repair.

M/S EQBH PTE LTD estimated repair cost is **S\$4,945.00** and we have adjusted it to **S\$3,924.00** on a part by part basis. However, taking into consideration the age of the vehicle and the availability of used/recondition components. We, therefore recommend a contract lump sum repair cost.

The repairer have agreed to undertake the repairs on a contract lump sum of **S\$3,100.00**, according to acceptable quality and standard. (Repairer discretion to repair parts, to replace with old parts, or to replace with OEM or genuine parts).

The entire repair of the damaged vehicle should be completed within a reasonable period of 4 working days.



We have advised the repairer that the inspection was conducted strictly on a WITHOUT PREJUDICE basis and we have not given any instruction and authorisation to proceed with the repair of the vehicle.


We are reverting the matter to you for your discretion and enclosed is our invoice for service rendered.


Yours faithfully,



A handwritten signature in blue ink, appearing to read 'ifhen', is written over a circular blue stamp. The stamp contains the text 'ADVANCED AUTOMOTIVE CONSULTANCY PTE LTD' around the perimeter and a small star symbol at the bottom.



Henry Low  
Automotive License Appraiser  
CMTM, DMTM, IPTM (UNF)

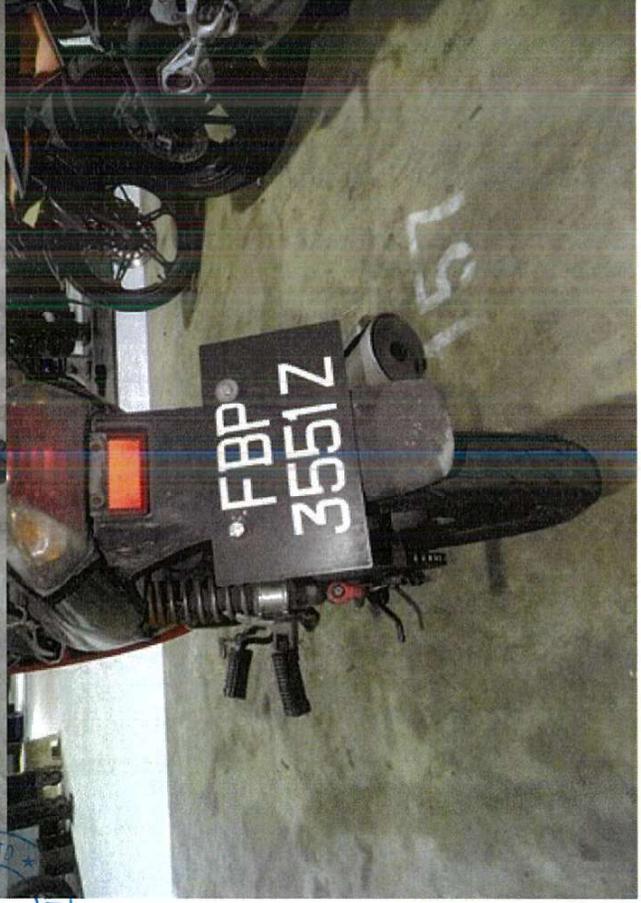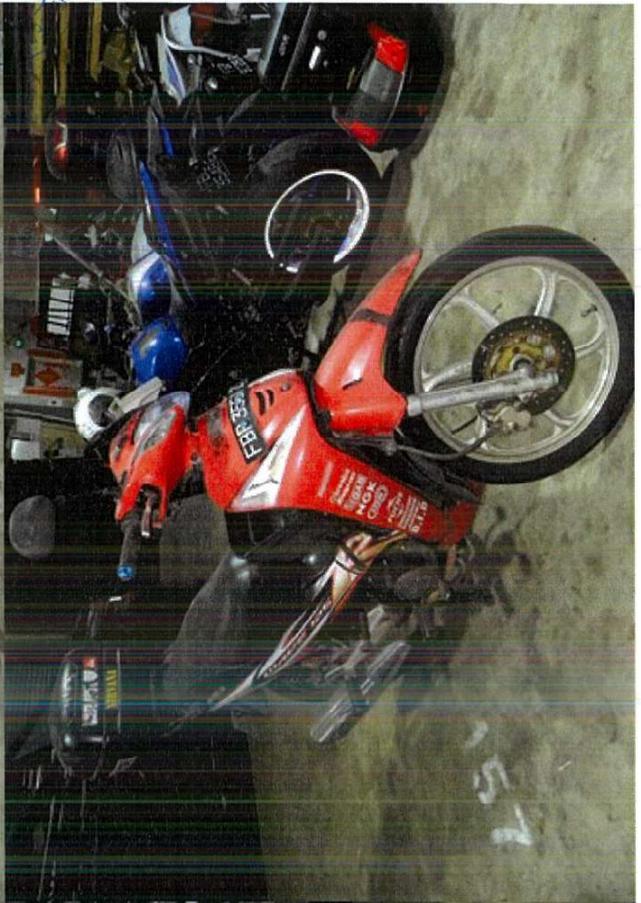


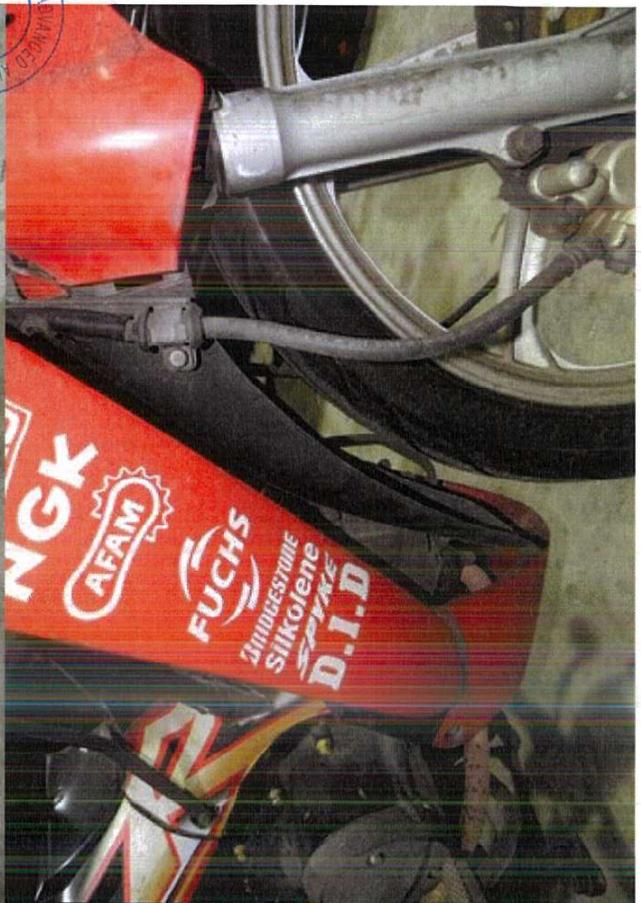


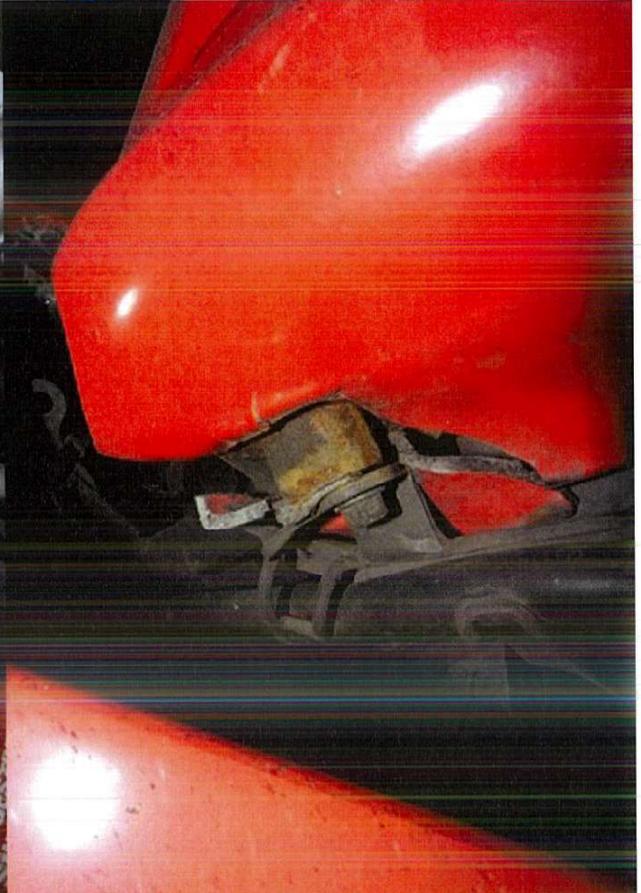


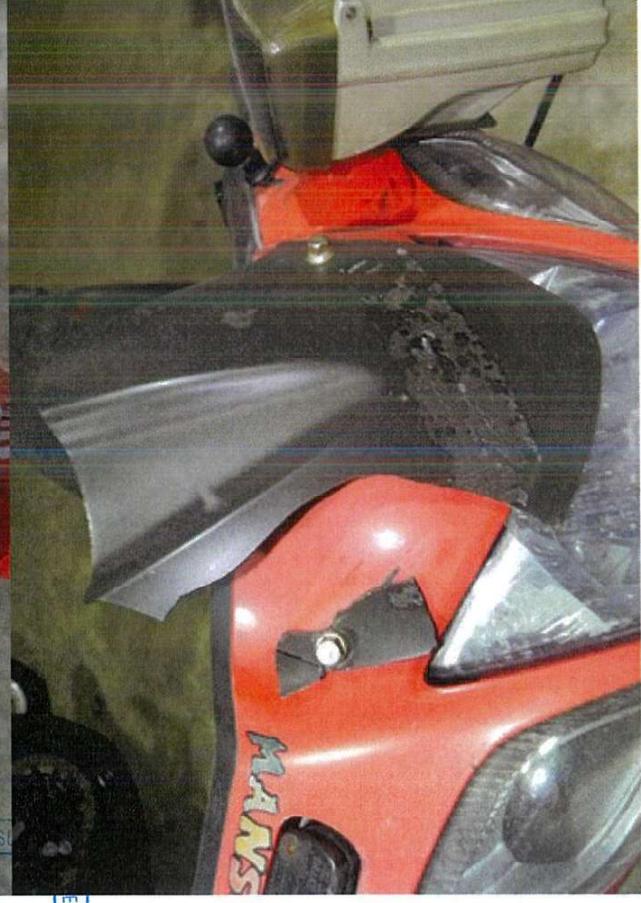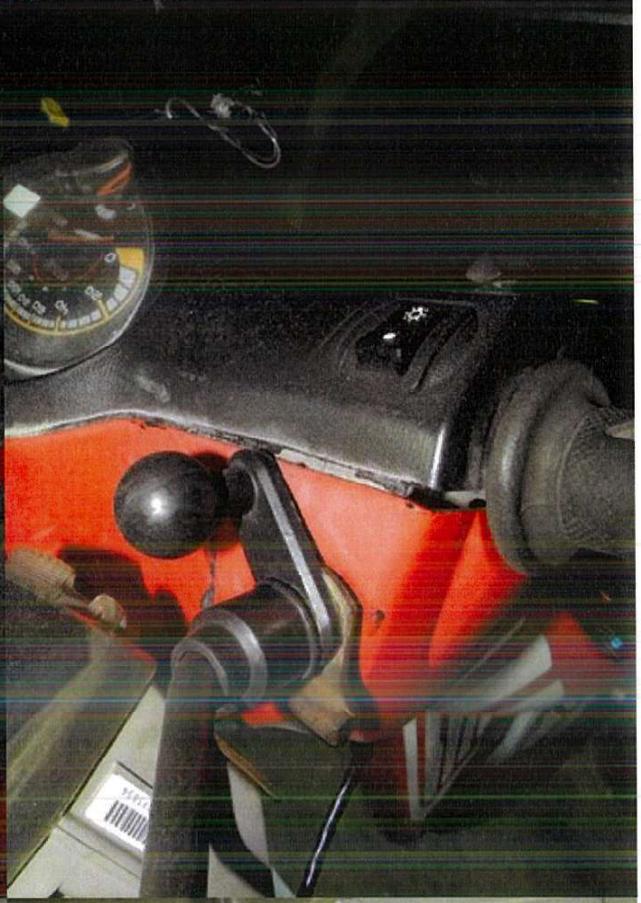


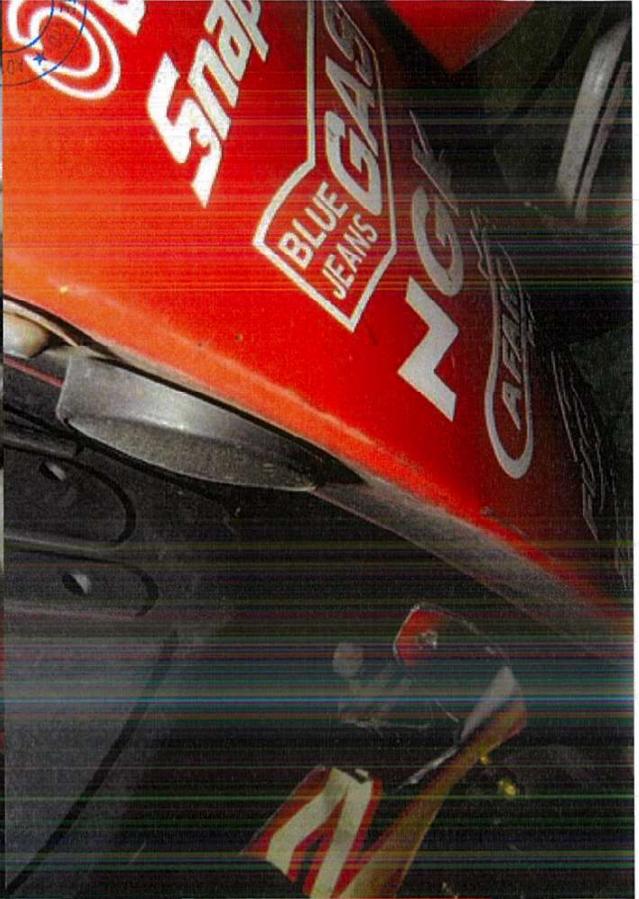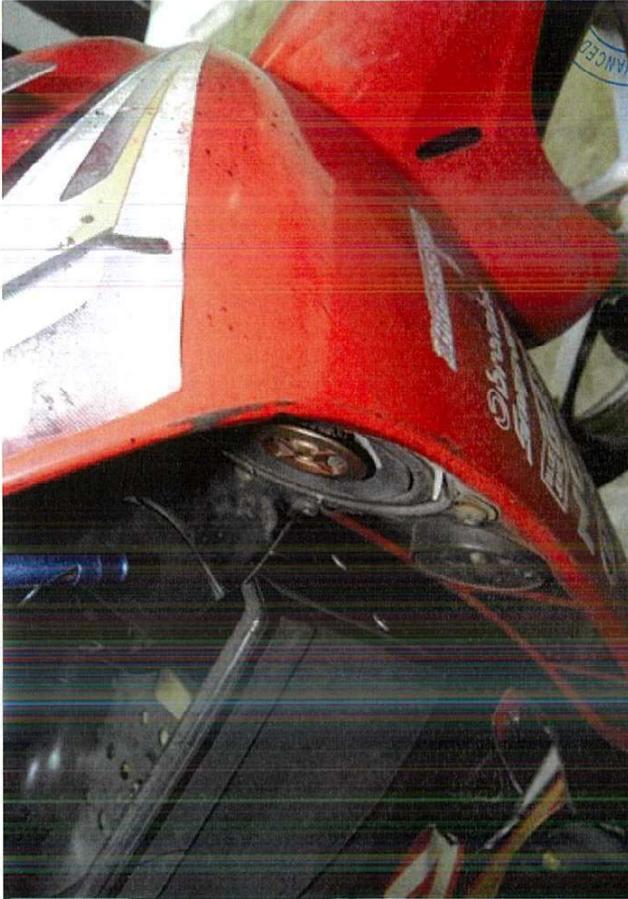


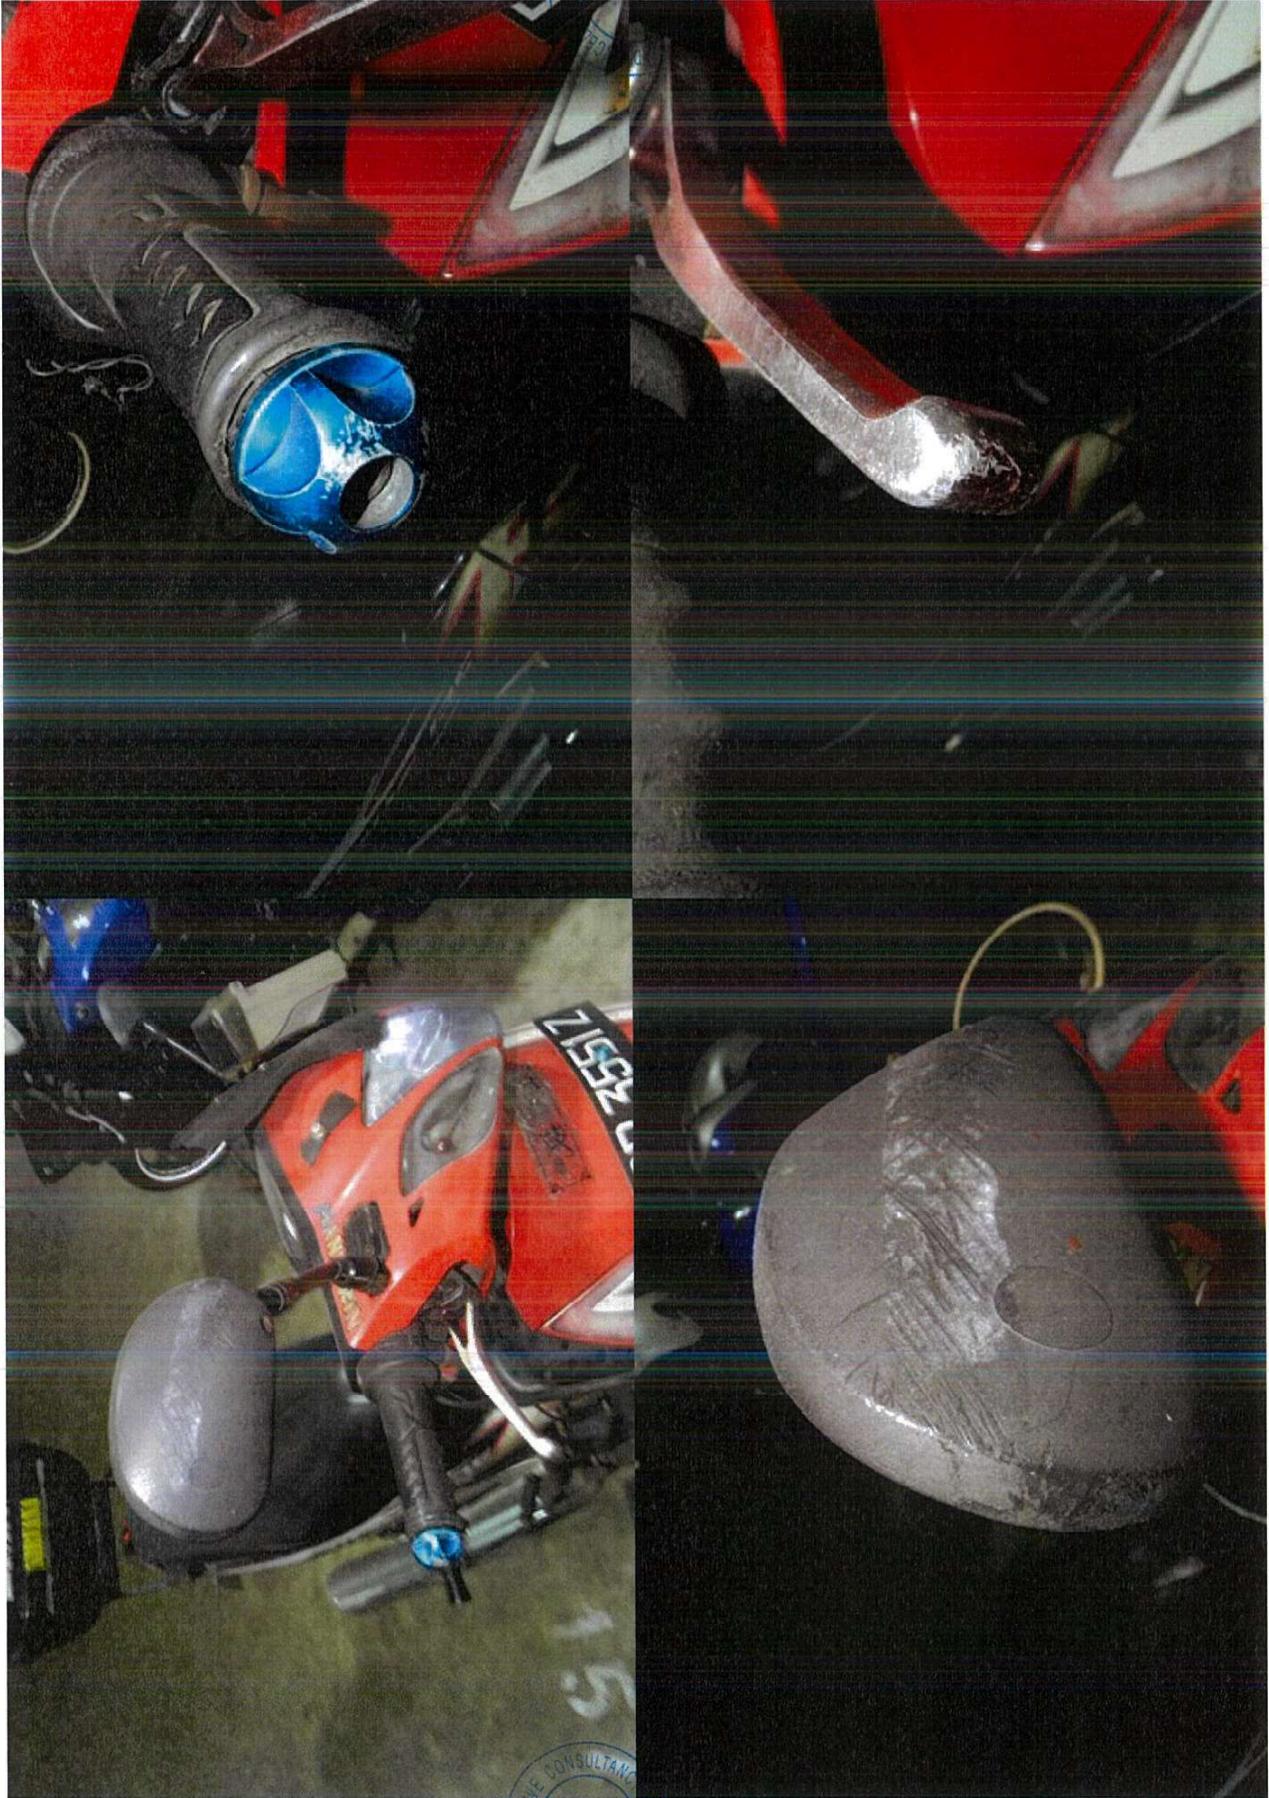


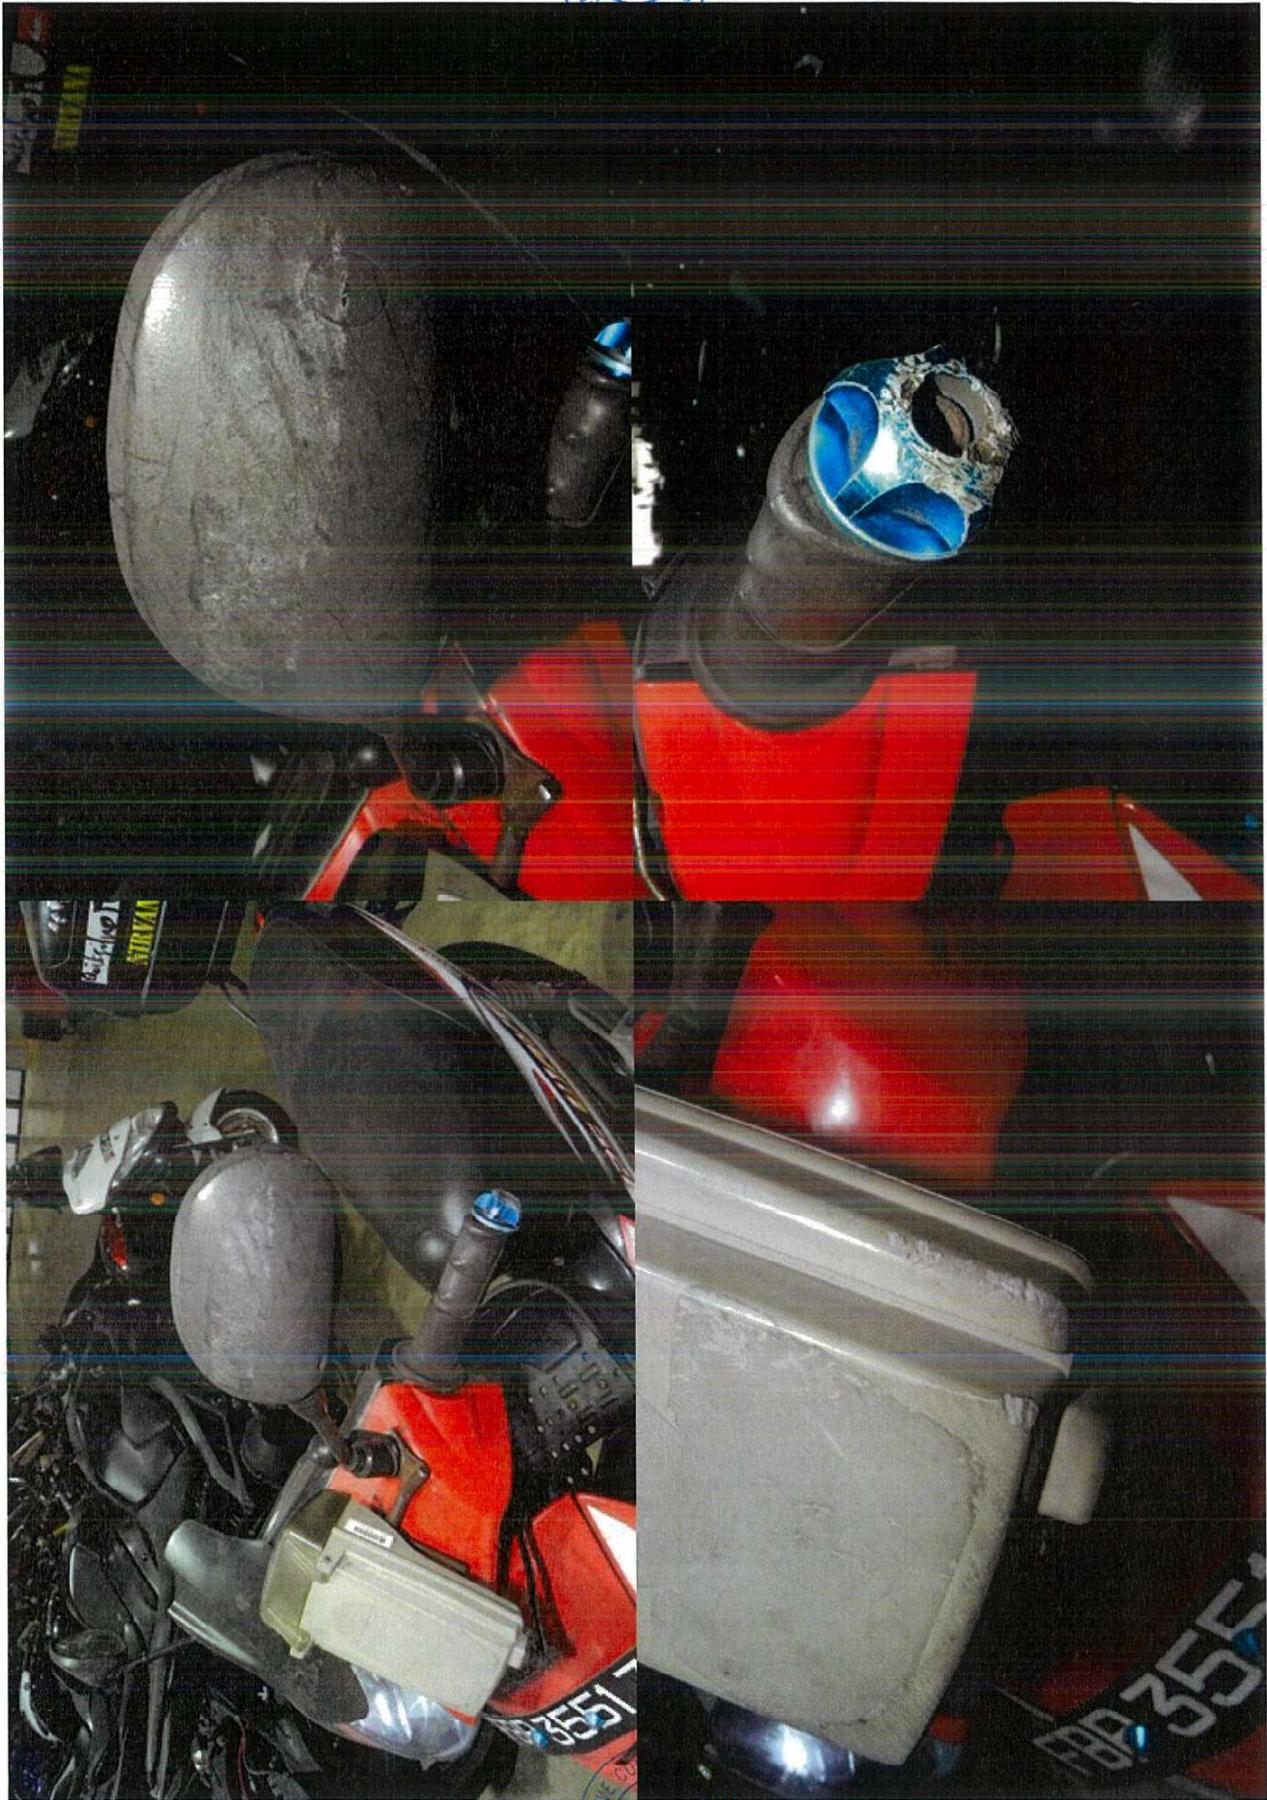

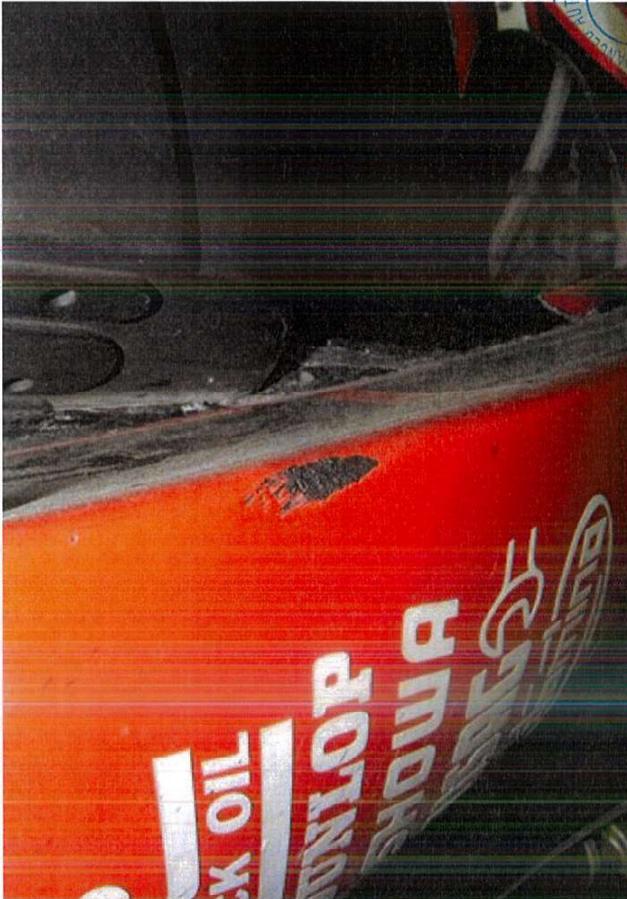

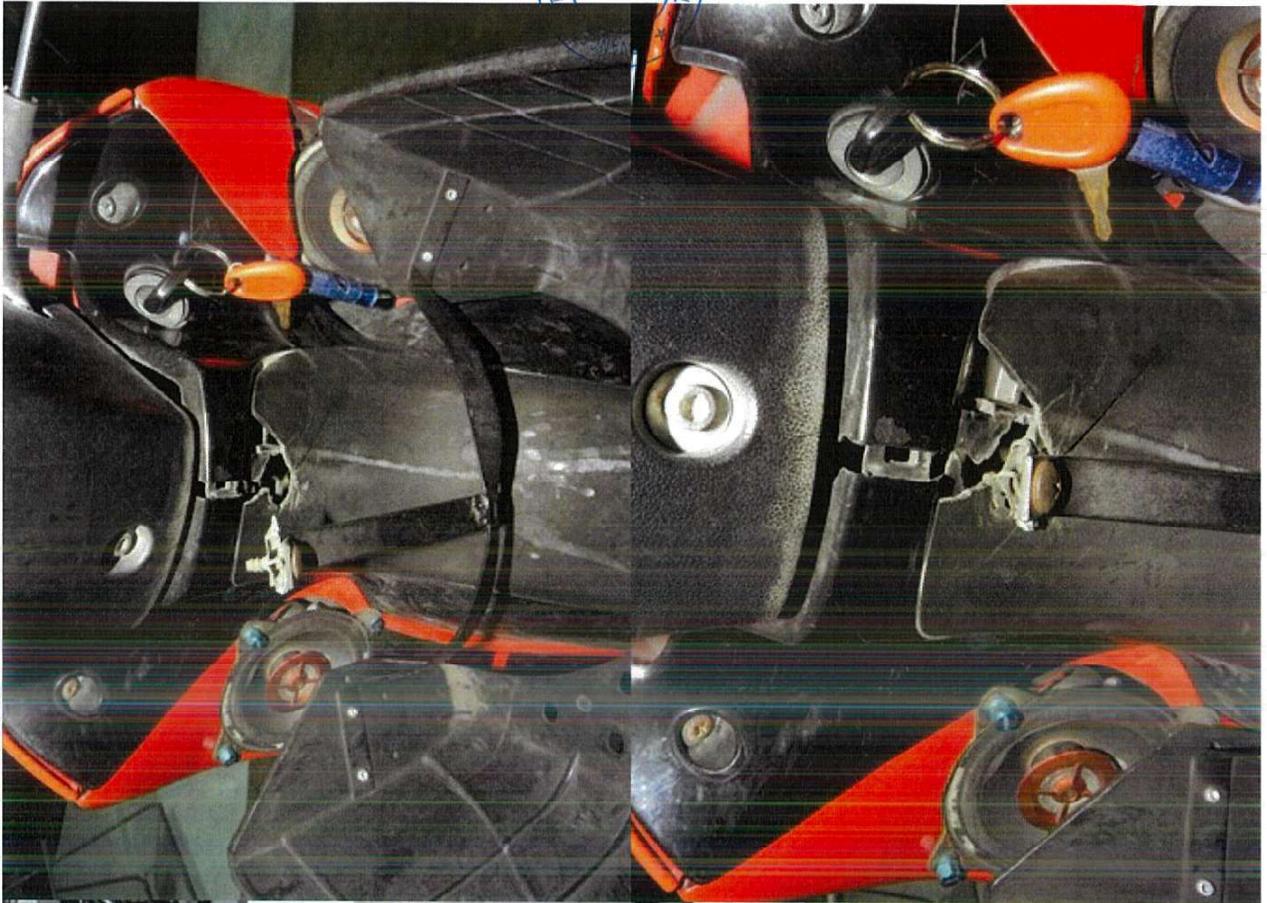



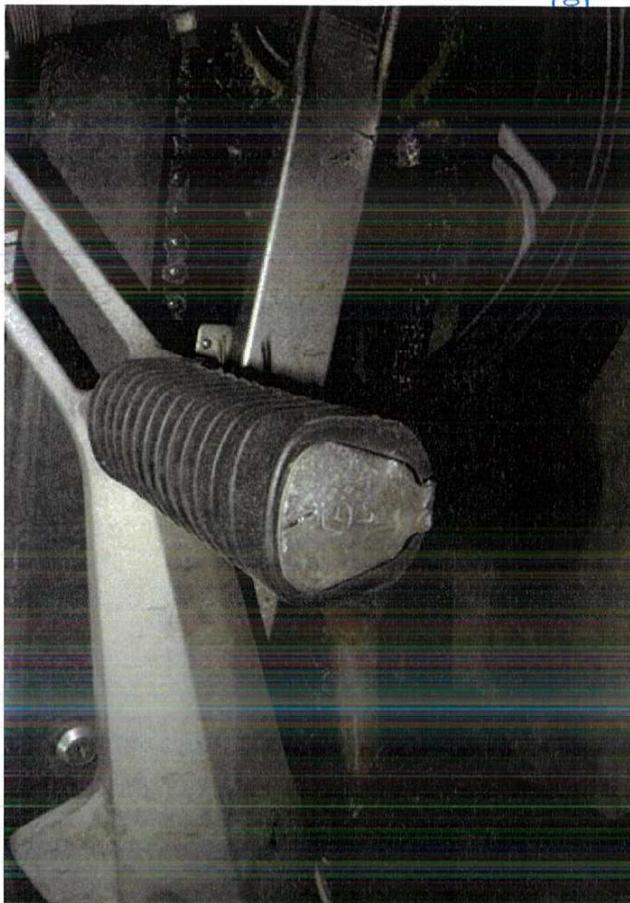


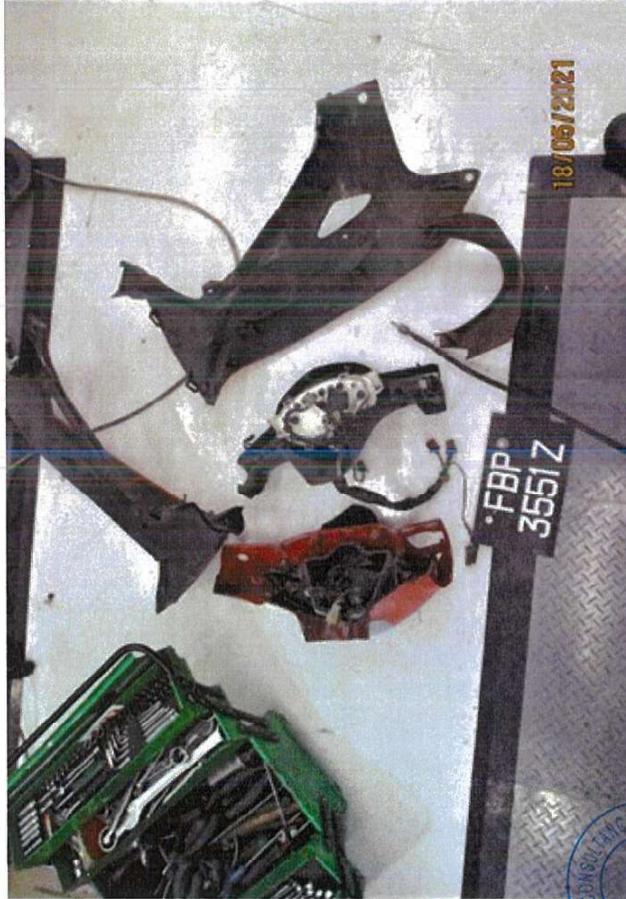




24/05/2021



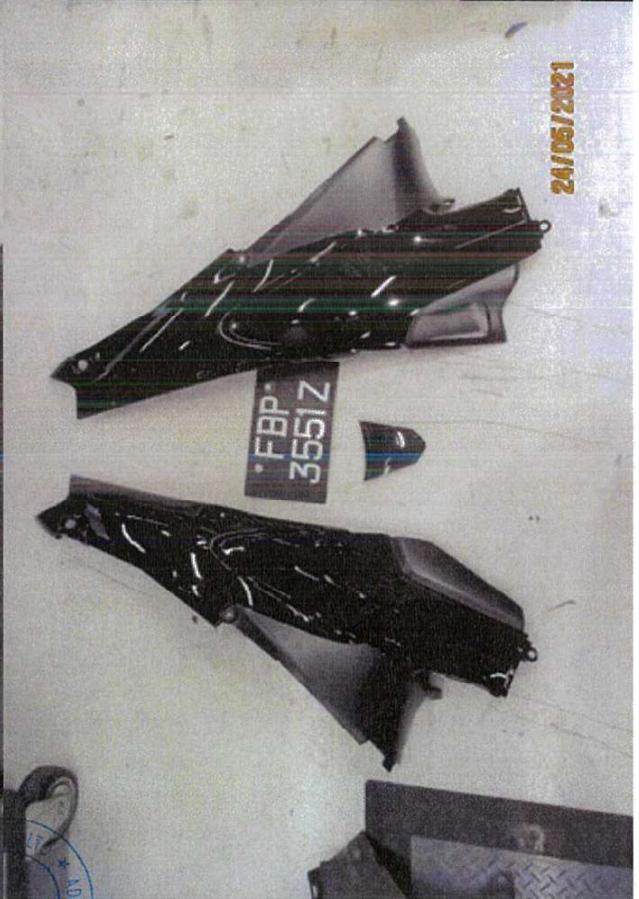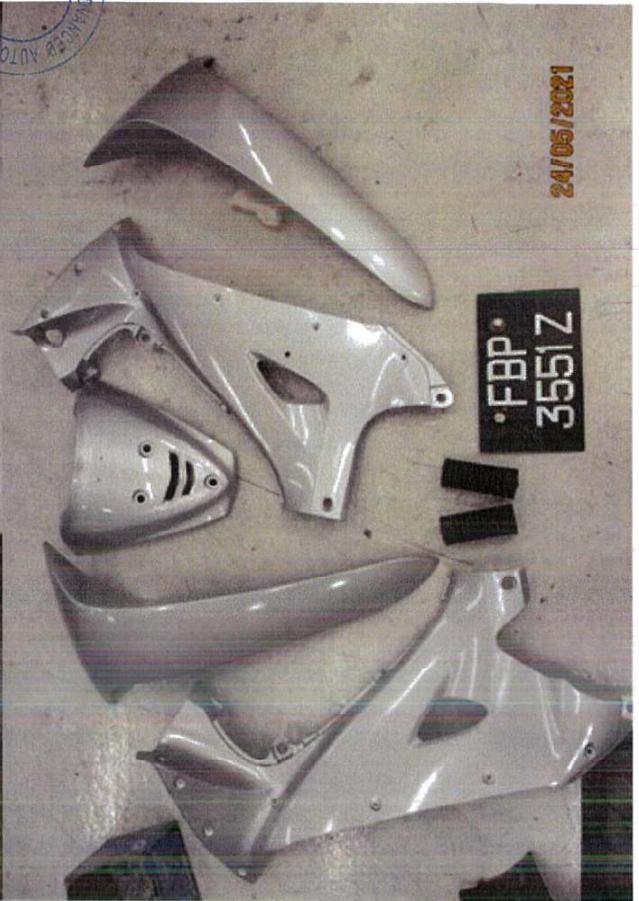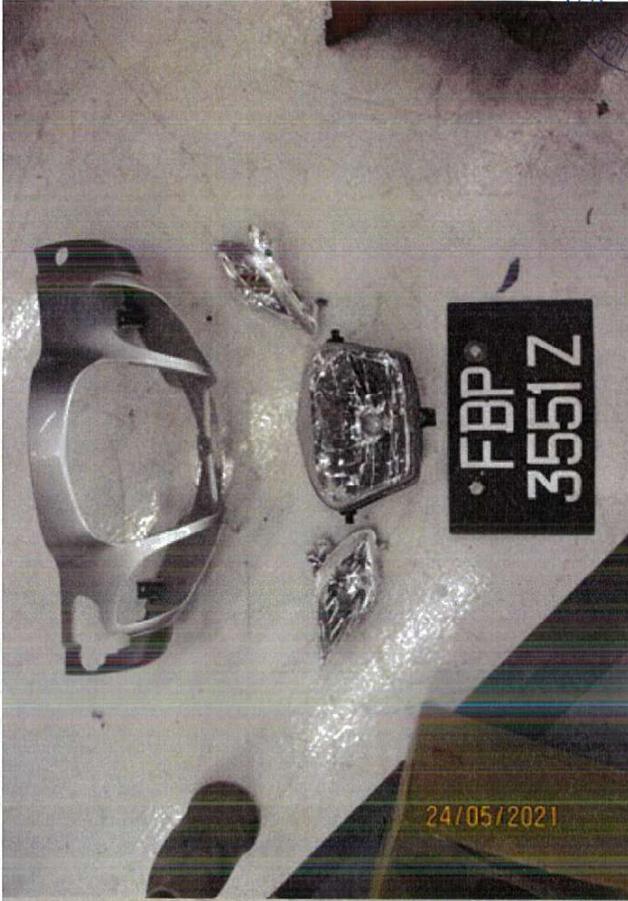



25/05/2021

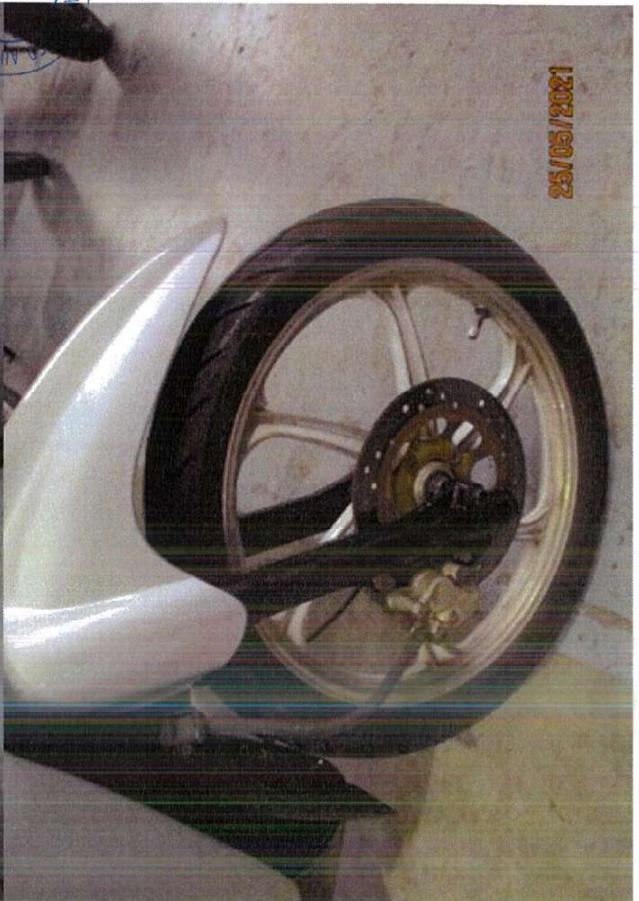

25/05/2021



24/06/2021




24/05/2021





25/06/2021

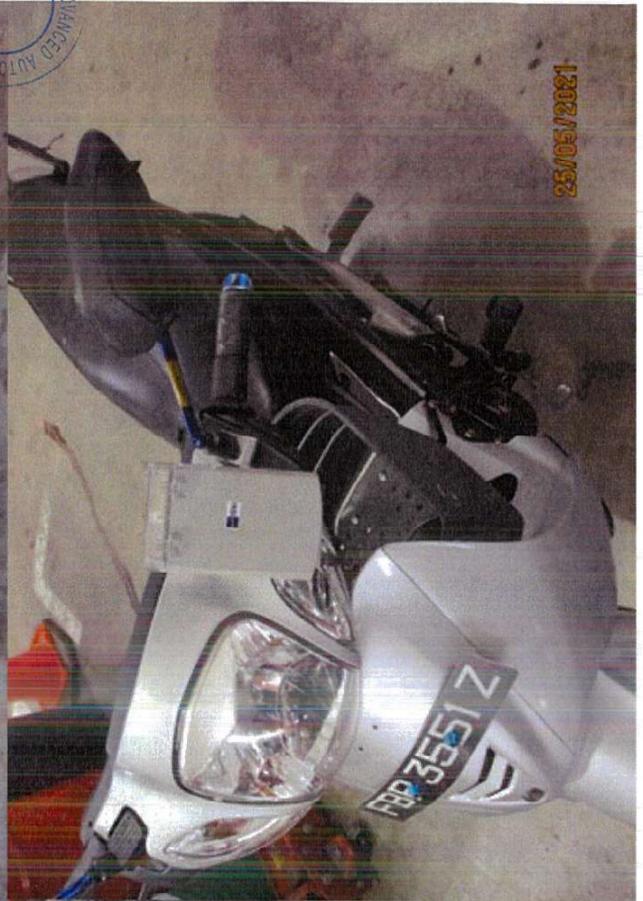

25/06/2021




25/06/2021



25/06/2021



25/05/2021

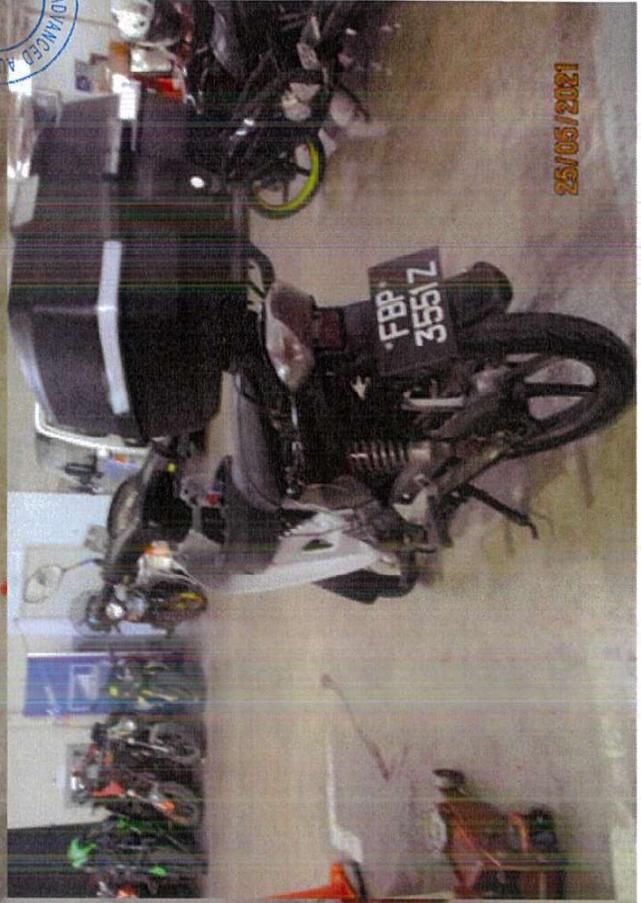

25/05/2021



25/05/2021



25/05/2021

