

AUTO PERFORMANCE APPRAISAL

APA

TAX INVOICE

Tan Kang Juat
C/O Guan Auto Service
Blk 7 Sin Ming Industrial Estate Sector C
#01-80/#01-82
Singapore 575642

INVOICE NO : APA22002389

DATE : 31/05/2022

VEHICLE NO : SGV1233P

JOB REFERENCE NO : 22/002501

ACCIDENT DATE : 18/05/2022

SURVEY DATE : 19/05/2022

| <u>DESCRIPTION</u> | <u>AMOUNT</u> |
|--|-----------------|
| Survey Fees Inclusive Of Transportation | \$525.00 |
| Photographs (\$1) Per Copies : 73 | \$73.00 |
| TOTAL AMOUNT | \$598.00 |

Notes :

All cheque payment should be "Crossed" and made payable to "Auto Performance Appraisal"

Auto Performance Appraisal



AUTO PERFORMANCE APPRAISAL

APA

| VEHICLE SURVEY REPORTS | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|--|---|-----------------|---------------------|--|---------------------|---------------|-----------------|---------------------|--|--------|-------------|----------|------|--|--|--|--|--|--|--------------|-------------|-------------|---------------------|--|-----------|-------------|-----------|---|--|-----------|-------------|-----------|---|--|----------|-------------|-----------|---|--|----------|-------------|-----------|---|--|
| Tan Kang Juat C/O Guan Auto Service Blk 7 Sin Ming Industrial Estate Sector C #01-80/#01-82 Singapore 575642 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 1 | Reference Job Reference No : 22/002501 Claim No : - Claim Type : Third Party Accident Date : 18/05/2022 Survey Date : 19/05/2022 Survey Report Date : 31/05/2022 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 2 | Particulars Of Vehicle Vehicle Registration No : SGV1233P Make & Model : Honda Accord Euro R Vehicle Registration Date : 18/05/2007 Chassis No : CL71300861 Engine No : Blocked Colour : Red | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 3 | Condition Of Vehicle And Tyres <table border="0" style="width: 100%;"> <tr> <td style="text-align: center;"><u>Mileage (KM)</u></td> <td style="text-align: center;"><u>Brakes</u></td> <td style="text-align: center;"><u>Steering</u></td> <td colspan="2" style="text-align: center;"><u>Modification</u></td> </tr> <tr> <td style="text-align: center;">254101</td> <td style="text-align: center;">Serviceable</td> <td style="text-align: center;">Affected</td> <td colspan="2" style="text-align: center;">None</td> </tr> <tr> <td colspan="5"> </td> </tr> <tr> <td style="text-align: center;"><u>Tyres</u></td> <td style="text-align: center;"><u>Make</u></td> <td style="text-align: center;"><u>Size</u></td> <td colspan="2" style="text-align: center;"><u>Balance (MM)</u></td> </tr> <tr> <td>Front RHS</td> <td>Bridgestone</td> <td>225/45R17</td> <td colspan="2" style="text-align: center;">5</td> </tr> <tr> <td>Front LHS</td> <td>Bridgestone</td> <td>225/45R17</td> <td colspan="2" style="text-align: center;">5</td> </tr> <tr> <td>Rear RHS</td> <td>Bridgestone</td> <td>225/45R17</td> <td colspan="2" style="text-align: center;">6</td> </tr> <tr> <td>Rear LHS</td> <td>Bridgestone</td> <td>225/45R17</td> <td colspan="2" style="text-align: center;">6</td> </tr> </table> | | | | <u>Mileage (KM)</u> | <u>Brakes</u> | <u>Steering</u> | <u>Modification</u> | | 254101 | Serviceable | Affected | None | | | | | | | <u>Tyres</u> | <u>Make</u> | <u>Size</u> | <u>Balance (MM)</u> | | Front RHS | Bridgestone | 225/45R17 | 5 | | Front LHS | Bridgestone | 225/45R17 | 5 | | Rear RHS | Bridgestone | 225/45R17 | 6 | | Rear LHS | Bridgestone | 225/45R17 | 6 | |
| <u>Mileage (KM)</u> | <u>Brakes</u> | <u>Steering</u> | <u>Modification</u> | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 254101 | Serviceable | Affected | None | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| <u>Tyres</u> | <u>Make</u> | <u>Size</u> | <u>Balance (MM)</u> | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Front RHS | Bridgestone | 225/45R17 | 5 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Front LHS | Bridgestone | 225/45R17 | 5 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Rear RHS | Bridgestone | 225/45R17 | 6 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Rear LHS | Bridgestone | 225/45R17 | 6 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 4 | Description Of Damages The vehicle sustained damages at front right hand portion. (For information of damages please refer to Parts/Labour/Photographs attached) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 5 | Instruction This survey was conducted entirely on a "WITHOUT PREJUDICE" basis, and we have not authorised any repair. | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |

AUTO PERFORMANCE APPRAISAL

Annex A

Vehicle Assessment Reports

Ref No : 22/002501

Damage And Repair Cost Adjustment

| <u>S/No</u> | <u>Qty</u> | <u>Parts Description</u> | <u>Comments/condition</u> | <u>Workshop Estimate (\$)</u> | <u>Our Assessment (\$)</u> |
|----------------------------------|------------|-------------------------------------|---------------------------|-------------------------------|----------------------------|
| <u>List Items</u> | | | | | |
| 1 | 1 | Front bumper | Deformed | 1,171.20 | 1,171.20 |
| 2 | 1 | Front bumper RH Fog lamp | Cut/grazed | 152.70 | 152.70 |
| 3 | 1 | Front bumper RH Fog lamp bracket | Bent | 52.30 | 52.30 |
| 4 | 1 | Front bumper RH side retainer | Deformed/broken | 62.00 | 62.00 |
| 5 | 1 | Front bumper RH side beam | Bent | 87.90 | 87.90 |
| 6 | 1 | Front bumper inner reinforcement | Buckled/bent | 232.30 | 232.30 |
| 7 | 1 set | Front bumper clips | Broken/necessary | 40.00 | 40.00 |
| 8 | 1 | Front grille | To repair | 272.60 | - |
| 9 | 1 | RH headlamp (HID) | Smashed/broken | 1,151.40 | 1,151.40 |
| 10 | 1 | RH headlamp bulb | Malfunction | 84.60 | 84.60 |
| 11 | 1 | RH headlamp ballast | Malfunction | 152.70 | 152.70 |
| 12 | 1 | Font bonnet | Broken | 834.60 | 834.60 |
| 13 | 1 | Front support panel | Badly dented/bent | 678.50 | 678.50 |
| 14 | 1 | Front support panel top cover | Deformed/broken | 113.20 | 113.20 |
| 15 | 1 set | Front support panel top cover clips | Necessary | 30.00 | 30.00 |
| 16 | 1 | Front RH fender | Buckled | 911.20 | 911.20 |
| 17 | 1 | Front RH fender top moulding | Deformed/bent | 78.30 | 78.30 |
| 18 | 1 | Front RH fender under shield | Deformed/broken | 127.60 | 127.60 |
| 19 | 1 set | Front fender under shield clips | Broken/necessary | 40.00 | 40.00 |
| 20 | 1 | Front bonnet lock | Serviceable/reuse | 89.70 | - |
| 21 | 1 | Front RH shock absorber | Serviceable/reuse | 438.90 | - |
| 22 | 1 | Front RH knuckle arm | Bent | 633.70 | 633.70 |
| 23 | 1 | Front RH wheel hub | Bent | 235.60 | 235.60 |
| 24 | 1 | Front RH wheel bearing | Noisy/necesssary | 130.30 | 130.30 |
| | | | | 7,801.30 | 7,000.10 |
| Less discount 20% | | | | 1,560.26 | 1,400.02 |
| Total : | | | | 6,241.04 | 5,600.08 |
| <u>Special Nett Items</u> | | | | | |
| 25 | 1 | Front bumper lower skirting | To repair | 800.00 | - |
| 26 | 1 | Front RH sport rim | Cut/warped | 550.00 | 550.00 |
| | | | | 1,350.00 | 550.00 |
| Total Spare Parts : | | | | 7,591.04 | 6,150.08 |

AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Annex B

Ref No : 22/002501

Damage And Repair Cost Adjustment

| <u>Items</u> | <u>Job Description</u> | <u>Workshop Estimate (\$)</u> | <u>Adjusted Costs (\$)</u> |
|----------------------|--|-------------------------------|----------------------------|
| 1 | To tow vehicle to workshop. | 80.00 | 80.00 |
| 2 | To remove, cut out damage portion, jack out, straighten, panel beating, welding, align and renew replaced parts. | 1,000.00 | 700.00 |
| 3 | To putty and respray painting on affected areas. | 1,200.00 | 800.00 |
| 4 | To check wirings and lightings. | 50.00 | 30.00 |
| 5 | To remove, refix aircon condenser, pipes, drier vacuum and recharge gas. | 150.00 | 120.00 |
| 6 | To remove, refix front RH under carriages. | 150.00 | 120.00 |
| 7 | To conduct computerise wheel alignment test. | 80.00 | 60.00 |
| 8 | To supplied and applied anti rust treatments. | 100.00 | 60.00 |
| Total Labour : | | <u>2,810.00</u> | <u>1,970.00</u> |
| Total Spare Parts : | | 7,591.04 | 6,150.08 |
| Total Labour : | | 2,810.00 | 1,970.00 |
| Total Repair Costs : | | <u>10,401.04</u> | <u>8,120.08</u> |

Assessor's Recommendation

| | |
|---------------------|------------------|
| Repairer Estimate : | <u>10,401.04</u> |
| Our Adjustment : | <u>8,120.08</u> |

Remarks

The repairer has agreed to undertake the repair on a lump sum basis of \$6,500.00, with a repair period of 6 working days.

Surveyed By:



Lek Boon Hwee
Automobile Appraiser

GUAN AUTO SERVICE

Blk 7 Sin Ming Industrial Estate Sector C
#01-82 Singapore 575642

FINAL BILL

Tan Kang Juat
c/o Blk 7 Sin Ming Industrial Estate Sector C
#01-82 Singapore 575642

| | |
|-----------|------------|
| Our Ref. | SGV1233P |
| Your Ref: | - |
| Date | 2-Jun-2022 |

| No. | Description | Qty | Unit Price | Total |
|-----|--|-----|-------------------|-------------------|
| | To supply labour and materials to repair below mentioned vehicle to its pre-accident condition. Vehicle: <u>SGV1233P</u> Make/Model: <u>Honda Accord</u> Accident Date: <u>18-May-22</u> | | | \$6,500.00 |
| | | | Amount Due | \$6,500.00 |



A handwritten signature in black ink, appearing to read "Kang Juat".

Authorised Signatory